



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** **



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123



CASE SUMMARY

PSU 75 CASE NO. 158A TYPE OF ACCIDENT Pickup/Utility Veh.-Angle impact

A. DESCRIPTION OF THE ACCIDENT SEQUENCE AND ACCIDENT PECULIARITIES

(Provide a summary of the accident sequence as well as any particular event of the accident that is noteworthy. Injury mechanism and vehicle crashworthiness is the focus, not driver culpability. Do not include any personal identifiers.)

See attached

B. VEHICLE PROFILE(S)

Vehicle No.	Class of Vehicle	Year/Make/Model	Most Severe Damage Based on Vehicle Inspection		Component Failure
			Damage Plane	Severity Description	

DO NOT SANITIZE THIS FORM

C. PERSON PROFILE(S)

Vehicle No.	Person Role	Seat Position	Restraint Use	Most Severe Injury (TO BE COMPLETED BY ZONE CENTER)			
				Body Region	Injury Type	AIS	Injury Source

Body Region

Abdomen
 Ankle-foot
 Arm (upper)
 Back-thoracolumbar spine
 Brain
 Chest
 Ears
 Eye
 Elbow
 Face
 Forearm
 Head-skull
 Heart
 Kidneys
 Knee
 Leg (lower)
 Liver
 Lower limbs(s) (whole or unknown part)
 Mouth
 Neck-cervical spine
 Nose

Pelvic-hip
 Pulmonary-lungs
 Shoulder
 Spleen
 Thigh
 Thyroid, other endocrine gland
 Upper limb(s) (whole or unknown part)
 Vertebrae
 Whole body
 Wrist-hand

Injury Type

Abrasion
 Amputation
 Avulsion
 Burn
 Concussion
 Contusion
 Crush
 Detachment, separation
 Dislocation

Fracture
 Fracture and dislocation
 Laceration
 Other
 Perforation, puncture
 Rupture
 Sprain
 Strain
 Total severance, transection
 Unknown

Abbreviated Injury Scale

- (1) Minor injury
- (2) Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity

DO NOT SANITIZE THIS FORM

PSU75
CASE 158A

1996 Case Summary Form

TYPE OF ACCIDENT: PICKUP/UTILITY VEH.-ANGLE IMPT

A. DESCRIPTION OF THE ACCIDENT SEQUENCE AND ACCIDENT PECULIARITIES

VEHICLE NUMBER ONE WAS NORTHBOUND ON A TWO LANE, TWO-WAY STATE HIGHWAY. THE ROADWAY WAS WET WITH SLUSH PILED ALONG THE ROAD EDGE AND ACCUMULATED ALONG THE CENTER LANE LINE. VEHICLE NUMBER ONE WAS PULLING A SMALL HOME-MADE TRAILER HAULING A MOTORCYCLE. VEHICLE NUMBER TWO WAS SOUTHBOUND ON THE SAME ROADWAY. THE TRAFFIC VOLUME WAS FAIRLY HEAVY AND TRAFFIC WAS TRAVELING AT THE MAXIMUM SPEED LIMIT. AS V#1 CONTINUED NORTHBOUND THE TRAILER STARTED TO FISHTAIL BACK AND FORTH. THEN THE MOMENTUM OF THE TRAILOR CAUGHT UP WITH THE PICKUP AND CAUSED THE PICKUP TO ROTATE CCW AND ENTERED THE SOUTHBOUND TRAVEL LANE. THEN THE RIGHT FRONT OF V#1 CONTACTED THE FRONT LEFT OF V#2. V#1 ROTATED COUNTER CLOCKWISE AS IT ENGAGED THE LEFT SIDE OF V#2. THEN V#1 TRAVELED OFF THE WEST SIDE OF THE ROAD AND CAME TO REST PARTIALLY ON THE DIRT SHOULDER FACING WEST. AFTER IMPACT V#2 WENT OFF THE RIGHT SIDE OF THE ROAD AND ROLLED TWO QUARTER TURNS TO THE RIGHT AND CAME TO REST ON ITS ROOF FACING SOUTHEAST. BOTH VEHICLES WERE TOWED FROM THE SCENE AND THE OCCUPANT OF V#2 WAS TRANSPORTED. THE DRIVER OF V#2 DIED AT THE SCENE.

01

PSU75

1996 Case Summary Form

CASE 158A

TYPE OF ACCIDENT: PICKUP/UTILITY VEH.-ANGLE IMPT

B. VEHICLE PROFILE(S)

V e h. No	Class of Vehicle	Year/Make/ Model	Most Severe Damage Based on Vehicle Inspection		
			Damage Plane	Severity Descr.	Component Failure
01	CHASSIS CAB PICKUP	1996/DODGE/RAM 2500	FRONT	MODERATE	NONE
02	UTILITY STATION WGN	1996/CHEVROLET/ SUBURBAN	LEFT	MODERATE	NONE

01

PSU75

1996 Case Summary Form

CASE 158A

TYPE OF ACCIDENT: PICKUP/UTILITY VEH.-ANGLE IMPT

C. PERSON PROFILE(S)

Most Severe Injury
(TO BE COMPLETED BY ZONE CENTER)

V e h. No	Person Role	Seat Positon	Restraint Use	Body Region	Injury Type	Most Severe Injury (TO BE COMPLETED BY ZONE CENTER)	
						A I S	Injury Source
01	DRIVER	LEFT FRONT	L & S W/ AIR BAG	WRIST	FRACTURE	2	DOOR PANEL
02	DRIVER	LEFT FRONT	L & S W/ AIR BAG	LUNGS	UNKNOWN	3	DOOR PANEL
02	PASS	RIGHT FRONT	L & S	HEART	CONTUSION	3	DOOR PANEL

0




ACCIDENT COLLISION DIAGRAM


NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

PSU No. 75

Case Number—Stratum 158A

Indicate North

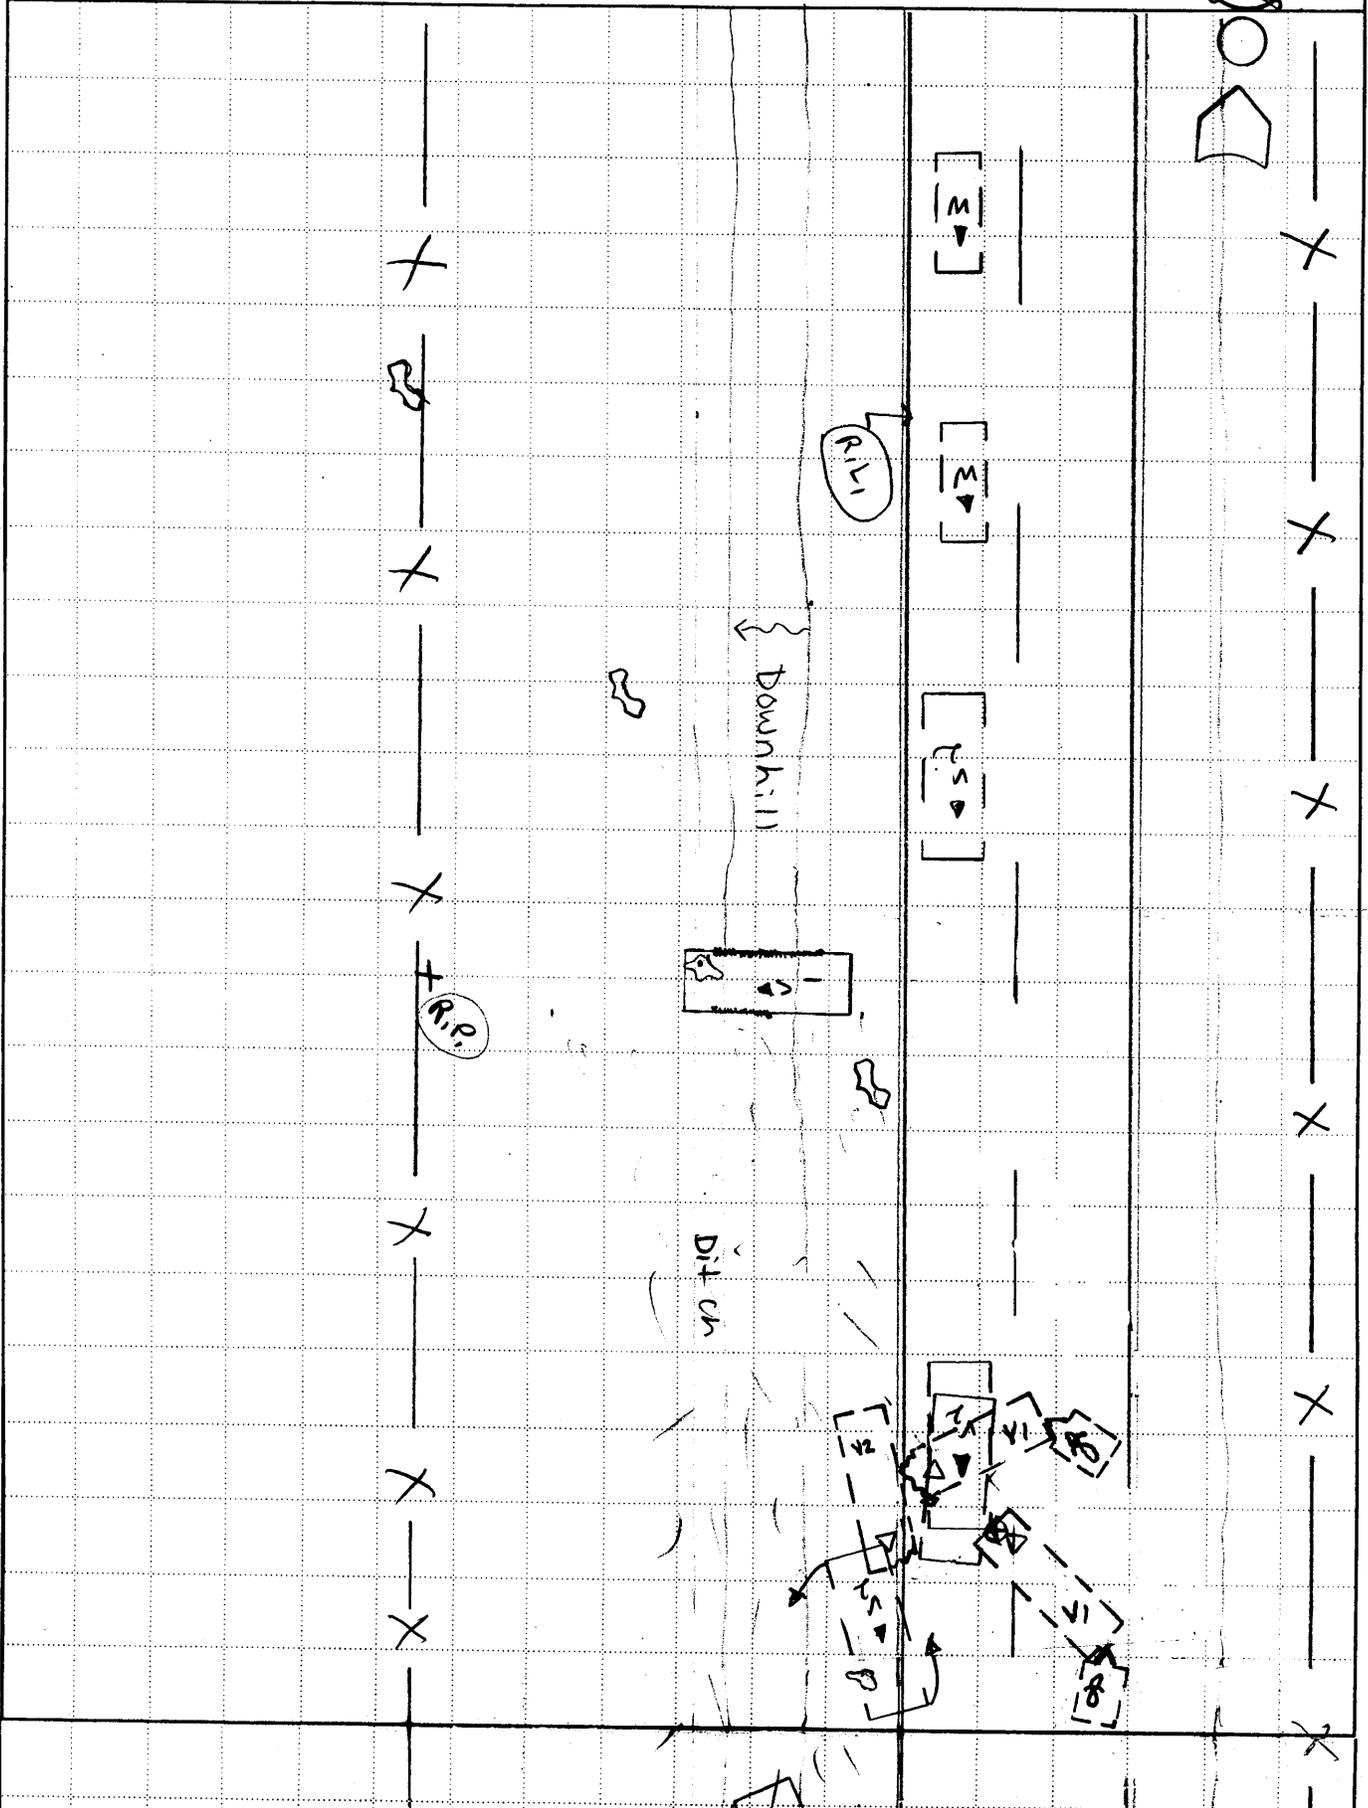

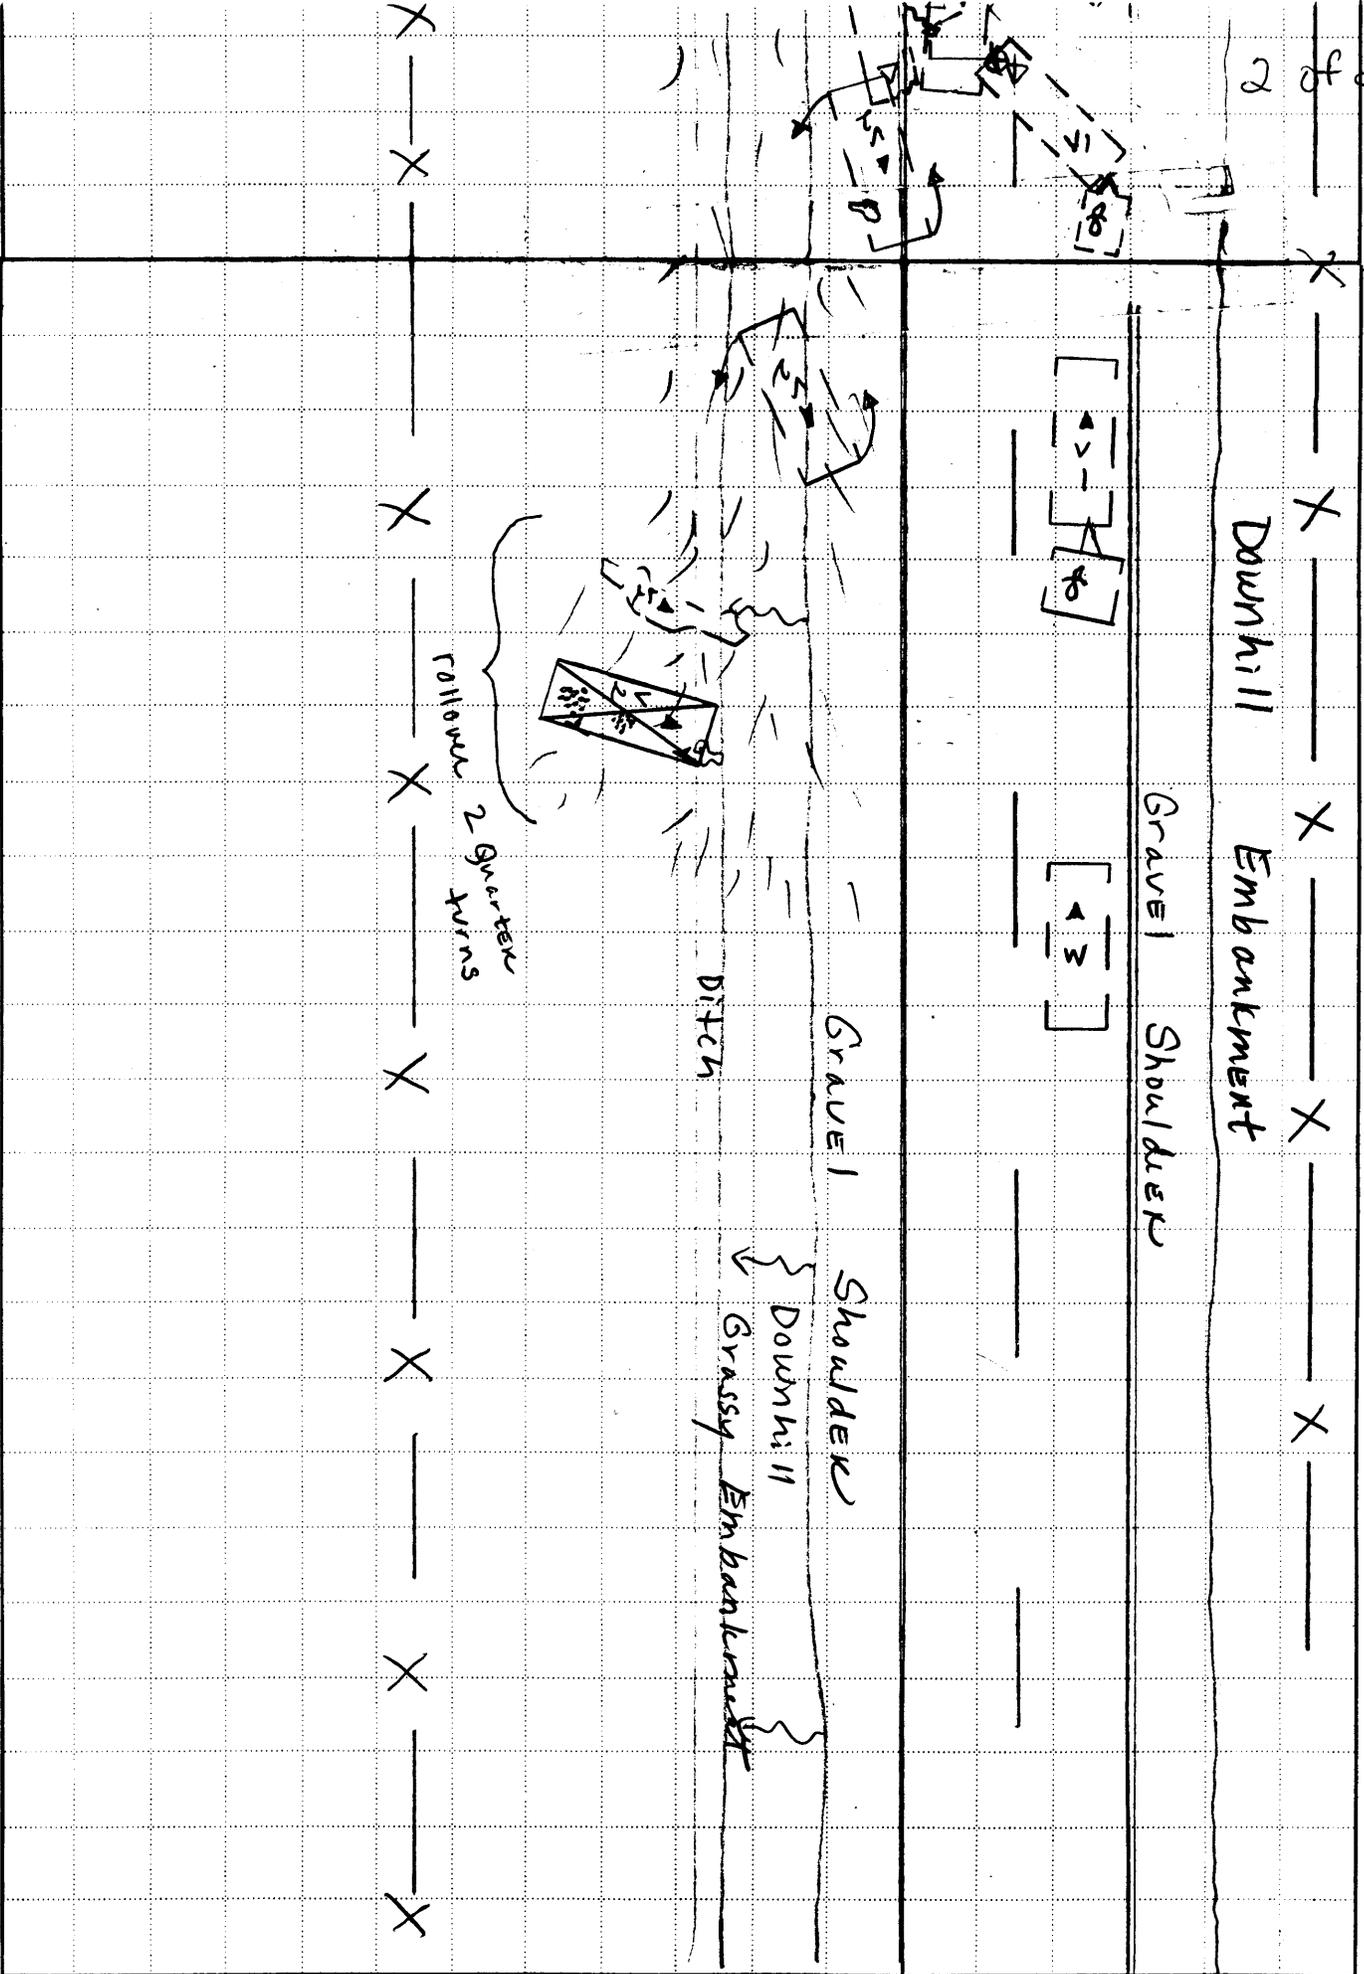


Scene Located at 0.6m of [redacted]

ACCIDENT COLLISION DIAGRAM

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

PSU No. 75 Case Number - Stratum 158A Indicate North 

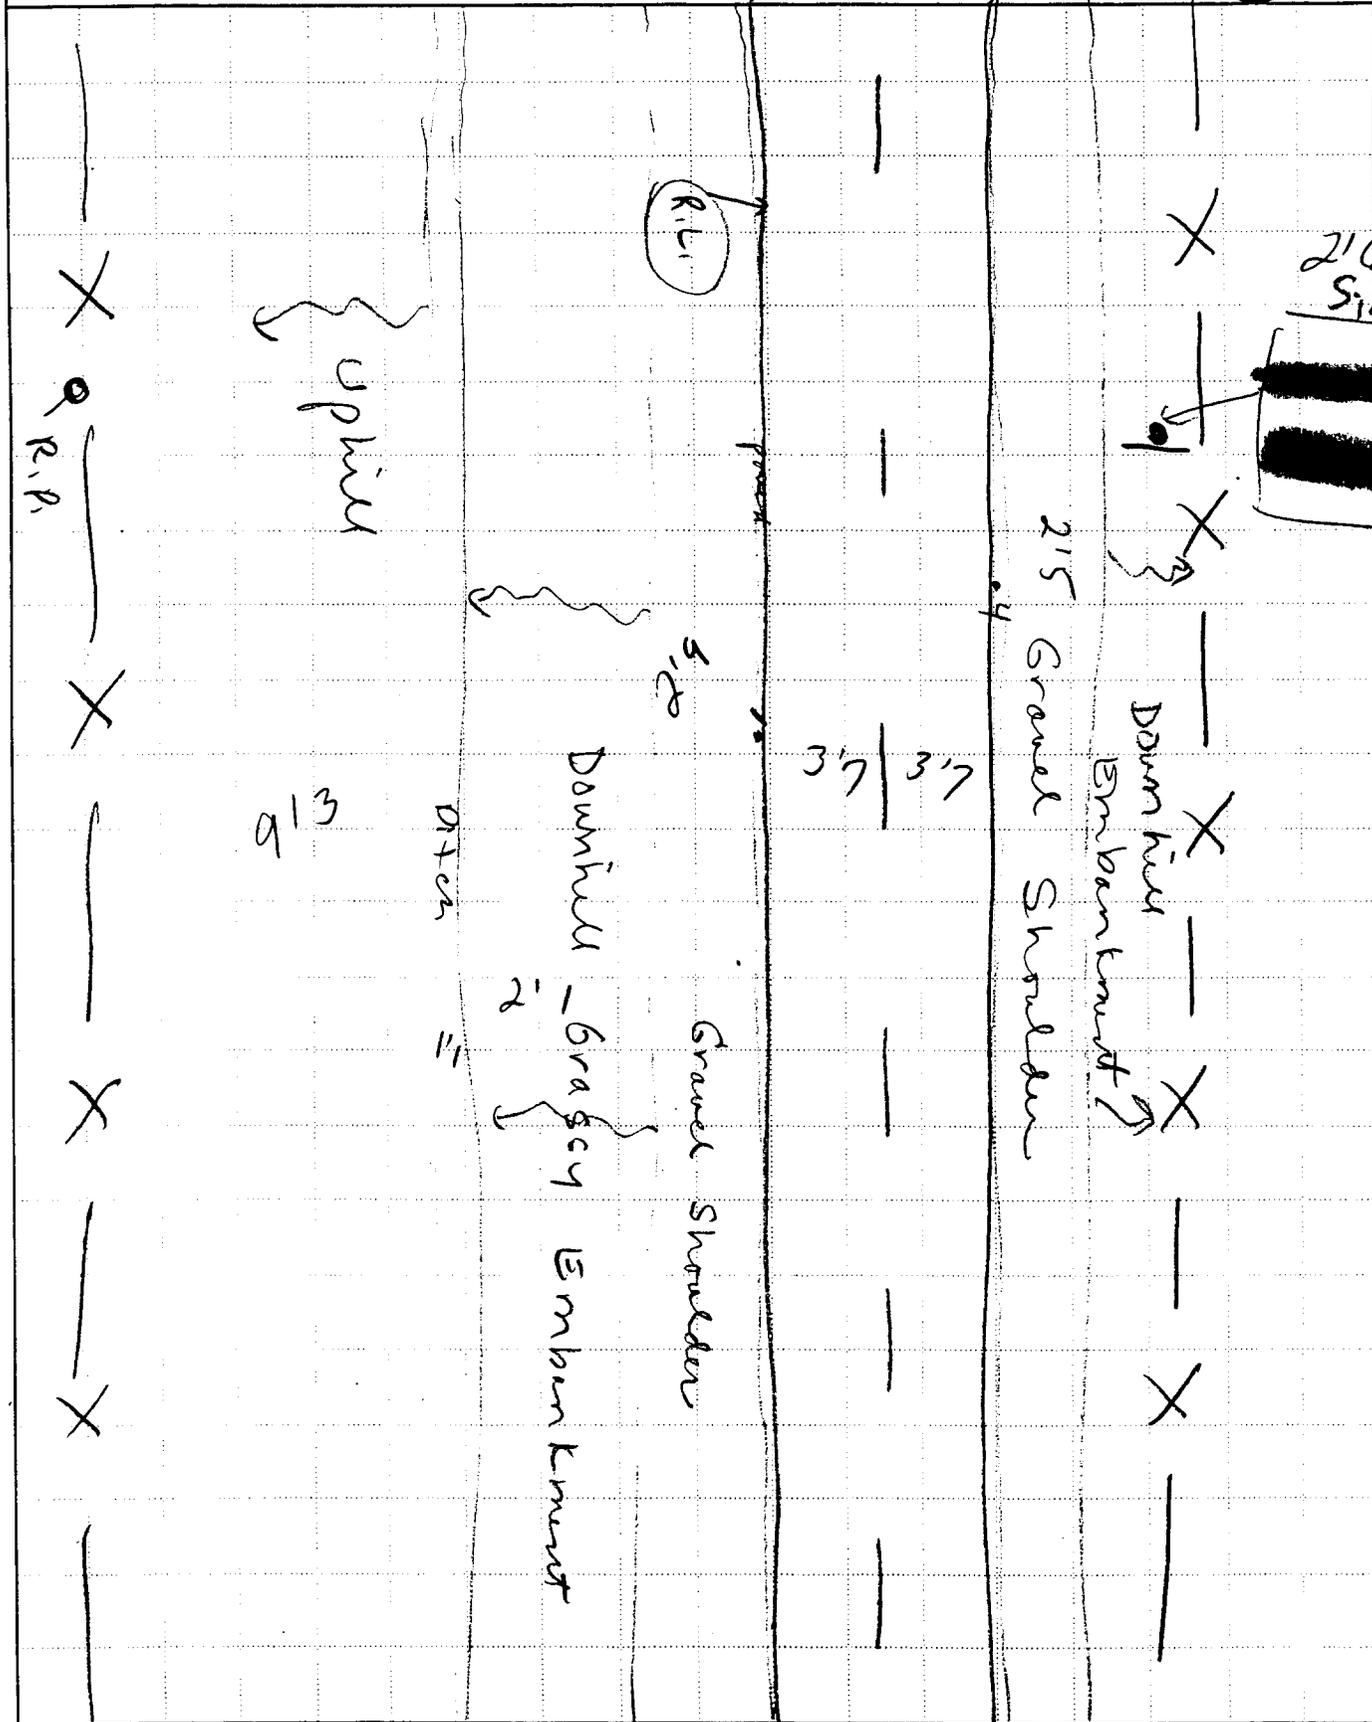

ACCIDENT COLLISION MEASUREMENT TABLE

2pm

Primary Sampling Unit Number 75

Case Number - Stratum 158A

ACCIDENT COLLISION DIAGRAM

Document the physical plant:

- all road/roadway delineation (e.g., curbs/edge lines, lane markings, median markings, pavement markings, parked vehicles, poles, signs, etc.)
- all traffic controls (e.g., signs/signals, etc.)
- north arrow placed on diagram
- roadway surface type and condition of applicable roadways
- grade measurements for all applicable roadways and at location of rollover initiation
- roadway curvature (include measurement of precrash superelevation for each vehicle if applicable)

06 N of Co. [redacted]

Document vehicle dynamics including:

- reference point and reference line relative to physical features present at the scene
- scaled documentation of all accident induced physical evidence
- scaled documentation of all roadside objects contacted
- scaled representations of the vehicle(s) at pre-impact, impact, and final rest based upon either:
 - a) physical evidence, or
 - b) reconstructed accident dynamics

SL=SS

CRASH DATA

	VEH. #1	VEH. #2	VEH. #3
Heading Angle	-63°	180°	
Surface Type	Bituminous		
Surface Condition	Slushy →		
Coefficient of Friction	.20	.20	
Grade (v/h) Measurement (between impact and final rest)	9/122 9/122		
Grade (v/h) Measurement (at location of rollover initiation)	X 8/122 ↑		
Grade (v/h) Measurement (at pre-crash location)	2/122 9/122 ↓		

Reference Point: Telephone Cable Reference line: W. Road Edge
line marker on W. side of N1B [redacted] of N1B Co. [redacted]

Item	Distance and Direction from Reference Point	Distance and Direction from Reference Line
R.P.	—	15'7W ✓
V#1 F. Rest / Fluid Spill	.4 N	6'7W ✓
V#1 BRF Scuff	.9 N	2'8W ✓
E RF 00	.8 N	6'3W ✓
V1 B LF Scuff	.110 S	4'5W ✓
E LF	.9 S	6'4W ✓
Bag Debris	1'0 S	11'4 - 11'7W ✓
P.O.P.I. (per par)	18'3 S	3'0E ✓
Fluid Spill ??	23'0 S	1'4W ✓
Glass Area 1	39'8 S	10'8W ✓
" " #2	40'2 S	9'5W ✓
LF Tire v2) per	41'3 S	7'3W ✓
LR Tire v2) par	40'6 S	10'8W ✓



ACCIDENT FORM

1. Primary Sampling Unit Number 75
2. Case Number - Stratum 158A

IDENTIFICATION

3. Number of General Vehicle Forms Submitted 02
4. Date of Accident (Month, Day, Year) [REDACTED] 19 6
5. Time of Accident 0900
Code reported military time of accident.
NOTE: Midnight = 2400
Unknown = 9999

SPECIAL STUDIES - INDICATORS

Check (✓) each special study (SS15-SS18 below) that has been completed; code 1 for the checked special studies and 0 for the special studies not checked.

6. SS15 Administrative Use 0
7. SS16 Pedestrian Crash Data Study 0
(Data for this special study available in a separate file.)
8. SS17 Impact Fires 0
9. SS18 Unsafe Driver Actions 1
10. SS19 Run Off Road 0

NUMBER OF EVENTS

11. Number of Recorded Events in This Accident 03
02
Code the number of events which occurred in this accident.

ACCIDENT EVENTS

For each event that occurred in the accident, code the lowest numbered vehicle in the left columns and the other involved vehicle or object in the right columns.

Accident Event Sequence Number	Vehicle Number	Class Of Vehicle	General Area of Damage	Vehicle Number or Object Contacted	Class Of Vehicle	General Area of Damage
12. <u>0 1</u>	13. <u>0 1</u>	14. <u>45</u>	15. <u>F</u>	16. <u>02</u>	17. <u>16</u>	18. <u>KF</u>
19. 0 2	20. 0 1	21. 45	22. N	23. <u>34</u>	24. 00	25. N
26. <u>0 2</u>	27. <u>0 2</u>	28. <u>16</u>	29. <u>T</u>	30. <u>31</u>	31. <u>00</u>	32. <u>N</u>
33. <u>0 4</u>	34. <u> </u>	35. <u> </u>	36. <u> </u>	37. <u> </u>	38. <u> </u>	39. <u> </u>
40. <u>0 5</u>	41. <u> </u>	42. <u> </u>	43. <u> </u>	44. <u> </u>	45. <u> </u>	46. <u> </u>

IF GREATER THAN FIVE EVENTS, CONTINUE CODING ON THE ACCIDENT EVENT SUPPLEMENT

CODES FOR CLASS OF VEHICLE

- | | |
|--|---|
| (00) Not a motor vehicle
(01) Subcompact/mini (wheelbase < 254 cm)
(02) Compact (wheelbase ≥ 254 but < 265 cm)
(03) Intermediate (wheelbase ≥ 265 but < 278 cm)
(04) Full size (wheelbase ≥ 278 but < 291 cm)
(05) Largest (wheelbase ≥ 291 cm)
(09) Unknown passenger car size
(14) Compact utility vehicle
(15) Large utility vehicle (≤ 4,536 kgs GVWR)
(16) Utility station wagon (≤ 4,536 kgs GVWR)
(19) Unknown utility type
(20) Minivan (≤ 4,536 kgs GVWR)
(21) Large van (≤ 4,536 kgs GVWR)
(24) Van Based school bus (≤ 4,536 kgs GVWR)
(28) Other van type (≤ 4,536 kgs GVWR)
(29) Unknown van type (≤ 4,536 kgs GVWR)
(30) Compact pickup truck (≤ 4,536 kgs GVWR) | (31) Large pickup truck (≤ 4,536 kgs GVWR)
(38) Other pickup truck (≤ 4,536 kgs GVWR)
(39) Unknown pickup truck type (≤ 4,536 kgs GVWR)
(45) Other light truck (≤ 4,536 kgs GVWR)
(48) Unknown light truck type (≤ 4,536 kgs GVWR)
(49) Unknown light vehicle type
(50) School bus (excludes van based)(> 4,536 kgs GVWR)
(58) Other bus (> 4,536 kgs GVWR)
(59) Unknown bus type
(60) Truck (> 4,536 kgs GVWR)
(67) Tractor without trailer
(68) Tractor-trailer(s)
(78) Unknown medium/heavy truck type
(79) Unknown light/medium/heavy truck type
(80) Motored cycle
(90) Other vehicle
(99) Unknown |
|--|---|

CODES FOR GENERAL AREA OF DAMAGE (GAD)

- | | | | |
|-----------------------------------|--|---|---|
| CDS APPLICABLE AND OTHER VEHICLES | (O) Not a motor vehicle
(N) Noncollision
(F) Front | (R) Right side
(L) Left side
(B) Back | (T) Top
(U) Undercarriage
(9) Unknown |
|-----------------------------------|--|---|---|

- | | | | |
|-------------------------|--|--|---|
| TDC APPLICABLE VEHICLES | (O) Not a motor vehicle
(N) Noncollision
(F) Front
(R) Right side | (L) Left side
(B) Back of unit with cargo area
(rear of trailer or straight truck)
(D) Back (rear of tractor) | (C) Rear of cab
(V) Front of cargo area
(T) Top
(U) Undercarriage
(9) Unknown |
|-------------------------|--|--|---|

CODES FOR VEHICLE NUMBER OR OBJECT CONTACTED

- | | |
|---|--|
| (01-30) — Vehicle Number

Noncollision
(31) Overturn — rollover (excludes end-over-end)
(32) Rollover — end-over-end
(33) Fire or explosion
(34) Jackknife
(35) Other intraunit damage (specify):

(36) Noncollision injury
(38) Other noncollision (specify):

(39) Noncollision — details unknown

Collision With Fixed Object
(41) Tree (≤ 10 cm in diameter)
(42) Tree (> 10 cm in diameter)
(43) Shrubbery or bush
(44) Embankment
(45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post
(50) Pole or post (≤ 10 cm in diameter)
(51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
(52) Pole or post (> 30 cm in diameter)
(53) Pole or post (diameter unknown)

(54) Concrete traffic barrier
(55) Impact attenuator
(56) Other traffic barrier (includes guardrail)
(specify): _____ | (57) Fence
(58) Wall
(59) Building
(60) Ditch or culvert
(61) Ground
(62) Fire hydrant
(63) Curb
(64) Bridge
(68) Other fixed object (specify):

(69) Unknown fixed object

Collision with Nonfixed Object
(70) Passenger car, light truck, van, or other vehicle not in-transport
(71) Medium/heavy truck or bus not in-transport
(72) Pedestrian
(73) Cyclist or cycle
(74) Other nonmotorist or conveyance

(75) Vehicle occupant
(76) Animal
(77) Train
(78) Trailer, disconnected in transport
(79) Object fell from vehicle in-transport
(88) Other nonfixed object (specify):

(89) Unknown nonfixed object

(98) Other event (specify):

(99) Unknown event or object |
|---|--|



GENERAL VEHICLE FORM

11am

- 1. Primary Sampling Unit Number 75
- 2. Case Number - Stratum 158A
- 3. Vehicle Number 01

- 12. Speed Limit 089
(000) No statutory limit
Code posted or statutory speed limit in kmph
(999) Unknown
55 mph X 1.6093 = 88.5 kmph

VEHICLE IDENTIFICATION

- 4. Vehicle Model Year 96
Code the last two digits of the model year
(99) Unknown
- 5. Vehicle Make (specify): 07
Dodge
Applicable codes are found in your
NASS Data Collection, Coding and
Editing Manual.
(99) Unknown Flat Bed Chassis
- 6. Vehicle Model (specify): 482
Ram 2500
Applicable codes are found in your
NASS Data Collection, Coding and
Editing Manual. TURBO diesel
(999) Unknown Caremi SLT

- 13. Police Reported Alcohol Presence For Driver 0
(0) No alcohol present
(1) Yes alcohol present
(7) Not reported
(8) No driver present
(9) Unknown

- 14. Alcohol Test Result For Driver 96
Code actual value (decimal implied
before first digit—0.xx)
(95) Test refused
(96) None given
(97) AC test performed, results unknown
(98) No driver present
(99) Unknown
Source: [REDACTED]

- 7. Body Type 40
Note: Applicable codes may be found on
the back of this page.
- 8. Vehicle Identification Number 1B6KF26XT3
[REDACTED]
1 2 3 4 5 6 7 8 9 10 11 12 13 14 15 16 17
Left justify; Slash zeros and letter Z (0 and Z)
No VIN—Code all zeros
Unknown—Code all nines

- 15. Police Reported Other Drug Presence For Driver 0
(0) No other drug(s) present
(1) Yes other drug(s) present
(7) Not reported
(8) No driver present
(9) Unknown

- 9. Vehicle Special Use (This Trip) 0
(0) No special use
(1) Taxi
(2) Vehicle used as school bus
(3) Vehicle used as other bus
(4) Military
(5) Police
(6) Ambulance
(7) Fire truck or car
(8) Other (specify): _____
(9) Unknown

- 16. Other Drug Specimen Test Result For Driver 0
(0) No specimen test given
(1) Drug(s) not found in specimen
(2) Drug(s) found in specimen, (specify):

(3) Specimen test given, results unknown or not
obtained
(8) No driver present
(9) Unknown if specimen test given

- 17. Driver's Zip Code [REDACTED]
(00001) Driver not a resident of U.S. or territories
Code actual 5-digit zip code
(99998) No driver present
(99999) Unknown

OFFICIAL RECORDS

- 10. Police Reported Vehicle Disposition 1
(0) Not towed due to vehicle damage
(1) Towed due to vehicle damage
(9) Unknown
- 11. Police Reported Travel Speed 097
Code to the nearest kmph (NOTE: 000 means
less than 0.5 kmph)
(160) 159.5 kmph and above
(999) Unknown
60 mph X 1.6093 = 96.5 kmph

- 18. Driver's Race/Ethnic Origin 1
(1) White (non-Hispanic)
(2) Black (non-Hispanic)
(3) White (Hispanic)
(4) Black (Hispanic)
(5) American Indian, Eskimo or Aleut
(6) Asian or Pacific Islander
(7) Other (specify): _____
(8) No driver present
(9) Unknown

CODES FOR BODY TYPE

CDS APPLICABLE VEHICLES

Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (04) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify): _____
- (09) Unknown automobile type

Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine - more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

Utility Vehicles ($\leq 4,536$ kgs GVWR)

- (14) Compact utility (Jeep CJ-2 - CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravada, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Passport, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Hummer, Landcruiser, Rover, Scout, Yukon)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

Van Based Light Trucks ($\leq 4,536$ kgs GVWR)

- (20) Minivan (Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Vista, Aerostar, Windstar, Villager, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Quest, Mitsubishi Minivan, Expo Wagon, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura.)
- (22) Step van or walk-in van ($\leq 4,536$ kgs GVWR)
- (23) Van based motorhome ($\leq 4,536$ kgs GVWR)
- (24) Van based school bus ($\leq 4,536$ kgs GVWR)
- (25) Van based other bus ($\leq 4,536$ kgs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify): _____
- (29) Unknown van type

Light Conventional Trucks (Pickup style cab, $\leq 4,536$ kgs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500, T100)
- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

Other Light Trucks ($\leq 4,536$ kgs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

OTHER VEHICLES

Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify): _____
- (59) Unknown bus type

Medium/Heavy Trucks ($> 4,536$ kgs GVWR)

- (60) Step van ($> 4,536$ kgs GVWR)
- (61) Single unit straight truck ($4,536$ kgs $<$ GVWR $\leq 8,845$ kgs)
- (62) Single unit straight truck ($8,845$ kgs $<$ GVWR $\leq 11,793$ kgs)
- (63) Single unit straight truck ($> 11,793$ kgs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify): _____
- (89) Unknown motored cycle type

Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

PRECRASH DRIVER RELATED DATA

30. Driver's Distraction/Inattention To Driving 01
 (Prior To Recognition Of Critical Event)
- (00) No driver present
 (01) Attentive or not distracted
 (02) Looked but did not see
- Distractions*
- (03) By other occupant(s), (specify): _____
 (04) By moving object in vehicle (specify): _____
 (05) While talking or listening to cellular phone (specify location and type of phone): _____
 (06) While dialing cellular phone (specify location and type of phone): _____
 (07) While adjusting climate controls
 (08) While adjusting radio, cassette, CD (specify): _____
 (09) While using other device/controls integral to vehicle (specify): _____
 (10) While using or reaching for device/object brought into vehicle (specify): _____
 (11) Sleepy or fell asleep
 (12) Distracted by outside person, object, or event (specify): _____
 (13) Eating or drinking
 (14) Smoking related
 (97) Distracted/inattentive, details unknown
 (98) Other, distraction (specify): _____
 (99) Unknown

31. Pre-Event Movement (Prior to Recognition of Critical Event) 01
- (00) No driver present
 (01) Going straight
 (02) Decelerating in traffic lane
 (03) Accelerating in traffic lane
 (04) Starting in traffic lane
 (05) Stopped in traffic lane
 (06) Passing or overtaking another vehicle
 (07) Disabled or parked in travel lane
 (08) Leaving a parking position
 (09) Entering a parking position
 (10) Turning right
 (11) Turning left
 (12) Making a U-turn
 (13) Backing up (other than for parking position)
 (14) Negotiating a curve
 (15) Changing lanes
 (16) Merging
 (17) Successful avoidance maneuver to a previous critical event
 (97) Other (specify): _____
 (99) Unknown

32. Critical Precrash Event 08
- THIS VEHICLE LOSS OF CONTROL DUE TO:**
- (01) Blow out or flat tire
 (02) Stalled engine
 (03) Disabling vehicle failure (e.g., wheel fell off) (specify): _____
 (04) Non-disabling vehicle problem (e.g., hood flew up) (specify): _____
 (05) Poor road conditions (puddle, pot hole, ice, etc.) (specify): _____
 (06) Traveling too fast for conditions
 (08) Other cause of control loss (specify): trailer fish-tailing
 (09) Unknown cause of control loss

THIS VEHICLE TRAVELLING

- (10) Over the lane line on left side of travel lane
 (11) Over the lane line on right side of travel lane
 (12) Off the edge of the road on the left side
 (13) Off the edge of the road on the right side
 (14) End departure
 (15) Turning left at intersection
 (16) Turning right at intersection
 (17) Crossing over (passing through) intersection
 (18) This vehicle decelerating
 (19) Unknown travel direction

OTHER MOTOR VEHICLE IN LANE

- (50) Other vehicle stopped
 (51) Traveling in same direction with lower steady speed
 (52) Traveling in same direction while decelerating
 (53) Traveling in same direction with higher speed
 (54) Traveling in opposite direction
 (55) In crossover
 (56) Backing
 (59) Unknown travel direction of other motor vehicle in lane

OTHER MOTOR VEHICLE ENCROACHING INTO LANE

- (60) From adjacent lane (same direction)—over left lane line
 (61) From adjacent lane (same direction)—over right lane line
 (62) From opposite direction—over left lane line
 (63) From opposite direction—over right lane line
 (64) From parking lane
 (65) From crossing street, turning into same direction
 (66) From crossing street, across path
 (67) From crossing street, turning into opposite direction
 (68) From crossing street, intended path not known
 (70) From driveway, turning into same direction
 (71) From driveway, across path
 (72) From driveway, turning into opposite direction
 (73) From driveway, intended path not known
 (74) From entrance to limited access highway
 (78) Encroachment by other vehicle—details unknown

PEDESTRIAN, PEDALCYCLIST, OR OTHER NONMOTORIST

- (80) Pedestrian in roadway
 (81) Pedestrian approaching roadway
 (82) Pedestrian—unknown location
 (83) Pedalcyclist or other nonmotorist in roadway (specify): _____
 (84) Pedalcyclist or other nonmotorist approaching roadway, (specify): _____
 (85) Pedalcyclist or other nonmotorist—unknown location (specify): _____

OBJECT OR ANIMAL

- (87) Animal in roadway
 (88) Animal approaching roadway
 (89) Animal—unknown location
 (90) Object in roadway
 (91) Object approaching roadway
 (92) Object—unknown location
 (98) Other critical precrash event (specify): _____
 (99) Unknown

33. Attempted Avoidance Maneuver 01
- (00) No driver present
 - (01) No avoidance maneuver
 - (02) Braking (no lockup)
 - (03) Braking (lockup)
 - (04) Braking (lockup unknown)
 - (05) Releasing brakes
 - (06) Steering left
 - (07) Steering right
 - (08) Braking and steering left
 - (09) Braking and steering right
 - (10) Accelerating
 - (11) Accelerating and steering left
 - (12) Accelerating and steering right
 - (98) Other action (specify):
 - _____
 - (99) Unknown

34. Pre-Impact Stability 1
- (0) No driver present
 - (1) Tracking
 - (2) Skidding longitudinally—rotation less than 30 degrees
 - (3) Skidding laterally—clockwise rotation
 - (4) Skidding laterally—counterclockwise rotation
 - (7) Other vehicle loss-of-control (specify):
 - _____
 - (9) Precrash stability unknown

35. Pre-Impact Location 2
- (0) No driver present
 - (1) Stayed in original travel lane
 - (2) Stayed on roadway but left original travel lane
 - (3) Stayed on roadway, not known if left original travel lane
 - (4) Departed roadway
 - (5) Remained off roadway
 - (6) Returned to roadway
 - (7) Entered roadway
 - (9) Unknown

36. Accident Type 64
50
- (Note: Applicable codes on back of this page)

- (00) No impact
Code the number of the diagram that best describes the accident circumstance
- (98) Other accident type (specify):
- _____
- (99) Unknown

STOP HERE IF GV07 DOES NOT EQUAL 01 - 49

Category	Configuration	ACCIDENT TYPES (Includes Intent)							
I Single Driver	A Right Roadside Departure	01 DRIVE OFF ROAD	02 CONTROL/ TRACTION LOSS	03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN			
	B Left Roadside Departure	06 DRIVE OFF ROAD	07 CONTROL/ TRACTION LOSS	08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN			
	C Forward Impact	11 PARKED VEH.	12 STA. OBJECT	13 PEDESTRIAN/ ANIMAL	14 END DEPARTURE	15 SPECIFICS OTHER	16 SPECIFICS UNKNOWN		
II Same Trafficway Same Direction	D Rear-End	20 STOPPED 21, 22, 23	22 SLOWER 24, 25, 27	24 DECEL. 26, 28, 31	25 AVOID COLLISION WITH VEH.	26 AVOID COLLISION WITH OBJECT	(EACH - 32) SPECIFICS OTHER	(EACH - 33) SPECIFICS UNKNOWN	
	E Forward Impact	34 CONTROL/ TRACTION LOSS	35 CONTROL/ TRACTION LOSS	36 AVOID COLLISION WITH VEH.	37 AVOID COLLISION WITH OBJECT	38 AVOID COLLISION WITH VEH.	39 AVOID COLLISION WITH OBJECT	(EACH - 42) SPECIFICS OTHER	(EACH - 43) SPECIFICS UNKNOWN
	F Sideswipe Angle	44	45	46	47	(EACH - 48) SPECIFICS OTHER	(EACH - 49) SPECIFICS UNKNOWN		
III Same Trafficway Opposite Direction	G Head-On	50 LATERAL MOVE	51 LATERAL MOVE	(EACH - 52) SPECIFICS OTHER	(EACH - 53) SPECIFICS UNKNOWN				
	H Forward Impact	54 CONTROL/ TRACTION LOSS	55 CONTROL/ TRACTION LOSS	56 AVOID COLLISION WITH VEH.	57 AVOID COLLISION WITH OBJECT	58 AVOID COLLISION WITH VEH.	59 AVOID COLLISION WITH OBJECT	(EACH - 62) SPECIFICS OTHER	(EACH - 63) SPECIFICS UNKNOWN
	I Sideswipe Angle	64 LATERAL MOVE	65 LATERAL MOVE	(EACH - 66) SPECIFICS OTHER	(EACH - 67) SPECIFICS UNKNOWN				
IV Change Trafficway Vehicle Turning	J Turn Across Path	68 INITIAL OPPOSITE DIRECTIONS	69 INITIAL SAME DIRECTIONS	70 INITIAL SAME DIRECTIONS	71 INITIAL SAME DIRECTIONS	72 INITIAL SAME DIRECTIONS	73 INITIAL SAME DIRECTIONS	(EACH - 74) SPECIFICS OTHER	(EACH - 75) SPECIFICS UNKNOWN
	K Turn Into Path	77 TURN INTO SAME DIRECTION	78 TURN INTO SAME DIRECTION	79 TURN INTO OPPOSITE DIRECTIONS	80 TURN INTO OPPOSITE DIRECTIONS	81 TURN INTO OPPOSITE DIRECTIONS	82 TURN INTO OPPOSITE DIRECTIONS	(EACH - 84) SPECIFICS OTHER	(EACH - 85) SPECIFICS UNKNOWN
V Intersecting Paths (Vehicle Damage)	L Straight Paths	87	88	89	(EACH - 90) SPECIFICS OTHER	(EACH - 91) SPECIFICS UNKNOWN			
VI Miscellaneous	M. Backing Etc.	92 BACKING VEH.	93 OTHER VEH. OR OBJECT	94 Other Accident Type	95 Unknown Accident Type	96 No Impact			

OCCUPANT RELATED

37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
38. Number of Occupants This Vehicle 01
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
39. Number of Occupant Forms Submitted 01

AIR BAG RELATED

40. Is this an AOPS Vehicle? 1
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
41. Air Bag(s) Deployment, First Seat Frontal 2
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

43. Vehicle Curb Weight 9,990
 Code weight to nearest 10 kilograms.
 (045) Less than 454 kilograms
 (612) 6,124 kilograms or more
 (999) Unknown
 _____ lbs X .4536 = _____ *multi-stage vehicle* Kgs

Source: _____

44. Vehicle Cargo Weight 1,090
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (454) 4,536 kilograms or more
 (999) Unknown
 _____ lbs X .4536 = 1,088.6 Kgs

Source: _____

ROLLOVER DATA

45. Rollover 00
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns
 (17) Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
46. Rollover Initiation Type 00
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify): _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
47. Location of Rollover Initiation 0
 (0) No rollover
 (1) On roadway
 (2) On shoulder—paved
 (3) On shoulder—unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
48. Rollover Initiation Object Contacted 00
 (Note: Applicable codes on back of page)
49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 0
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown
50. Direction of Initial Roll 0
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
- (01-30) — Vehicle Number

Noncollision

- (31) Turn-over — fall-over
- (32) No rollover impact initiation (end-over-end)
- (34) Jackknife

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail)
(specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify): _____

- (69) Unknown fixed object

Collision with Nonfixed Object

- (70) Passenger car, light truck, van, or other vehicle not in-transport
- (71) Medium/heavy truck or bus not in-transport
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify): _____

- (89) Unknown nonfixed object

- (98) Other event (specify): _____

- (99) Unknown event or object

VERRIDE/UNDERRIDE (THIS VEHICLE)

51. Front Override/Underride (this Vehicle) 0

52. Rear Override/Underride (this Vehicle) 0
 (0) No override/underride, or not an end-to-end impact between two CDS applicable vehicles, and no medium/heavy truck or bus underride

Override (see specific CDC)
[Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49)]
 (1) 1st CDC
 (2) 2nd CDC
 (3) Other not automated CDC (specify):

Underride (see specific CDC)
[Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49)]
 (4) 1st CDC
 (5) 2nd CDC
 (6) Other not automated CDC (specify):

(7) Medium/heavy truck or bus override (of any configuration)
 (9) Unknown

HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V

Values: (000)-(359) Code actual value
 (996) Non-horizontal impact
 (997) Noncollision
 (998) Impact with object
 (999) Unknown

53. Heading Angle For This Vehicle 315
~~297~~

54. Heading Angle For Other Vehicle 180

RECONSTRUCTION DATA

55. Towed Trailing Unit 1
 (0) No towed unit
 (1) Yes—towed trailing unit
 (9) Unknown

56. Documentation of Trajectory Data for This Vehicle 1
 (0) No
 (1) Yes

57. Post Collision Condition of Tree or Pole (For Highest Delta V) 0
 (0) Not collision (for highest delta V) with tree or pole
 (1) Not damaged
 (2) Cracked/sheared
 (3) Tilted < 45 degrees
 (4) Tilted ≥ 45 degrees
 (5) Uprooted tree
 (6) Separated pole from base
 (7) Pole replaced
 (8) Other (specify):

 (9) Unknown

ACCIDENT RECONSTRUCTION PROGRAMS HIGHEST DELTA V

58. Basis for Total (Resultant) Delta V (highest) 04
 (00) No vehicle inspection

Delta V Calculated
 (01) Reconstruction program-damage only routine
 (02) Reconstruction program-damage and trajectory routine
 (03) Missing vehicle algorithm

Delta V Not Calculated
 (04) At least one vehicle (which may be this vehicle) is beyond the scope of an acceptable reconstruction program, regardless of collision conditions.

All vehicles within scope (CDC applicable) of reconstruction program but one of the collision conditions is beyond the scope of the reconstruction program or other acceptable reconstruction technique, regardless of adequacy of damage data.

(05) Rollover
 (06) Other non-horizontal forces
 (07) Sideswipe type damage
 (08) Severe override
 (09) Yielding object
 (10) Overlapping damage
 (11) All vehicle and collision conditions are within scope of one of the acceptable reconstruction programs, but there is insufficient data available, (specify):

(98) Other, (specify): _____

COMPUTER GENERATED CRASH SEVERITY

59. Total Delta V Highest 999

Nearest kmph (highest)
Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
(160) 159.5 kmph and above
(999) Unknown

60. Longitudinal Component of Delta V Highest + - 999

Nearest kmph (highest)
Nearest kmph (secondary)

(NOTE: __000 means greater than -0.5 kmph and less than +0.5 kmph)
(±160) ±159.5 kmph and above
(_999) Unknown

61. Lateral Component of Delta V Highest + - 999

Nearest kmph (highest)
Nearest kmph (secondary)

(NOTE: __000 means greater than -0.5 kmph and less than +0.5 kmph)
(±160) ±159.5 kmph and above
(_999) Unknown

62. Energy Absorption Highest 999.900

Nearest 100 joules (highest)
Nearest 100 joules (secondary)

(NOTE: 0000 means less than 50 joules)
(9997) 999,650 joules or more
(9999) Unknown

63. Impact Speed Highest 999

Nearest kmph (highest)
Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
(160) 159.5 kmph and above
(998) Trajectory algorithm not run
(999) Unknown

DELTA V CONFIDENCE LEVEL

64. Confidence In Reconstruction Program Results (For Highest Delta V) 0
(0) No reconstruction
(1) Collision fits model - results appear reasonable
(2) Collision fits model - results appear high
(3) Collision fits model - results appear low
(4) Borderline reconstruction - results appear reasonable

OTHER SPEED ESTIMATE

65. Barrier Equivalent Speed Highest 21.4 / 999

Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
(160) 159.5 kmph and above
(999) Unknown

ESTIMATED DELTA V	INSPECTION TYPE
<p>66. Estimated Highest Delta V (Researcher Determined) <u>0</u> (0) Reconstruction Delta V coded <u>7</u> <i>BASED ON CRUSH</i></p> <p><i>Estimated Delta V</i></p> <p>(1) Less than 10 kmph (2) ≥ 10 kmph but < 25 kmph (3) ≥ 25 kmph but < 40 kmph (4) ≥ 40 kmph but < 55 kmph (5) ≥ 55 kmph</p> <p><i>Other estimates of damage severity</i></p> <p>(6) Minor (7) Moderate (8) Severe (9) Unknown</p>	<p>67. Type of Vehicle Inspection <u>3</u> (0) No inspection (1) Vehicle fully repaired-no damage evident (2) Partial inspection (specify): _____ (3) Complete inspection</p>
DELTA V EVENT NUMBER	
<p>68. Delta V Event Number <u>01</u> _____ Code the accident event sequence number that resulted in the Delta V that has been coded above for this vehicle (99) Unknown</p>	

*** IF THE CDS APPLICABLE VEHICLE WAS NOT INSPECTED (I.E., GV67 = 0), ***

DO NOT COMPLETE THE EXTERIOR AND INTERIOR VEHICLE FORMS

*** IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE ***

**THE EXTERIOR VEHICLE, INTERIOR VEHICLE,
 OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.**



EXTERIOR VEHICLE FORM

1. Primary Sampling Unit Number <u>75</u>	3. Vehicle Number <u>01</u>
2. Case Number - Stratum <u>158A</u>	

VEHICLE IDENTIFICATION

VIN 1B6KF26CXTS XXXXXXXXXX Model Year 96
 Vehicle Make (specify): Dodge Vehicle Model (specify): Ram 2500

LOCATOR

Locate the end of the damage with respect to the vehicle's damaged center point or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L	Location of Max Crush
01	Begins RF BC	BC to BC	C1
	Begins RF BC	Begins 56 in behind RF axle	C6

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

01 - set up from rear axles

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

Specific Impact Number	Plane of Impact C-Measurements	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Width (CDC)	Max Crush								
01	FRONT	139	C1	141	36	17	10	9	7	18	25.5
	Free space			+	13	13	13	13	13	13	
	Result				49	30	23	22	20	31	
					210	4	0	0	4	260	
	342 w/B	438			25	26	23	22	16	7	
	96 F.O	425			29					11	
	438 =	13									
	425										
	13										
01	R. Side	52	C4	116	5	8	18	49	77	87	
	Free space				0	0	0	0	3	5	
	Step				5	8	18	49	74	82	
	to 117cm	100.5 actual			16.5	16.5	16.5	16.5	16.5	16.5	
	117	16.5			0	0	1	32	57	65	

ORIGINAL SPECIFICATIONS WORK SHEET


Wheelbase	<u>134.7</u>	inches	x 2.54	=	<u>342.1</u> cm
Overall Length	<u>216.7</u>	inches	x 2.54	=	<u>550.4</u> cm
Maximum Width	<u>79.3</u>	inches	x 2.54	=	<u>201.4</u> cm
Curb Weight	<u>4,710</u>	pounds	x .4536	=	<u>2,136.4</u> kg
Average Track	_____	inches	x 2.54	=	_____ cm
Front Overhang	<u>37.9</u>	inches	x 2.54	=	<u>96.2</u> cm
Rear Overhang	<u>44.1</u>	inches	x 2.54	=	<u>112.0</u> cm
Undeformed End Width	_____	inches	x 2.54	=	_____ cm
Engine Size: cyl./displ.	_____	cc	x .001	=	_____ L
	V-8 <u>5.9L</u>	CID	x .0164	=	_____ L

96
67I

VEHICLE DAMAGE SKETCH

TIRE - WHEEL DAMAGE a. Rotation physically restricted RF <u>2</u> LF <u>1</u> RR <u>2</u> LR <u>2</u> (1) Yes (2) No (8) NA (9) Unk.		b. Tire deflated RF <u>2</u> LF <u>2</u> RR <u>2</u> LR <u>2</u>		ORIGINAL SPECIFICATIONS Wheelbase <u>342</u> cm Overall Length <u>550</u> cm Maximum Width <u>201</u> cm Curb Weight <u>2136</u> kg Average Track <u>Not Available</u> cm Front Overhang <u>96</u> cm Rear Overhang <u>112</u> cm Undeformed End Width <u>190</u> cm Engine Size: cyl./displ. <u>V-8/5.9L</u> L		WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only) RF ± <u> </u> ° LF ± <u>00</u> ° RR ± <u> </u> ° LR ± <u> </u> ° Within ± 5 degrees	
TYPE OF TRANSMISSION <input checked="" type="checkbox"/> Manual <input type="checkbox"/> Automatic END SHIFT ≥ 10 CM <input checked="" type="checkbox"/> Yes <input type="checkbox"/> No				DRIVE WHEELS <input type="checkbox"/> FWD <input type="checkbox"/> RWD <input checked="" type="checkbox"/> 4WD		Approximate Cargo Weight <u>1,500 lbs</u> kg	

MEASUREMENTS IN CENTIMETERS

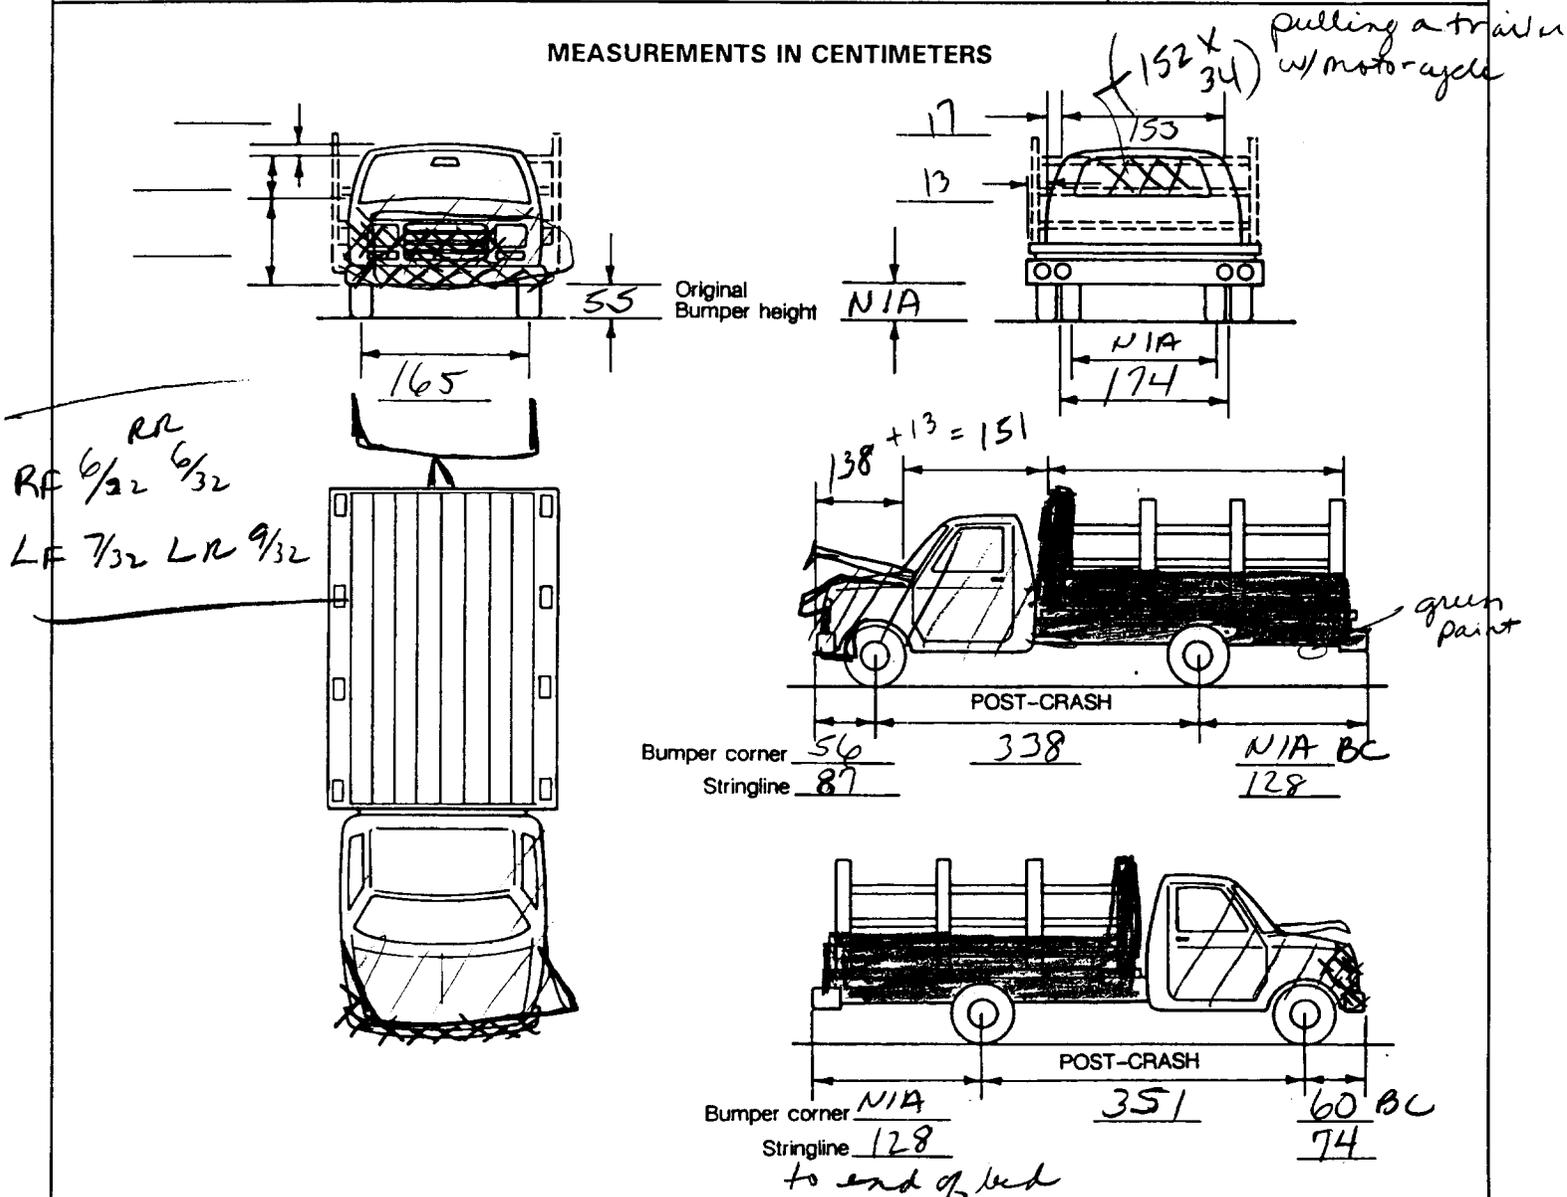

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page. Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>02</u>	6. <u>81</u>	7. <u>F</u>	8. <u>D</u>	9. <u>E</u>	10. <u>W</u>	11. 01 <u>02</u>

Second Highest Delta "V"

12. 02	13. 39	14. 99	15. 9	16. 9	17. 9	18. 9	19. 99
-------------------	-------------------	-------------------	------------------	------------------	------------------	------------------	-------------------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
<u>190</u>	025 <u>029</u>	<u>026</u>	<u>023</u>	<u>022</u>	<u>016</u>	007 <u>011</u>	⁺ <u>026</u>

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D

26. Undeformed End Width (Coded when highest severity impact is an end plane impact.) 190
 Code to the nearest centimeter
 (250) 250 centimeters or more
 (998) No highest severity end plane impact
 (999) Unknown

27. Direct Damage Width (For highest severity impact) 139
 Code to the nearest centimeter
 (250) 250 centimeters or more
 (999) Unknown

28. Original Wheelbase 342
 Code to the nearest centimeter
 (650) 650 centimeters or more
 (999) Unknown
134.7 inches X 2.54 = _____ centimeters

29. Original Average Track Width 170
 Code to the nearest centimeter
 (185) 185 centimeters or more
 (999) Unknown
 _____ inches X 2.54 = 169.5 centimeters

30. Are CDCs Documented but Not Coded on The Automated File? 0
 (0) No
 (1) Yes

31. Researcher's Assessment of Vehicle Disposition 1
 (0) Not towed due to vehicle damage
 (1) Towed due to vehicle damage
 (9) Unknown

32. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? 9
 (0) No post manufacturer modifications
 (1) Yes - post manufacturer modifications (specify): L.E. door was jammed + handle find any refs

 (Include photograph of CERTIFICATION PLACARD in case report)
 (9) Unknown if vehicle is modified

FUEL SYSTEM

35. Location of Fuel Tank-1 Filler Cap 4

36. Location of Fuel Tank-2 Filler Cap 0
 (0) No fuel tank
 (1) On back plane
 (2) Aft of center of the rear wheels (rear axle) on left side plane
 (3) Aft of center of the rear wheels (rear axle) on right side plane
 (4) Forward of center of the rear wheels (rear axle) on left side plane
 (5) Forward of center of the rear wheels (rear axle) on right side plane
 (6) Over the center of the rear wheels (rear axle) on left side plane
 (7) Over the center of the rear wheels (rear axle) on right side plane
 (8) Other (specify): _____
 (9) Unknown

37. Type of Fuel Tank-1 2

38. Type of Fuel Tank-2 0
 (0) No fuel tank (electrical vehicle)
 (1) Metallic
 (2) Non-metallic
 (9) Unknown

FIRE OCCURRENCE

33. Fire Occurrence 0
 (0) No fire
 Yes, fire occurred
 (1) Minor
 (2) Major
 (9) Unknown

34. Origin of Fire 0
 (0) No fire
 (1) Vehicle exterior (front, side, back, top)
 (2) Exhaust system
 (3) Fuel tank (and other fuel retention system parts)
 (4) Engine compartment
 (5) Cargo/trunk compartment
 (6) Instrument panel
 (7) Passenger compartment area
 (8) Other location (specify): _____
 (9) Unknown

39. Location of Fuel Tank-1 5

40. Location of Fuel Tank-2 0
 (0) No fuel tank
 (1) Aft of center of the rear wheels (rear axle) centered
 (2) Aft of center of the rear wheels (rear axle) left side
 (3) Aft of center of the rear wheels (rear axle) right side
 (4) Forward of center of the rear wheels (rear axle) centered
 (5) Forward of center of the rear wheels (rear axle) left side
 (6) Forward of center of the rear wheels (rear axle) right side
 (7) Over center of the rear wheels (rear axle)
 (8) Other (specify): _____
 (9) Unknown

41. Damage to Fuel Tank-1 1

42. Damage to Fuel Tank-2 0
 (0) No fuel tank
 (1) No damage to fuel tank
 (2) Deformed, no seam failure
 (3) Deformed, with a seam failure
 (4) Punctured
 (5) Lacerated (ripped)
 (6) Abraded (scraped)
 (7) Filler neck separation from the fuel tank
 (8) Other damage (specify): _____
 (9) Unknown

43. Leakage Location of Fuel System-1 1

44. Leakage Location of Fuel System-2 0

(0) No fuel tank
(1) No fuel leakage

Primary Area Of Leakage

(2) Tank
(3) Filler neck
(4) Cap
(5) Lines/pump/filter
(6) Vent/emission recovery
(8) Other (specify): _____
(9) Unknown

45. Fuel Type-1 02

46. Fuel Type-2 00

Single Fuel Type

(00) No fuel tank
(01) Gasoline
(02) Diesel
(03) CNG (Compressed Natural Gas)
(04) LPG (Liquid Petroleum Gas) also known as Propane
(05) LNG (Liquid Natural Gas)
(06) Methanol (M100 or M85)
(07) Ethanol (E100 or E85)
(08) Other (Hydrogen or others) (specify): _____

Electric Powered or Electric/Solar Powered Vehicles

(10) Lead Acid Battery
(11) Nickel-Iron Battery
(12) Nickel-Cadmium Battery
(13) Sodium Metal Chloride Battery
(14) Sodium Sulfur Battery
(18) Other (Specify): _____

(98) Other Hybrid (specify): _____

(99) Unknown fuel type

47. Is This Vehicle Equipped With More Than Two Fuel Tanks? 0

(0) No (one or two tanks only)

Yes - More Than Two Tanks

(1) Yes -- no damage to any tank or filler cap and no fuel system leakage

(2) Yes -- no damage to any tank or filler cap but there is fuel system leakage (specify leakage location): _____

(3) Yes -- damage to an additional tank or filler cap and there is fuel system leakage (specify the following):
 Type of tank _____
 Tank location _____
 Filler cap location _____
 Tank damage _____
 Location of leakage _____
 Type of fuel _____

(9) Unknown if more than two tanks

COMMENTS

*** STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED ***

(GV10=0)

DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



GLAZING

1. Primary Sampling Unit Number 75

2. Case Number - Stratum 158A

3. Vehicle Number 01

INTEGRITY

4. Passenger Compartment Integrity 01

(00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):

(99) Unknown

Door, Tailgate or Hatch Opening

5. LF 3 6. RF 1 7. LR 0 8. RR 0 9. TG/H 0

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify):
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code Ø

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify):
- (9) Unknown

Type of Window/Windshield Glazing

15. WS 1 16. LF 2 17. RF 2 18. LR 0 19. RR 0
20. BL 2 21. Roof 0 22. Other 0

- (0) No glazing
- (1) AS-1 -- Laminated
- (2) AS-2 -- Tempered
- (3) AS-3 -- Tempered-tinted (original)
- (4) AS-2 -- Tempered-with after market tint
- (5) AS-3 -- Tempered-tinted (with additional after market tint)
- (6) AS-14 -- Glass/Plastic
- (7) Glazing removed prior to accident
- (8) Other (specify):
- (9) Unknown

Window Precrash Glazing Status

23. WS 1 24. LF 2 25. RF 2 26. LR 0 27. RR 0
28. BL 1 29. Roof 0 30. Other 0

- (0) No glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (7) Glazing removed prior to accident
- (9) Unknown

Glazing Damage from Impact Forces

31. WS 1 32. LF 1 33. RF 1 34. LR 0 35. RR 0
36. BL 6 37. Roof 0 38. Other 0

- (0) No glazing
- (1) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (9) Unknown if damaged


Glazing Damage from Occupant Contact

39. WS 1 40. LF 1 41. RF 1 42. LR 0 43. RR 0
44. BL 1 45. Roof 0 46. Other 0

- (0) No glazing
- (1) No occupant contact to glazing
- (2) Glazing contacted by occupant but no glazing damage
- (3) Glazing in place and cracked by occupant contact
- (4) Glazing in place and holed by occupant contact
- (5) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (6) Glazing out-of-place by occupant contact and holed by occupant contact
- (7) Glazing removed prior to accident
- (8) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

INTRUSION WORKSHEET

NOTE: SKETCH INTRUDED AREAS

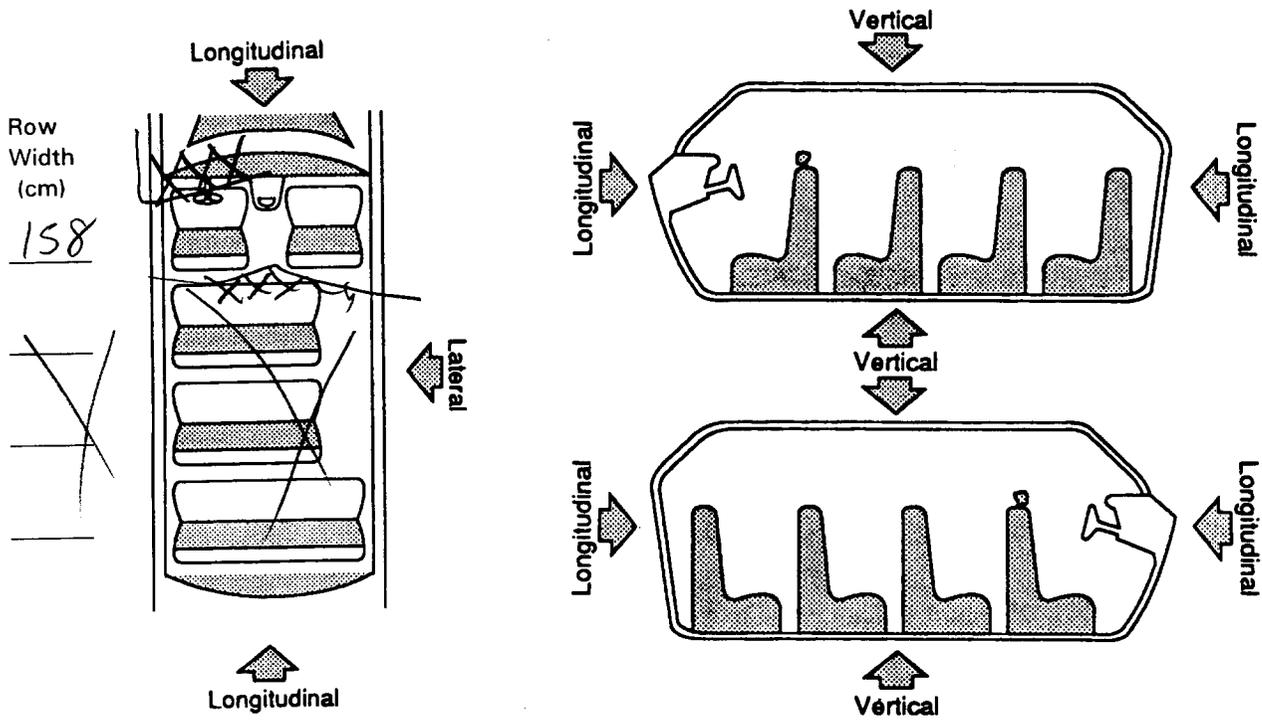

LOCATION OF INTRUSION	INTRUDED COMPONENT	(All Measurements Are In Centimeters)				DOMINANT CRUSH DIRECTION
		COMPARISON VALUE	INTRUDED VALUE	=	INTRUSION	
11	DASH	94	82	= 12	① Long	
11	Air Pillar	103	100	= 3	②	
11	Panel F of Air Pillar	103	101	= 2		
11	Near of Cab	21	20	= 1		
12	↓	21	18	= 3	③	
13	↓	21	21	= 0		
				=		
				=		
				=		
				=		
				=		
				=		
				=		
				=		
				=		
				=		

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Side panel - forward of the A1/A2-pillar
- (11) Door panel (side)
- (12) Side panel - rear of the B-pillar
- (13) Roof (or convertible top)
- (14) Roof side rail
- (15) Windshield
- (16) Windshield header
- (17) Window frame
- (18) Floor pan (includes sill)
- (19) Backlight header
- (20) Front seat back
- (21) Second seat back
- (22) Third seat back
- (23) Fourth seat back
- (24) Fifth seat back
- (25) Seat cushion
- (26) Back door/panel (e.g., tailgate)
- (27) Other interior component (specify): _____

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify): _____
- (32) Other exterior object in the environment (specify): _____
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): _____
- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. <u>11</u>	48. <u>02</u>	49. <u>2</u>	50. <u>2</u>
2nd	51. <u>11</u>	52. <u>06</u>	53. <u>1</u>	54. <u>2</u>
3rd	55. <u>12</u>	56. <u>26</u>	57. <u>1</u>	58. <u>2</u>
4th	59. _____	60. _____	61. _____	62. _____
5th	63. _____	64. _____	65. _____	66. _____
6th	67. _____	68. _____	69. _____	70. _____
7th	71. _____	72. _____	73. _____	74. _____
8th	75. _____	76. _____	77. _____	78. _____
9th	79. _____	80. _____	81. _____	82. _____
10th	83. _____	84. _____	85. _____	86. _____

LOCATION OF INTRUSION

- | | |
|--|---|
| <p>Front Seat</p> <ul style="list-style-type: none"> (11) Left (12) Middle (13) Right <p>Second Seat</p> <ul style="list-style-type: none"> (21) Left (22) Middle (23) Right <p>Third Seat</p> <ul style="list-style-type: none"> (31) Left (32) Middle (33) Right | <p>Fourth Seat</p> <ul style="list-style-type: none"> (41) Left (42) Middle (43) Right <p>(97) Catastrophic</p> <p>(98) Other enclosed area (specify) _____</p> <p>(99) Unknown</p> |
|--|---|

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)

COMPARISON VALUE	—	DAMAGE VALUE	=	DEFORMATION
------------------	---	--------------	---	-------------


	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--




	—		=	
--	---	--	---	--

STEERING COLUMN	INSTRUMENT PANEL
<p>87. Steering Column Type <u>2</u> (1) Fixed column (2) Tilt column (3) Telescoping column (4) Tilt and telescoping column (8) Other column type (specify): _____ (9) Unknown</p> <p>88. Tilt Steering Column Adjustment <u>1</u> (0) No tilt steering column (1) Full up (2) Between full up and center (3) Center (4) Between center and full down (5) Full down (9) Unknown</p> <p>89. Telescoping Steering Column Adjustment <u>0</u> (0) No telescoping steering column (1) Full back (2) Between full back and midpoint (3) Midpoint (4) Between midpoint and full forward (5) Full forward (9) Unknown</p> <p>90. Steering Rim/Spoke Deformation <u>00</u> Code actual measured deformation to the nearest centimeter (00) No steering rim deformation (01-14) Actual measured value in centimeters (15) 15 centimeters or more (98) Observed deformation cannot be measured (99) Unknown</p> <p>91. Location of Steering Rim/Spoke Deformation <u>00</u> (00) No steering rim deformation</p> <p><i>Quarter Sections</i> (01) Section A (02) Section B (03) Section C (04) Section D</p> <p><i>Half Sections</i> (05) Upper half of rim/spoke (06) Lower half of rim/spoke (07) Left half of rim/spoke (08) Right half of rim/spoke</p> <p>(09) Complete steering wheel collapse (10) Undetermined location (99) Unknown</p>	<p>92. Odometer Reading <u>022,000</u> _____ kilometers Code to the nearest 1,000 kilometers (000) No odometer (001) Less than 1,500 kilometers (500) 499,500 kilometers or more (999) Unknown <u>013,663</u> miles X 1.6093 = <u>21,987</u> kilometers</p> <p>Source: _____</p> <p>93. Instrument Panel Damage from Occupant Contact? <u>0</u> (0) No (1) Yes (9) Unknown</p> <p>94. Type of Knee Bolster Covering <u>2</u> (0) No knee bolster (1) Padded (2) Rigid plastic (8) Other (specify): _____ (9) Unknown</p> <p>95. Knee Bolsters Deformed from Occupant Contact? <u>1</u> (0) No knee bolster (1) No deformation (2) Yes - deformation (9) Unknown</p> <p>96. Did Glove Compartment Door Open During Collision(s)? <u>1</u> (0) No glove compartment door (1) No - door did not open (2) Yes - door opened (9) Unknown</p> <p>97. Adaptive (Assistive) Driving Equipment <u>0</u> (0) No adaptive driving equipment (1) Adaptive driving equipment installed (Check all that apply.) <input type="checkbox"/> Hand controls for braking/acceleration <input type="checkbox"/> Steering control devices (attached to OEM steering wheel) <input type="checkbox"/> Steering knob attached to steering wheel <input type="checkbox"/> Low effort power steering (unit or device) <input type="checkbox"/> Replacement steering wheel (i.e., reduced diameter) <input type="checkbox"/> Joy-stick steering controls <input type="checkbox"/> Wheelchair tie-downs <input type="checkbox"/> Modification to seat belts (specify): _____ <input type="checkbox"/> Additional or relocated switches (specify): _____ <input type="checkbox"/> Raised roof <input type="checkbox"/> Wall-mounted head rest (used behind wheelchair) <input type="checkbox"/> Other adaptive device (specify): _____ (9) Unknown</p>




VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

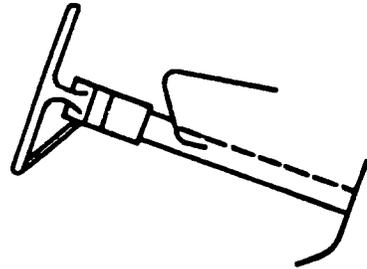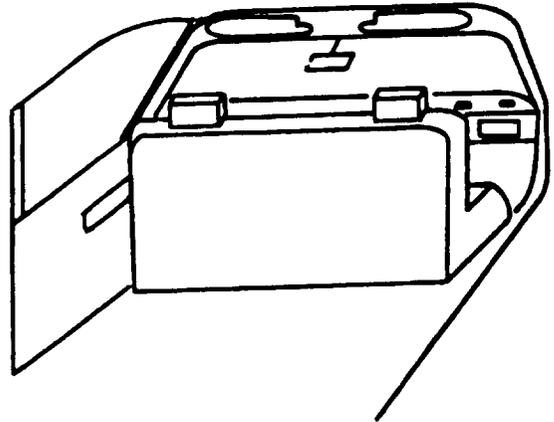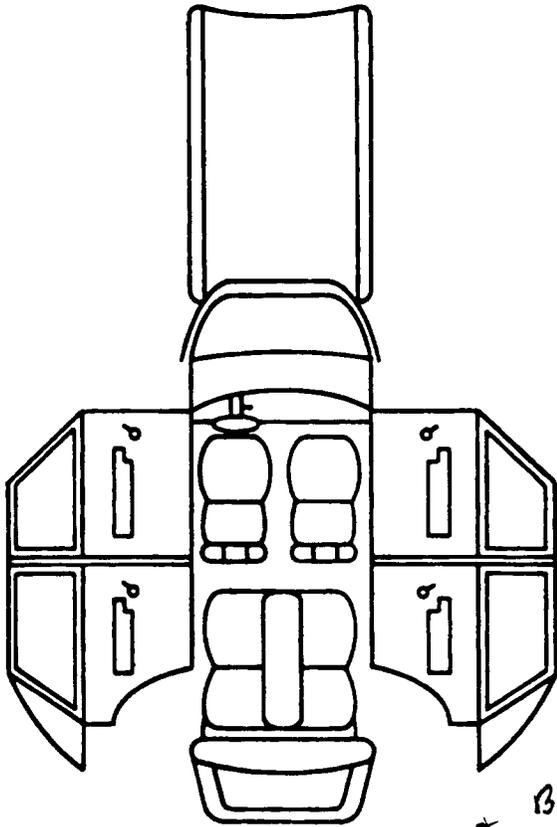

(A₁) Scrape mark + Blood Spot

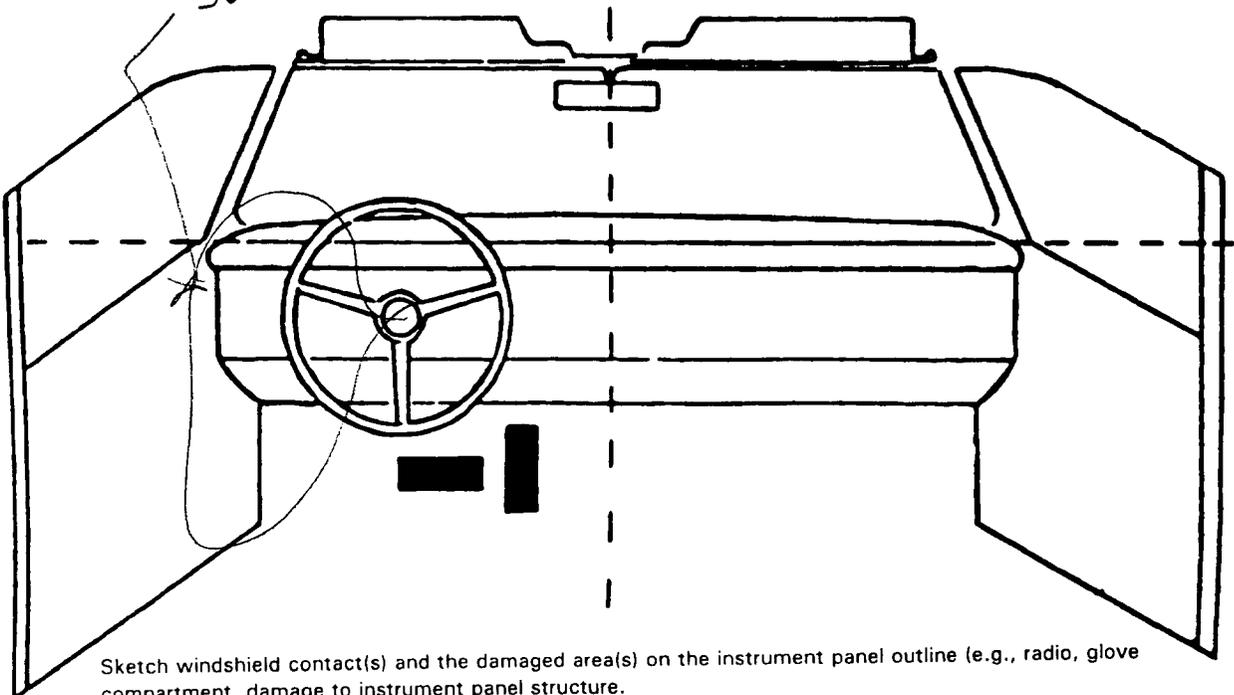

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).
Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	170	01	Face	Scrape & Blood spot	2
B					
C					
D					
E					
F					
G					
H					
I					
J					
K					
L					
M					
N					

CODES FOR INTERIOR COMPONENTS

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tapedeck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object, (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests
- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (175) Air bag compartment cover-driver side
- (180) Air bag-passenger side
- (185) Air bag compartment cover-passenger side
- (190) Other air bag (specify) _____
- (195) Other air bag compartment cover (specify) _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof
- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

If a child safety seat is present, encode the data on the back of this page 11.

If the vehicle has automatic restraints available, encode the appropriate data on page 6.

		Left	Center	Right
F I R S T	A-Availability	4	3	4
	B-Evidence of usage	04	00	04
	C-Used in this crash?	04	00	00
	D-Proper Use	1	0	0
	E-Failure Modes	1	0	0
	F-Anchorage Adjustment	1	0	1
S E C O N D	A-Availability			
	B-Evidence of usage			
	C-Used in this crash?			
	D-Proper Use			
	E-Failure Modes			
	F-Anchorage Adjustment			
O T H E R	A-Availability			
	B-Evidence of usage			
	C-Used in this crash?			
	D-Proper Use			
	E-Failure Modes			
	F-Anchorage Adjustment			

A-Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

- (9) Unknown

B/C-Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____
- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

D-Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of manual belt system (specify): _____
- (9) Unknown

E-Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

F-Shoulder Belt Upper Anchorage Adjustment

- (0) No shoulder belt
- (1) No upper anchorage adjustment for shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Frontal Air Bags--Left Front	Frontal Air Bags--Right Front	Other Air Bag
F I R S T	Availability/Function			
	Deployment			
	Failure			

Air Bag System Availability/Function

- (0) Not equipped/not available
- (1) Air bag

Non-functional

- (2) Air bag disconnected (specify): _____
- (3) Air bag not reinstalled
- (9) Unknown

Air Bag System Deployment (This Occupant Position)

- (0) Not equipped/not available
- (1) Deployed during accident (as a result of impact)
- (2) Deployed inadvertently just prior to accident
- (3) Deployed, accident sequence undetermined
- (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (5) Unknown if deployed
- (7) Nondeployed
- (9) Unknown

Are There Indications of Air Bag System Failure? (This Occupant Position)

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____
- (9) Unknown

AUTOMATIC BELTS

		Left	Right
F I R S T	A-Availability/Function		
	B-Use		
	C-Type		
	D-Proper Use		
	E-Failure Modes		

A-Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

B-Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

C-Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

D-Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____

- (8) Other improper use of automatic belt system (specify): _____
- (9) Unknown

E-Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

FIRST SEAT FRONTAL AIR BAGS

NOTES: Encode the applicable data *for the driver and first seat passenger* in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

	Driver	Passenger
A-Type of air bag?	1	X
B-Flaps open at tear points?	2	
C-Flaps damaged?	1	
D-Air bag damaged?	01	
E-Source of air bag damage	01	
F-Air bag tethered?	1	
G-Air bag have vent ports?	2	
H-Other occupant contact air bag?	1	
I-Occupant wearing eyewear?	4	

A-Type of Air Bag

- (0) Not equipped/not available
- (1) Original manufacturer installed system
- (2) Retrofitted air bag
- (3) Replacement air bag
- (8) Unknown type of air bag
- (9) Unknown

B-Did Air Bag Module Cover Flap(s) Open At Designated Tear Points?

- (0) Not equipped/not available
- (1) No
- (2) Yes
- (3) Deployed, unknown if flap(s) opened at designated tear points
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

C-Were Air Bag Module Cover Flap(s) Damaged?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if air bag module cover flap(s) damaged
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

D-Was There Damage To The Air Bag?

- (00) Not equipped/not available
- (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
- (03) Cut
- (04) Torn
- (05) Holed
- (06) Burned
- (07) Abraded
- (88) Other damage (specify):

- (95) Damaged, details unknown
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

E-Source of Air Bag Damage

- (00) Not equipped/not available
- (01) Not damaged
- (02) Object worn by occupant, (specify):
- (03) Object carried by occupant, (specify):
- (04) Adaptive/assistive controls, (specify):
- (05) Fire in vehicle
- (06) Thermal burns
- (07) Rescue or emergency efforts
- (88) Other damage source (specify):
- (95) Damaged, unknown source
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

F-Was The Air Bag Tethered?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of tether straps):
- (3) Deployed, unknown if tethered
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

G-Did The Air Bag Have Vent Ports?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of vent ports):
- (3) Deployed, unknown if vent ports present
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

H-Was the Air Bag in this Occupant's Position Contacted by Another Occupant?


- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if other occupant contact to air bag
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

I-Was This Occupant Wearing Eye-wear?


- (0) Not equipped/not available
- (1) No
- (2) Eyeglasses/sunglasses
- (3) Contact lenses
- (4) Deployed, unknown if eyewear worn
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

DRIVER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Front)

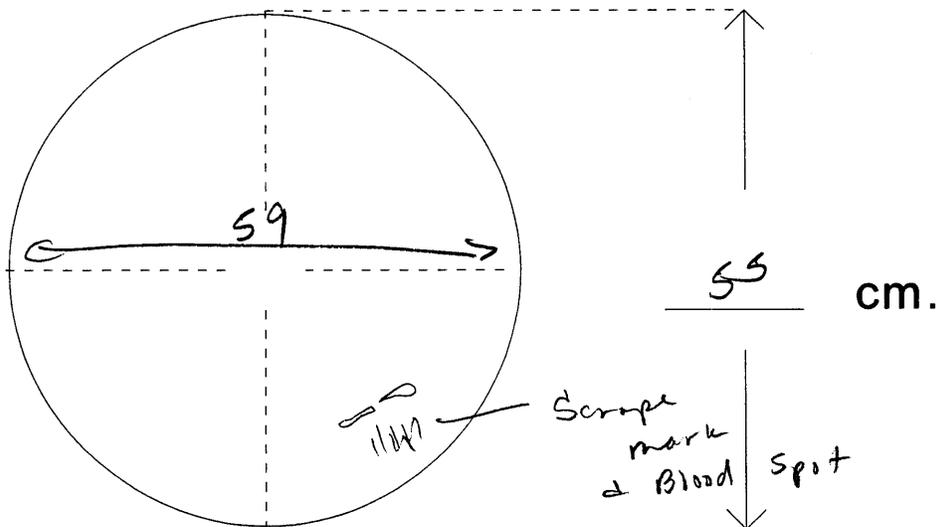

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Back)

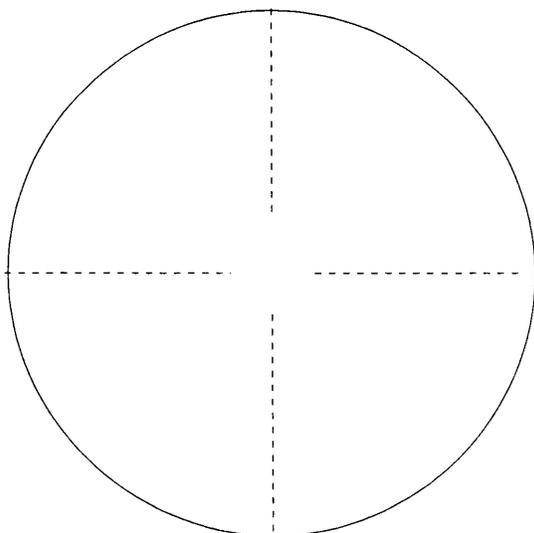


DRIVER AIR BAG SKETCHES (Cont'd)

3. DRIVER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

width (W_U) _____ width (W_L) _____

height (H) _____

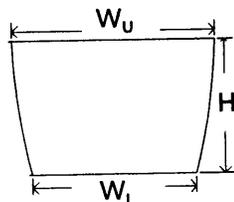

4. DRIVER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_U) 17

width (W_L) 17

height (H_U) 7


height (H_L) 7

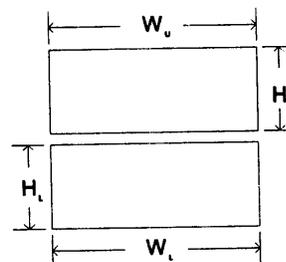

5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE


6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

7. SKETCH LOCATION OF CIRCULAR AIR BAG VENT PORTS

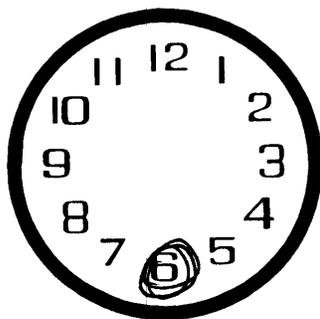


PASSENGER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Front)

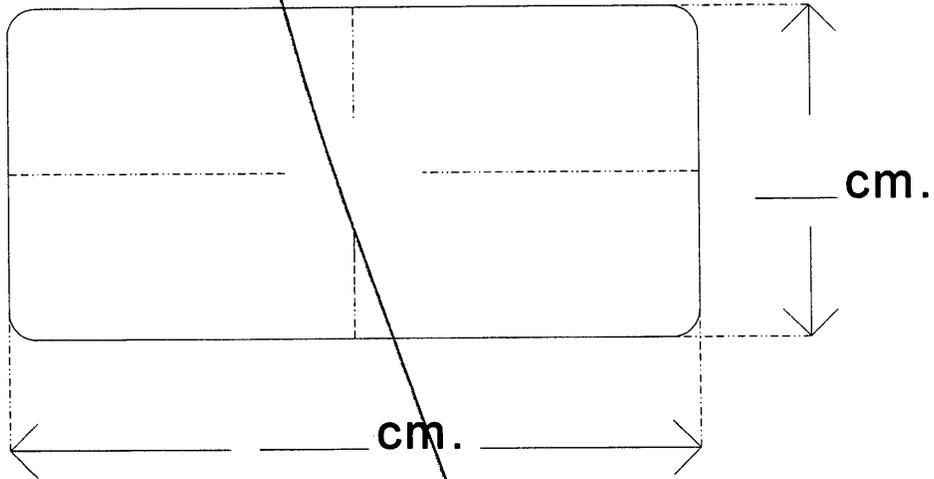

NIA

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Back)

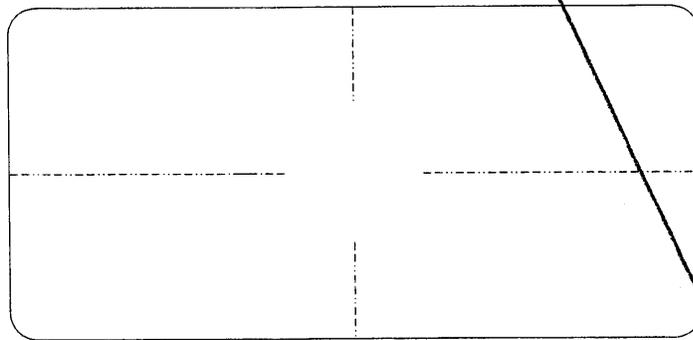


PASSENGER AIR BAG SKETCHES (Cont'd)

3. PASSENGER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

width (W) _____

height (H) _____

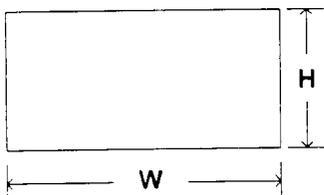

4. PASSENGER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_u) _____

width (W_l) _____

height (H_u) _____

height (H_l) _____

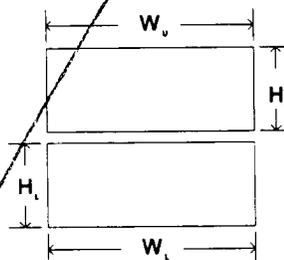


5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

N/A

7. SKETCH LOCATION OF RECTANGULAR AIR BAG VENT PORTS

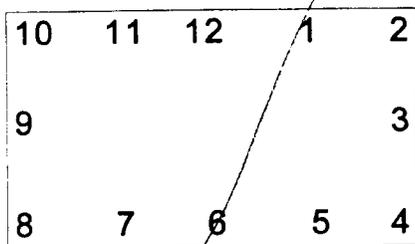

"OTHER" AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Front)

N/A


2. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Back)

"OTHER" AIR BAG SKETCHES (Cont'd)

3. SKETCH AIR BAG MODULE FLAP AND SIZE OR OPENING FOR AIRBAG

4. SKETCH AIR BAG VENT PORTS

N/A

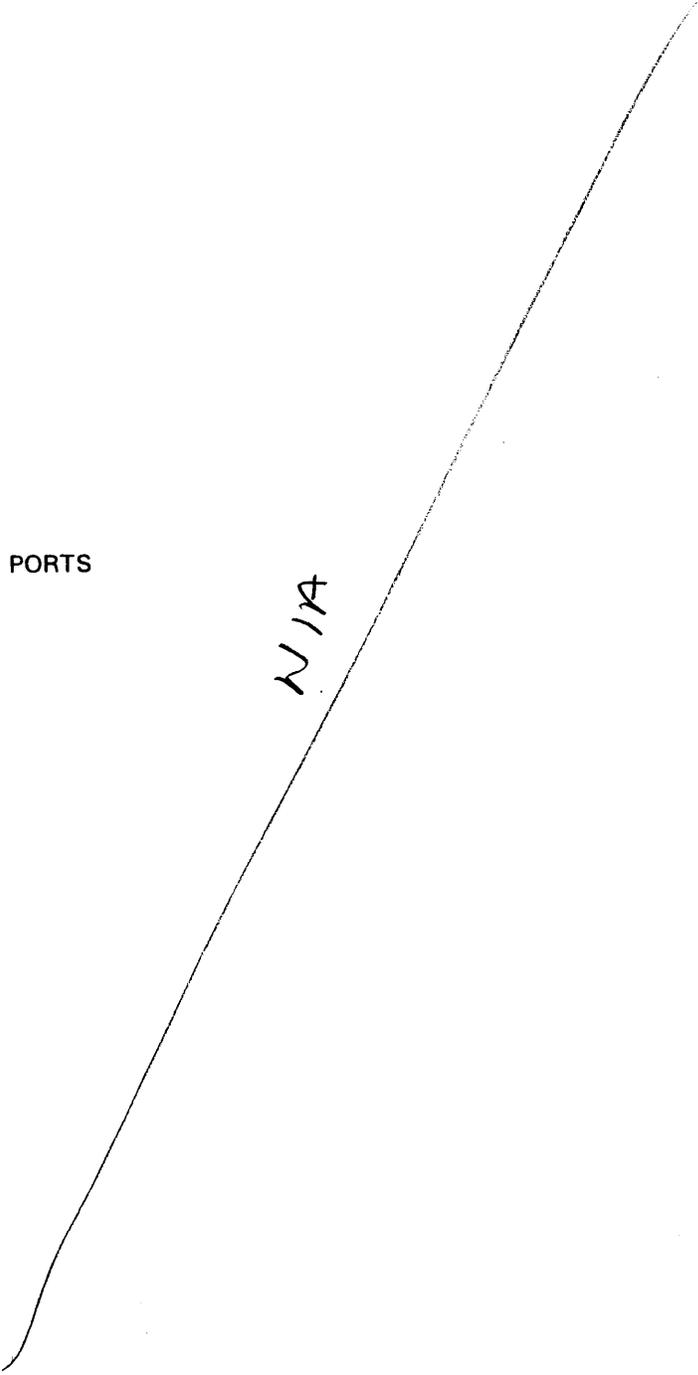

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found on the next page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
F I R S T	A-Head Restraint Type/Damage	1	0	1
	B-Seat Type	07	07	07
	C-Seat Orientation	1	1	1
	D-Seat Track Position	4	6	6
	E-Seat Back Incline Pre/Post Impact	14	14	14
	F-Seat Performance	1	1	1
S E C O N D	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			
T H I R D	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			
O T H E R	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

HEAD RESTRAINTS/SEAT EVALUATION

A-Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other
Specify): _____
- (9) Unknown

B-Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Box mounted seat (i.e., van type)
- (10) Other seat type (specify): _____
- (99) Unknown

C-Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

D-Seat Track Adjusted Position Prior To Impact

- (0) Occupant not seated or no seat
- (1) Non-adjustable seat track
- Adjustable Seat Track*
- (2) Seat at forward most track position
- (3) Seat between forward most and middle track positions
- (4) Seat at middle track position
- (5) Seat between middle and rear most track positions
- (6) Seat at rear most track position
- (9) Unknown

E-Seat Back Incline Prior and Post Impact

- (00) Occupant not seated or no seat
- (01) Not adjustable
- Upright prior to impact*
- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

Slightly reclined prior to impact




- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position
- (99) Unknown

F-Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat tracks/anchors failed _____
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

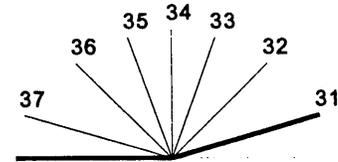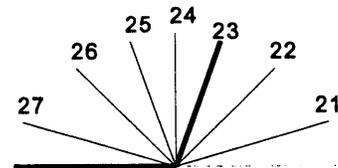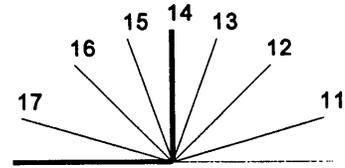

Coding diagrams for *Seat Back Incline Position Prior and Post Impact*

DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

1. Type of Child Safety Seat

- (0) No child safety seat
- (1) Infant seat
- (2) Toddler seat
- (3) Convertible seat
- (4) Booster seat
- (7) Other type child safety seat (specify):

- (8) Unknown child safety seat type
- (9) Unknown if child safety seat used

2. Child Safety Seat Orientation

- (00) No child safety seat
- Designed for Rear Facing for This Age/Weight
- (01) Rear facing
- (02) Forward facing
- (08) Other orientation (specify):

- (09) Unknown orientation
- Designed for Forward Facing for This Age/Weight
- (11) Rear facing
- (12) Forward facing
- (18) Other orientation (specify):

- (19) Unknown orientation
- Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
- (21) Rear facing
- (22) Forward facing
- (28) Other orientation (specify):

- (29) Unknown orientation
- (99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage

- (00) No child safety seat
- Not Designed with Harness/Shield/Tether
- (01) After market harness/shield/tether added, not used
- (02) After market harness/shield/tether used
- (03) Child safety seat used, but no after market harness/shield/tether added
- (09) Unknown if harness/shield/tether added or used
- Designed With Harness/Shield/Tether
- (11) Harness/shield/tether not used
- (12) Harness/shield/tether used
- (19) Unknown if harness/shield/tether used

- Unknown If Designed With Harness/Shield/Tether
- (21) Harness/shield/tether not used
- (22) Harness/shield/tether used
- (29) Unknown if harness/shield/tether used

- (99) Unknown if child safety seat used

6. Child Safety Seat Make/Model
(Specify make/model and occupant number)

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No Yes

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

- (8) Other area (e.g., back of pickup, etc.) (specify): _____
- (9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____

(5) Integral structure

- (8) Other medium (specify): _____
- (9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No Yes

Describe entrapment mechanism: LF Door jammed

Component(s): _____

(Note on vehicle interior sketch)



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 75
 2. Case Number - Stratum 158A
 3. Vehicle Number 01
 4. Occupant Number 01

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 58
 Code actual age at time of accident.
 (00) Less than one year old (specify by month): _____
 (97) 97 years and older
 (99) Unknown

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

6. Occupant's Sex 1
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

7. Occupant's Height 173
 Code actual height to the nearest centimeter.
 (999) Unknown
68 inches X 2.54 = 172.7 centimeters

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

8. Occupant's Weight 083
 Code actual weight to the nearest kilogram.
 (999) Unknown
182 pounds X .4536 = 82.5 kilograms

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

9. Occupant's Role 1
 (1) Driver
 (2) Passenger
 (9) Unknown

11. Occupant's Posture 0
 (0) Normal posture
Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

- (5) Integral structure
- (8) Other medium (specify):

- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 0

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors, fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 4

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or not oriented to time or place
- (2) Removed from vehicle due to perceived serious injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (8) Removed from vehicle for other reasons
(specify): _____
- (9) Unknown

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____

(9) Unknown19. Manual (Active) Belt System Use 04

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

20. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____(9) Unknown21. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor(7) Combination of above (specify): _____(8) Other manual belt failure (specify): _____(9) Unknown22. Manual Shoulder Belt Upper Anchorage Adjustment 1

- (0) No manual shoulder belt
- (1) No upper anchorage adjustment for manual shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or

automatic shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of automatic belt system (specify): _____(9) Unknown27. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor(7) Combination of above (specify): _____(8) Other automatic belt failure (specify): _____(9) Unknown

POLICE REPORTED RESTRAINT USE	AIR BAG SYSTEM FUNCTION
<p>28. Police Reported Belt Use <u>5</u></p> <p>(0) None used (1) Police did not indicate belt use (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt used, type not specified (6) Child safety seat (7) Automatic belt (8) Other type belt, (specify): _____ (9) Police indicated "unknown"</p> <p>29. Police Reported Air Bag Availability/Function <u>1</u></p> <p>(0) No air bag available (1) Police did not indicate air bag availability/function (2) Deployed (3) Not deployed (4) Unknown if deployed (9) Police indicated "unknown"</p> <hr/> <p>Check the Primary Source Used In Determining Belt Use.</p> <p><input type="checkbox"/> Vehicle inspection <input type="checkbox"/> Official injury data <input checked="" type="checkbox"/> Driver/occupant interview <input type="checkbox"/> Other (specify): _____</p> <p><input type="checkbox"/> Unknown if belt used</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>	<p>30. Frontal Air Bag System Availability/Function (This Occupant Position) <u>1</u></p> <p>(0) Not equipped/not available (1) Air bag <i>Non-functional</i> (2) Air bag disconnected (specify): _____ (3) Air bag not reinstalled (9) Unknown</p> <p>31. Frontal Air Bag System Deployment (This Occupant Position) <u>1</u></p> <p>(0) Not equipped/not available (1) Deployed during accident (as a result of impact) (2) Deployed inadvertently just prior to accident (3) Deployed, details unknown (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (5) Unknown if deployed (7) Nondeployed (9) Unknown</p> <p>32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) <u>0</u></p> <p>(0) Not equipped/not available (1) Air bag <i>Non-functional</i> (2) Air bag disconnected (specify): _____ (3) Air bag not reinstalled (9) Unknown <i>Specify type of "other" air bag present:</i> _____</p> <p>33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) <u>0</u></p> <p>(0) Not equipped with an "other" air bag (1) Deployed during accident (as a result of impact) (2) Deployed inadvertently just prior to accident (3) Deployed, details unknown (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical) (5) Unknown if deployed (7) Nondeployed (9) Unknown</p> <p>34. Are There Indications of Air Bag System Failure? (This Occupant Position) <u>1</u></p> <p>(0) Not equipped/not available (1) No (2) Yes (specify): _____ (9) Unknown</p>

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 1

- (0) Not equipped/not available
 (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
 (3) One previous accident with deployment
 (4) More than one previous accident with at least one deployment
 (8) Previous accidents, unknown deployment status
 (9) Unknown

36. Type of Air Bag 1

- (0) Not equipped/not available
 (1) Original manufacturer installed system
 (2) Retrofitted air bag
 (3) Replacement air bag
 (8) Unknown type of air bag
 (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 1

- (0) Not equipped/not available
 (1) No prior maintenance
 (2) Yes, prior maintenance (specify):

 (9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 01

- (00) Not equipped/not available
 _____ Code the accident event sequence number that initiated the air bag deployment
 (96) Deployed, unknown event
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

39. CDC For Air Bag Deployment Impact 1

- (0) Not equipped/not available
 (1) Highest delta V
 (2) Second highest delta V
 (3) Other non-coded delta V (specify):

 (6) Deployed, unknown event
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + 996

- (_000) Not equipped/not available
Code the value of the delta V for the impact that initiated the air bag deployment
 (_996) Deployment, unknown longitudinal Delta V
 (_997) Not deployed
 (_998) Unknown if deployed
 (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 2

- (0) Not equipped/not available
 (1) No
 (2) Yes
 (3) Deployed, unknown if flap(s) opened at designated tear points
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 1

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____
 (3) Deployed, unknown if air bag module cover flap(s) damaged
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

43. Was There Damage To The Air Bag? 01

- (00) Not equipped/not available
 (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
 (03) Cut
 (04) Torn
 (05) Holed
 (06) Burned
 (07) Abraded
 (88) Other damage (specify):

- (95) Damaged, details unknown
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION *continued*

HEAD RESTRAINT AND SEAT EVALUATION

44. Source of Air Bag Damage 01
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 1
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):

 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):

 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 1
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 1
 (0) Not air bag equipped/air bag not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

49. Head Restraint Type/Damage by Occupant at This Occupant Position 1
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 07
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 4
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track

Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown


HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact
 (00) Occupant not seated or no seat
 (01) Not adjustable

19
23


Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

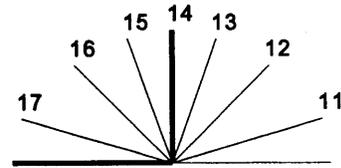


Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

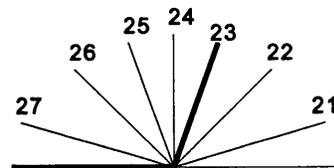

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

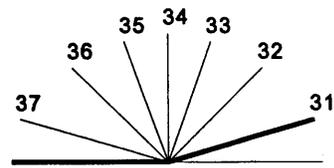

(99) Unknown

54. Seat Performance (this Occupant Position)

1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed
 (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): _____
- (7) _____
 Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used
56. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat - with shield
 (5) Booster seat - without shield
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used
57. Child Safety Seat Orientation 00
 (00) No child safety seat
- Designed for Rear Facing for This Age/Weight*
 (01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation
- Designed For Forward Facing for This Age/Weight*
 (11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation
- Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight*
 (21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation
- (99) Unknown if child safety seat used
58. Child Safety Seat Harness Usage 00
59. Child Safety Seat Shield Usage 00
60. Child Safety Seat Tether Usage 00
- Note: Options below applicable to
 Variables OA58-OA60.
 (00) No child safety seat
- Not Designed With Harness/Shield/Tether*
 (01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used
- Designed With Harness/Shield/Tether*
 (11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used
- Unknown If Designed With Harness/Shield/Tether*
 (21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used
- (99) Unknown if child safety seat used

INJURY CONSEQUENCES

61. Injury Severity (Police Rating) 2

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 6

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 5

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 00

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

EMERGENCY RESPONSE INFORMATION

EMS Notification

- (1) Not notified ROAD VEHICLE
- (2) Notified
- (9) Unknown AIR VEHICLE

EMS Notification Time (first unit)

- (9999) Unknown ROAD VEHICLE
- AIR VEHICLE

EMS Arrival Time (first unit)

- (9998) EMS cancelled or did not arrive ROAD VEHICLE
- (9999) Unknown AIR VEHICLE

EMS Departure Time To

- Treatment Facility (transporting unit)
- (9997) EMS arrived, provided treatment, but did not transport ROAD VEHICLE
- AIR VEHICLE
- (9998) EMS arrived, but was not used
- (9999) Unknown

EMS Arrival Time At

- Treatment Facility ROAD VEHICLE
- (9999) Unknown AIR VEHICLE

EMS Type

- (01) Fire department FIRST UNIT TRANSPORTING UNIT
- (02) Rescue squad
- (03) Police department ROAD VEHICLE
- (04) Trauma unit
- (05) Disaster unit AIR VEHICLE
- (06) Ambulance service unit
- (07) Hospital
- (08) Mortuaries/funeral homes
- (98) Other, specify: _____
- (99) Unknown

EMS Care

- (01) No care administered ON-SCENE DURING TRANSPORT
- (02) First aid
- (03) Resuscitation ROAD VEHICLE
- (04) CPR AIR VEHICLE
- (05) Emergency cardiac care
- (06) Life support system monitoring (blood pressure, pulse rate, respiration, EKG)
- (07) Emergency burn care
- (08) Combination of above, specify: _____
- (98) Other, specify: _____
- (99) Unknown

STOP WORK HERE VARIABLES 66-74 TO BE CODED BY THE ZONE CENTER

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES**

66. Time to Death 00
Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
(00) Not fatal
(96) Fatal - ruled disease
(99) Unknown
67. 1st Medically Reported Cause of Death 00
68. 2nd Medically Reported Cause of Death 00
69. 3rd Medically Reported Cause of Death 00
Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
(00) Not fatal or no additional causes
(96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown
70. Number of Recorded Injuries for This Occupant 01
Code the actual number of injuries recorded for this occupant.
(00) No recorded injuries
(97) Injured, details unknown
(99) Unknown if injured

TRAUMA DATA

71. Glasgow Coma Scale (GCS) Score 02
(at Medical Facility)
(00) Not injured
(01) Injured - not treated at medical facility
(02) No GCS Score at medical facility
(03-15) Code the actual value of the initial GCS Score recorded at medical facility.
(97) Injured, details unknown
(99) Unknown if injured
72. Was the Occupant Given Blood? 1
(1) No - blood not given
(2) Yes - blood given
(specify units): _____
(9) Unknown if blood given
73. Arterial Blood Gases (ABG) - HCO₃ 01
(00) Not injured
(01) Injured, ABGs not measured or reported
(02-50) Code the actual value of the HCO₃
(96) ABGs reported, HCO₃ unknown
(97) Injured, details unknown
(99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
(0) Not equipped/not available/destroyed or rendered inoperative
(1) Vehicle inspection
(2) Official injury data
(3) Driver/occupant interview
(8) Other (specify): _____
(9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>75</u>	3. Vehicle Number <u>01</u>
2. Case Number - Stratum <u>158A</u>	4. Occupant Number <u>01</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	A.I.S. - 90							Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
	Source of Injury Data	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				
	<i>FLINE INJURY</i>										
1st	5. <u>7</u>	6. <u>7</u>	7. <u>5</u>	8. <u>20</u>	9. <u>00</u>	10. <u>2</u>	11. <u>2</u>	12. <u>051</u>	13. <u>2</u>	14. <u>1</u>	15. <u>00</u>
2nd	16. ___	17. ___	18. ___	19. ___	20. ___	21. ___	22. ___	23. ___	24. ___	25. ___	26. ___
3rd	27. ___	28. ___	29. ___	30. ___	31. ___	32. ___	33. ___	34. ___	35. ___	36. ___	37. ___
4th	38. ___	39. ___	40. ___	41. ___	42. ___	43. ___	44. ___	45. ___	46. ___	47. ___	48. ___
5th	49. ___	50. ___	51. ___	52. ___	53. ___	54. ___	55. ___	56. ___	57. ___	58. ___	59. ___
6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head	<p><u>Vessels, Nerves, Organs.</u> <u>Bones, Joints</u> are assigned consecutive two digit numbers beginning with 02.</p> <p>The exceptions to this rule apply to:</p> <p><u>Whole Area</u> (02) Skin - Abrasion (04) Skin - Contusion (06) Skin - Laceration (08) Skin - Avulsion (10) Amputation (20) Burn (30) Crush (40) Degloving (50) Injury - NFS (90) Trauma, other than mechanical</p> <p><u>Head - LOC</u> (02) Length of LOC (04) Level (06) of (08) Consciousness (10) Concussion</p> <p><u>Spine</u> (02) Cervical (04) Thoracic (06) Lumbar</p>	<p>Specific injuries are assigned consecutive two-digit numbers beginning with 02.</p> <p>To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.</p> <p>Abbreviated Injury Scale</p> <p>(1) Minor Injury (2) Moderate Injury (3) Serious Injury (4) Severe Injury (5) Critical Injury (6) Maximum (untreatable) (7) Injured, unknown severity</p>	<p>(1) Right (2) Left (3) Bilateral (4) Central (5) Anterior (6) Posterior (7) Superior (8) Inferior (9) Unknown (0) Whole region</p>
(2) Face			
(3) Neck			
(4) Thorax			
(5) Abdomen			
(6) Spine			
(7) Upper Extremity			
(8) Lower Extremity			
(9) Unspecified			
Type of Anatomic Structure			
(1) Whole Area			
(2) Vessels			
(3) Nerves			
(4) Organs (includes Muscles/ligaments)			
(5) Skeletal (includes joints)			
(6) Head - LOC			
(9) Skin			

SOURCE OF INJURY DATA	INJURY SOURCE CONFIDENCE LEVEL	DIRECT/INDIRECT INJURY
<p><u>OFFICIAL RECORDS</u></p> <p>(1) Autopsy records with or without hospital/medical records</p> <p>(2) Hospital/medical records other than emergency room (e.g., discharge summary)</p> <p>(3) Emergency room records only (including associated X-rays or other lab reports)</p> <p>(4) Private physician, walk-in or emergency clinic</p> <p><u>UNOFFICIAL RECORDS</u></p> <p>(5) Lay coroner report</p> <p>(6) E.M.S. personnel</p> <p>(7) Interviewee</p> <p>(8) Other source (specify): _____</p> <p>(9) Police</p>	<p>(1) Certain (2) Probable (3) Possible (9) Unknown</p>	<p>(1) Direct contact injury (2) Indirect contact injury (3) Noncontact injury (7) Injured, unknown source</p>

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify): _____
- (195) Other air bag compartment cover (specify): _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

Restrained?

- No
- Yes

Blood Alcohol Level (mg/dl)

BAL = ____

Glasgow Coma Scale Score

GCSS = ____

Units of Blood Given

Units = ____


Arterial Blood Gases

pH = ____

PO₂ = ____



PCO₂ ____

HCO₃ ____

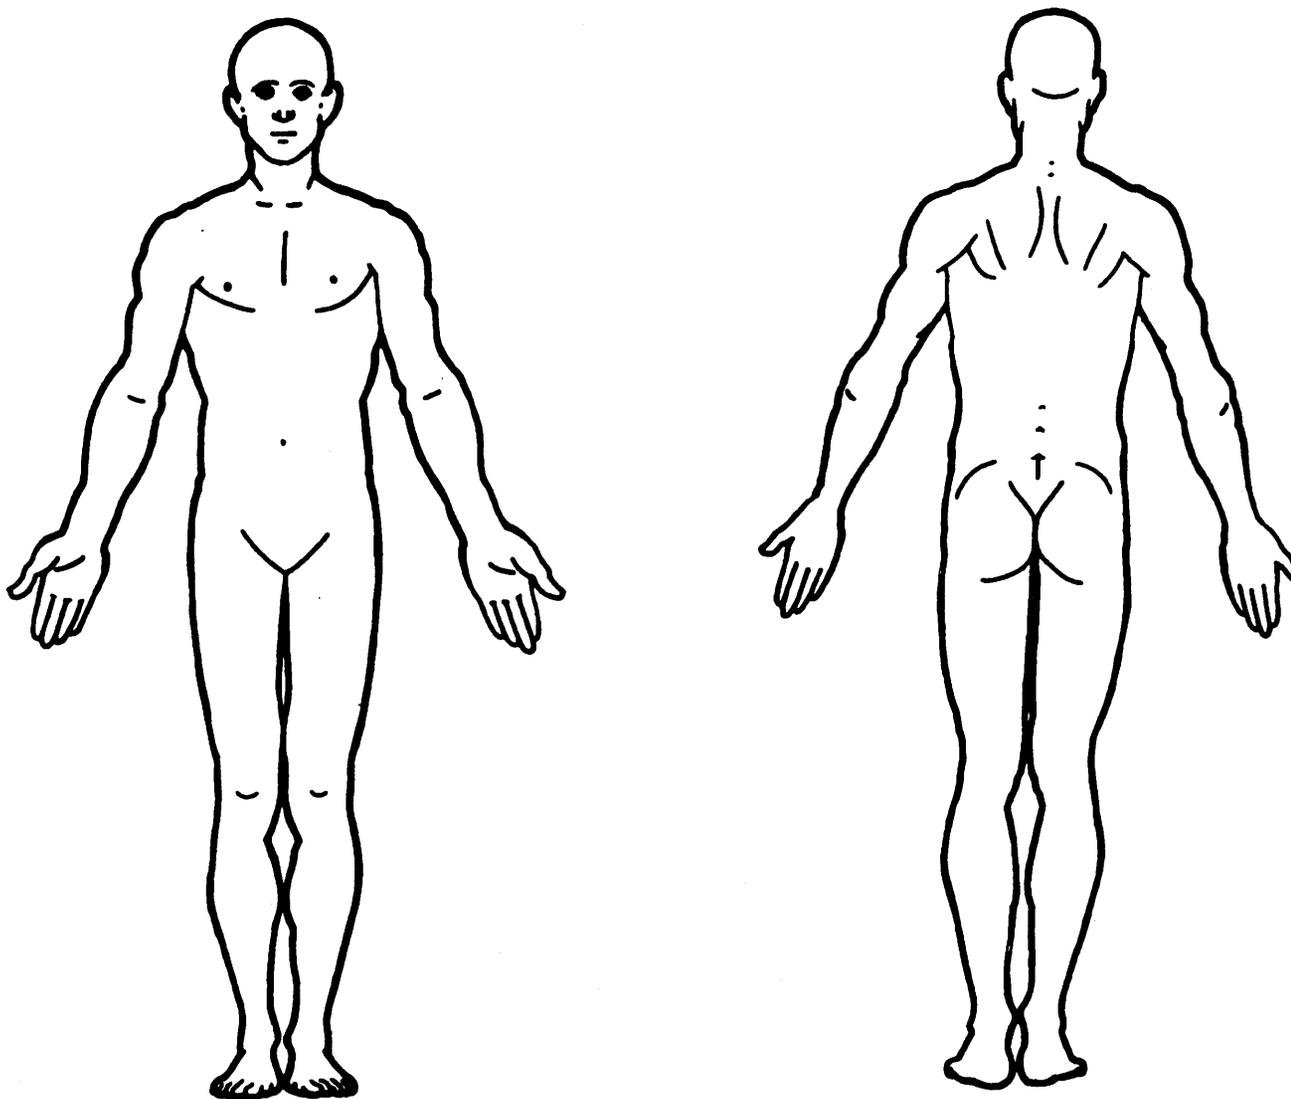



OFFICIAL INJURY DATA — SKELETAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

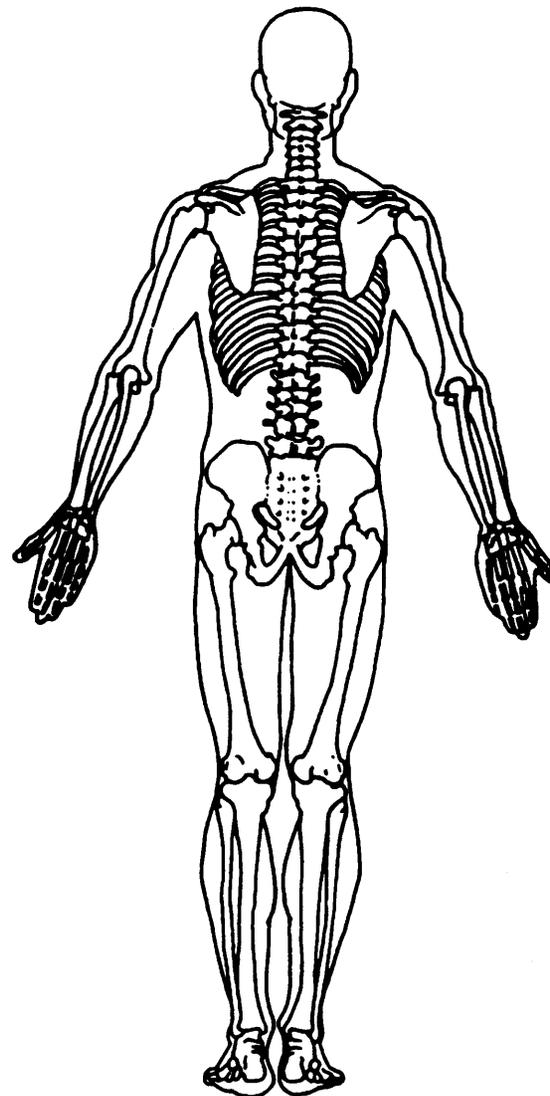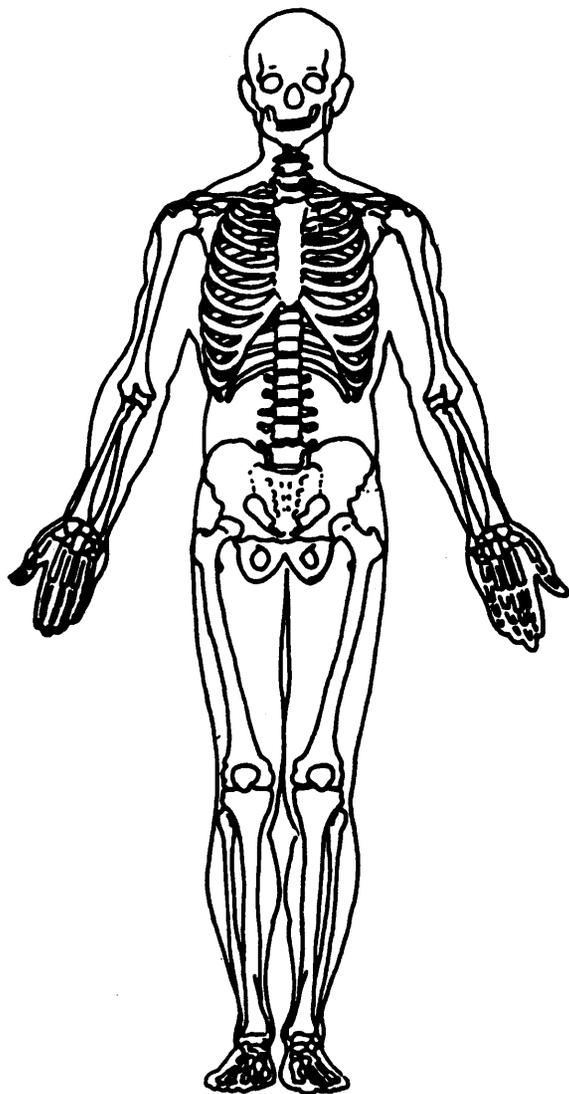

OFFICIAL INJURY DATA – INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

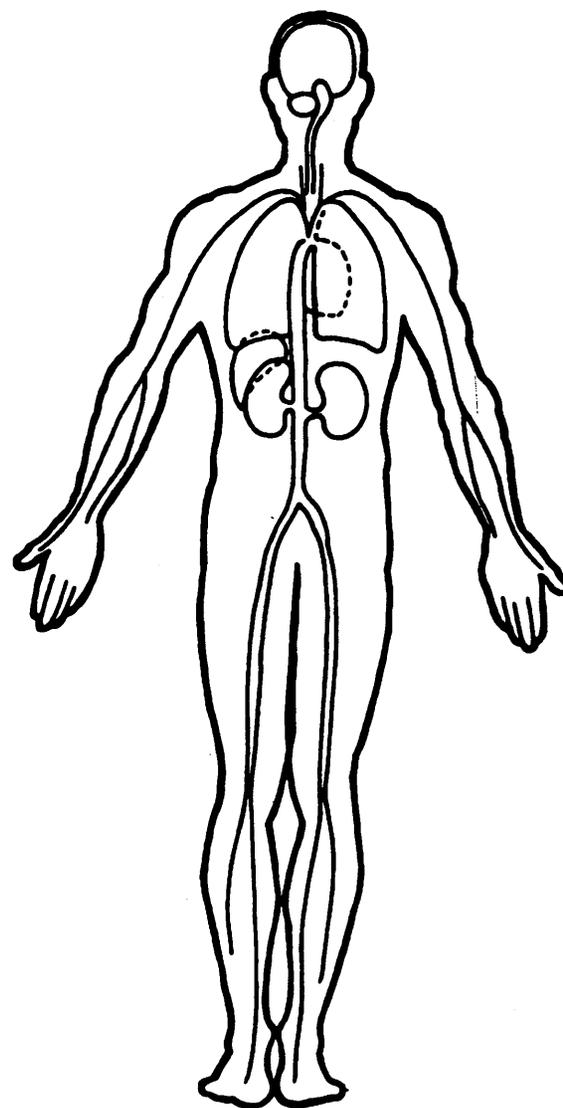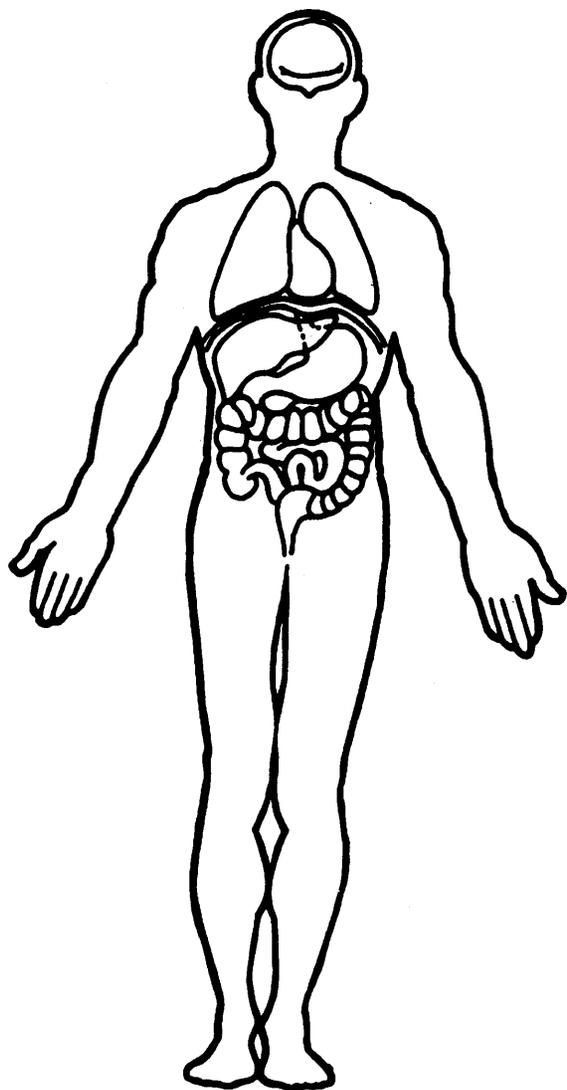

CODES FOR BODY TYPE

CDS APPLICABLE VEHICLES

Automobiles

- (01) Convertible (excludes sun-roof, t-bar)
- (02) 2-door sedan, hardtop, coupe
- (03) 3-door/2-door hatchback
- (04) 4-door sedan, hardtop
- (05) 5-door/4-door hatchback
- (06) Station wagon (excluding van and truck based)
- (07) Hatchback, number of doors unknown
- (08) Other automobile type (specify): _____
- (09) Unknown automobile type

Automobile Derivatives

- (10) Auto based pickup (includes El Camino, Caballero, Ranchero, Brat, and Rabbit pickup)
- (11) Auto based panel (cargo station wagon, auto based ambulance/hearse)
- (12) Large limousine - more than four side doors or stretched chassis
- (13) Three-wheel automobile or automobile derivative

Utility Vehicles ($\leq 4,536$ kgs GVWR)

- (14) Compact utility (Jeep CJ-2 - CJ-7, Scrambler, Golden Eagle, Renegade, Laredo, Wrangler, Cherokee [84 and after], Dispatcher, Raider, Bronco II, Bronco [76 and before], Explorer, S-10 Blazer, Geo Tracker, Bravada, S-15 Jimmy, Thing, Pathfinder, Trooper, Trooper II, Rodeo, Amigo, Navajo, 4-Runner, Montero, Passport, Samurai, Sidekick, Rocky)
- (15) Large utility (includes Jeep Cherokee [83 and before], Ramcharger, Trailduster, Bronco-fullsize [78 and after], fullsize Blazer, fullsize Jimmy, Hummer, Landcruiser, Rover, Scout, Yukon)
- (16) Utility station wagon (Chevy Suburban, GMC Suburban, Travelall, Grand Wagoneer, includes suburban limousine)
- (19) Utility, unknown body type

Van Based Light Trucks ($\leq 4,536$ kgs GVWR)

- (20) Minivan (Town and Country, Caravan, Grand Caravan, Voyager, Grand Voyager, Mini-Ram, Vista, Aerostar, Windstar, Villager, Lumina APV, Trans Sport, Silhouette, Astro, Safari, Toyota Van, Toyota Minivan, Previa, Nissan Minivan, Quest, Mitsubishi Minivan, Expo Wagon, Vanagon/Camper.)
- (21) Large van (B150-B350, Sportsman, Royal, Maxiwagon, Ram, Tradesman, Voyager [83 and before], E150-E350, Econoline, Clubwagon, Chateau, G10-G30, Chevy Van, Beauville, Sport Van, G15-G35, Rally Van, Vandura.)
- (22) Step van or walk-in van ($\leq 4,536$ kgs GVWR)
- (23) Van based motorhome ($\leq 4,536$ kgs GVWR)
- (24) Van based school bus ($\leq 4,536$ kgs GVWR)
- (25) Van based other bus ($\leq 4,536$ kgs GVWR)
- (28) Other van type (Hi-Cube Van, Kary) (specify): _____
- (29) Unknown van type

Light Conventional Trucks (Pickup style cab, $\leq 4,536$ kgs GVWR)

- (30) Compact pickup (D50, Colt P/U, Ram 50, Dakota, Arrow Pickup [foreign], Ranger, Courier, S-10, T-10, LUV, S-15, T-15, Sonoma, Datsun/Nissan Pickup, P'up, Mazda Pickup, Toyota Pickup, Mitsubishi Pickup)
- (31) Large Pickup (Jeep Pickup, Comanche, Ram Pickup, D100-D350, W100-W350, F100-F350, C10-C35, K10-K35, R10-R35, V10-V35, Silverado, Sierra, R100-R500, T100)
- (32) Pickup with slide-in camper
- (33) Convertible pickup
- (39) Unknown pickup style light conventional truck type

Other Light Trucks ($\leq 4,536$ kgs GVWR)

- (40) Cab chassis based (includes rescue vehicles, light stake, dump, and tow truck)
- (41) Truck based panel
- (42) Light truck based motorhome (chassis mounted)
- (45) Other light conventional truck type
- (48) Unknown light truck type
- (49) Unknown light vehicle type (automobile, utility, van, or light truck)

OTHER VEHICLES

Buses (Excludes Van Based)

- (50) School bus (designed to carry students, not cross country or transit)
- (58) Other bus type (e.g., transit, intercity, bus based motorhome) (specify): _____
- (59) Unknown bus type

Medium/Heavy Trucks ($> 4,536$ kgs GVWR)

- (60) Step van ($> 4,536$ kgs GVWR)
- (61) Single unit straight truck ($4,536$ kgs $<$ GVWR $\leq 8,845$ kgs)
- (62) Single unit straight truck ($8,845$ kgs $<$ GVWR $\leq 11,793$ kgs)
- (63) Single unit straight truck ($> 11,793$ kgs GVWR)
- (64) Single unit straight truck, GVWR unknown
- (65) Medium/heavy truck based motorhome
- (67) Truck-tractor with no cargo trailer
- (68) Truck-tractor pulling one trailer
- (69) Truck-tractor pulling two or more trailers
- (70) Truck-tractor (unknown if pulling trailer)
- (78) Unknown medium/heavy truck type
- (79) Unknown truck type (light/medium/heavy)

Motored Cycles (Does Not Include All-Terrain Vehicles/Cycles)

- (80) Motorcycle
- (81) Moped (motorized bicycle)
- (82) Three-wheel motorcycle or moped
- (88) Other motored cycle (minibike, motorscooter) (specify): _____
- (89) Unknown motored cycle type

Other Vehicles

- (90) ATV (All-Terrain Vehicle) and ATC (All-Terrain Cycle)
- (91) Snowmobile
- (92) Farm equipment other than trucks
- (93) Construction equipment other than trucks
- (97) Other vehicle type
- (99) Unknown body type

PRECRASH ENVIRONMENTAL DATA

19. Relation To Interchange Or Junction 0
 (0) Non-interchange area and non-junction
 (1) Interchange area related

Non-Interchange junctions

(2) Intersection related
 (3) Driveway, alley access related
 (4) Other junction (specify)

(5) _____
 Unknown type of junction

(9) Unknown

20. Trafficway Flow 0
 (0) Not physically divided (two way traffic)

(1) Divided trafficway-median strip without positive barrier
 (2) Divided trafficway-median strip with positive barrier
 (3) One way traffic
 (9) Unknown

21. Number Of Travel Lanes 2

(1) One
 (2) Two
 (3) Three
 (4) Four
 (5) Five
 (6) Six
 (7) Seven or more
 (9) Unknown

22. Roadway Alignment 1

(1) Straight
 (2) Curve right
 (3) Curve left
 (9) Unknown

23. Roadway Profile 1

(1) Level
 (2) Uphill grade (> 2%)
 (3) Hill crest
 (4) Downhill grade (> 2%)
 (5) Sag
 (9) Unknown

24. Roadway Surface Type 2

(1) Concrete
 (2) Bituminous (asphalt)
 (3) Brick or block
 (4) Slag, gravel, or stone
 (5) Dirt
 (8) Other (specify): _____
 (9) Unknown

25. Roadway Surface Condition 3

(1) Dry
 (2) Wet
 (3) Snow or slush
 (4) Ice
 (5) Sand, dirt, or oil
 (8) Other (specify): _____
 (9) Unknown

26. Light Conditions L

(1) Daylight
 (2) Dark
 (3) Dark, but lighted
 (4) Dawn
 (5) Dusk
 (9) Unknown

27. Atmospheric Conditions 0

(0) No adverse atmospheric-related driving conditions
 (1) Rain
 (2) Sleet/hail
 (3) Snow
 (4) Fog
 (5) Rain and fog
 (6) Sleet and fog
 (7) Other (e.g., smog, smoke, blowing sand or dust, etc.) (specify): _____
 (9) Unknown

28. Traffic Control Device 0

(0) No traffic control(s)
 (1) Traffic control signal (not RR crossing)

Regulatory

(2) Stop sign
 (3) Yield sign
 (4) School zone sign
 (5) Other regulatory sign (specify): _____

(6) Warning sign (not RR crossing)
 (7) Unknown sign
 (8) Miscellaneous/other controls including RR controls (specify): _____

(9) Unknown

29. Traffic Control Device Functioning 0

(0) No traffic control device
 (1) Traffic control device not functioning (specify): _____
 (2) Traffic control device functioning properly
 (9) Unknown

PRECRASH DRIVER RELATED DATA

30. Driver's Distraction/Inattention To Driving 01
 (Prior To Recognition Of Critical Event)
 (00) No driver present
 (01) Attentive or not distracted
 (02) Looked but did not see
Distractions
 (03) By other occupant(s), (specify): _____
 (04) By moving object in vehicle (specify): _____
 (05) While talking or listening to cellular phone (specify location and type of phone): _____
 (06) While dialing cellular phone (specify location and type of phone): _____
 (07) While adjusting climate controls
 (08) While adjusting radio, cassette, CD (specify): _____
 (09) While using other device/controls integral to vehicle (specify): _____
 (10) While using or reaching for device/object brought into vehicle (specify): _____
 (11) Sleepy or fell asleep
 (12) Distracted by outside person, object, or event (specify): _____
 (13) Eating or drinking
 (14) Smoking related
 (97) Distracted/inattentive, details unknown
 (98) Other, distraction (specify): _____
 (99) Unknown
31. Pre-Event Movement (Prior to Recognition of Critical Event) 01
 (00) No driver present
 (01) Going straight
 (02) Decelerating in traffic lane
 (03) Accelerating in traffic lane
 (04) Starting in traffic lane
 (05) Stopped in traffic lane
 (06) Passing or overtaking another vehicle
 (07) Disabled or parked in travel lane
 (08) Leaving a parking position
 (09) Entering a parking position
 (10) Turning right
 (11) Turning left
 (12) Making a U-turn
 (13) Backing up (other than for parking position)
 (14) Negotiating a curve
 (15) Changing lanes
 (16) Merging
 (17) Successful avoidance maneuver to a previous critical event
 (97) Other (specify): _____
 (99) Unknown
32. Critical Precrash Event 62
THIS VEHICLE LOSS OF CONTROL DUE TO:
 (01) Blow out or flat tire
 (02) Stalled engine
 (03) Disabling vehicle failure (e.g., wheel fell off) (specify): _____
 (04) Non-disabling vehicle problem (e.g., hood flew up) (specify): _____
 (05) Poor road conditions (puddle, pot hole, ice, etc.) (specify): _____
 (06) Traveling too fast for conditions
 (08) Other cause of control loss (specify): _____
 (09) Unknown cause of control loss

THIS VEHICLE TRAVELLING

- (10) Over the lane line on left side of travel lane
 (11) Over the lane line on right side of travel lane
 (12) Off the edge of the road on the left side
 (13) Off the edge of the road on the right side
 (14) End departure
 (15) Turning left at intersection
 (16) Turning right at intersection
 (17) Crossing over (passing through) intersection
 (18) This vehicle decelerating
 (19) Unknown travel direction

OTHER MOTOR VEHICLE IN LANE

- (50) Other vehicle stopped
 (51) Traveling in same direction with lower steady speed
 (52) Traveling in same direction while decelerating
 (53) Traveling in same direction with higher speed
 (54) Traveling in opposite direction
 (55) In crossover
 (56) Backing
 (59) Unknown travel direction of other motor vehicle in lane

OTHER MOTOR VEHICLE ENCROACHING INTO LANE

- (60) From adjacent lane (same direction)—over left lane line
 (61) From adjacent lane (same direction)—over right lane line
 (62) From opposite direction—over left lane line
 (63) From opposite direction—over right lane line
 (64) From parking lane
 (65) From crossing street, turning into same direction
 (66) From crossing street, across path
 (67) From crossing street, turning into opposite direction
 (68) From crossing street, intended path not known
 (70) From driveway, turning into same direction
 (71) From driveway, across path
 (72) From driveway, turning into opposite direction
 (73) From driveway, intended path not known
 (74) From entrance to limited access highway
 (78) Encroachment by other vehicle—details unknown

PEDESTRIAN, PEDALCYCLIST, OR OTHER NONMOTORIST

- (80) Pedestrian in roadway
 (81) Pedestrian approaching roadway
 (82) Pedestrian—unknown location
 (83) Pedalcyclist or other nonmotorist in roadway (specify): _____
 (84) Pedalcyclist or other nonmotorist approaching roadway, (specify): _____
 (85) Pedalcyclist or other nonmotorist—unknown location (specify): _____

OBJECT OR ANIMAL

- (87) Animal in roadway
 (88) Animal approaching roadway
 (89) Animal—unknown location
 (90) Object in roadway
 (91) Object approaching roadway
 (92) Object—unknown location
 (98) Other critical precrash event (specify): _____
 (99) Unknown

<p>33. Attempted Avoidance Maneuver <u>01</u></p> <p>(00) No driver present (01) No avoidance maneuver (02) Braking (no lockup) (03) Braking (lockup) (04) Braking (lockup unknown) (05) Releasing brakes (06) Steering left (07) Steering right (08) Braking and steering left (09) Braking and steering right (10) Accelerating (11) Accelerating and steering left (12) Accelerating and steering right (98) Other action (specify): _____ (99) Unknown</p> <p>34. Pre-Impact Stability <u>1</u></p> <p>(0) No driver present (1) Tracking (2) Skidding longitudinally—rotation less than 30 degrees (3) Skidding laterally—clockwise rotation (4) Skidding laterally—counterclockwise rotation (7) Other vehicle loss-of-control (specify): _____ (9) Precrash stability unknown</p>	<p>35. Pre-Impact Location <u>1</u></p> <p>(0) No driver present (1) Stayed in original travel lane (2) Stayed on roadway but left original travel lane (3) Stayed on roadway, not known if left original travel lane (4) Departed roadway (5) Remained off roadway (6) Returned to roadway (7) Entered roadway (9) Unknown</p> <p>36. Accident Type <u>65 51</u></p> <p>(Note: Applicable codes on back of this page)</p> <p>(00) No impact Code the number of the diagram that best describes the accident circumstance (98) Other accident type (specify): _____ (99) Unknown</p>
--	---

STOP HERE IF GV07 DOES NOT EQUAL 01 - 49

Category	Configuration	ACCIDENT TYPES (Includes Intent)						
I Single Driver	A Right Roadside Departure	01 DRIVE OFF ROAD	02 CONTROL/ TRACTION LOSS	03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN		
	B Left Roadside Departure	06 DRIVE OFF ROAD	07 CONTROL/ TRACTION LOSS	08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN		
	C Forward Impact	11 PARKED VEH.	12 STA. OBJECT	13 PEDESTRIAN/ ANIMAL	14 END DEPARTURE	15 SPECIFICS OTHER	16 SPECIFICS UNKNOWN	
II Same Trafficway Same Direction	D Rear-End	20 STOPPED 21, 22, 23	22 SLOWER 24, 25, 27	24 DECEL. 26, 28, 31	26 AVOID COLLISION WITH VEH.	28 AVOID COLLISION WITH OBJECT	(EACH • 32) SPECIFICS OTHER	(EACH • 33) SPECIFICS UNKNOWN
	E Forward Impact	34 CONTROL/ TRACTION LOSS	36 CONTROL/ TRACTION LOSS	38 AVOID COLLISION WITH VEH.	40 AVOID COLLISION WITH OBJECT	(EACH • 42) SPECIFICS OTHER	(EACH • 43) SPECIFICS UNKNOWN	
	F Sideswipe Angle	44 LATERAL MOVE	45 LATERAL MOVE	46 LATERAL MOVE	47 LATERAL MOVE	(EACH • 48) SPECIFICS OTHER	(EACH • 49) SPECIFICS UNKNOWN	
III Same Trafficway Opposite Direction	G Head-On	50 LATERAL MOVE	51 LATERAL MOVE	(EACH • 52) SPECIFICS OTHER	(EACH • 53) SPECIFICS UNKNOWN			
	H Forward Impact	54 CONTROL/ TRACTION LOSS	56 CONTROL/ TRACTION LOSS	58 AVOID COLLISION WITH VEH.	60 AVOID COLLISION WITH OBJECT	(EACH • 62) SPECIFICS OTHER	(EACH • 63) SPECIFICS UNKNOWN	
	I Sideswipe Angle	64 LATERAL MOVE	65 LATERAL MOVE	(EACH • 66) SPECIFICS OTHER	(EACH • 67) SPECIFICS UNKNOWN			
IV Change Trafficway Vehicle Turning	J Turn Across Path	68 INITIAL OPPOSITE DIRECTIONS	70 INITIAL SAME DIRECTIONS	72 INITIAL SAME DIRECTIONS	73 INITIAL SAME DIRECTIONS	(EACH • 74) SPECIFICS OTHER	(EACH • 75) SPECIFICS UNKNOWN	
	K Turn Into Path	77 TURN INTO SAME DIRECTION	78 TURN INTO SAME DIRECTION	80 TURN INTO OPPOSITE DIRECTIONS	81 TURN INTO OPPOSITE DIRECTIONS	(EACH • 84) SPECIFICS OTHER	(EACH • 85) SPECIFICS UNKNOWN	
V Intersecting Paths (Vehicle Damage)	L Straight Paths	87 LATERAL MOVE	88 LATERAL MOVE	(EACH • 89) SPECIFICS OTHER	(EACH • 90) SPECIFICS OTHER	(EACH • 91) SPECIFICS UNKNOWN		
VI Miscellaneous	M Backing Etc.	92 BACKING VEH.	93 OTHER VEH. OR OBJECT	98 Other Accident Type 99 Unknown Accident Type 00 No Impact				

OCCUPANT RELATED

37. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
38. Number of Occupants This Vehicle 02
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
39. Number of Occupant Forms Submitted 02

AIR BAG RELATED

40. Is this an AOPS Vehicle? 1
 (0) No (includes unknown)
 (1) Yes - researcher determined
 (2) VIN determined air bag system
 (3) VIN determined automatic (passive) belts
 (4) VIN determined air bag and automatic (passive) belts
41. Air Bag(s) Deployment, First Seat Frontal 2
 (0) Not equipped or not available
 (1) No air bags deployed
Single Air Bag Vehicle
 (2) Driver air bag deployed
 (3) Driver air bag, unknown if deployed
Multiple Air Bag Vehicle
 (4) Driver side only deployed
 (5) Passenger side only deployed
 (6) Driver and passenger side deployed
 (7) Driver and passenger side unknown if deployed
 (8) Air bag(s) deployed, details unknown
 (9) Unknown
42. Air Bag(s) Deployment, Other Than First Seat Frontal 0
 (0) Not equipped with an "other" air bag
 (1) Deployed during accident (as a result of impact)
 (2) Deployed inadvertently just prior to accident
 (3) Deployed, details unknown
 (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (5) Unknown if deployed
 (7) Nondeployed
 (9) Unknown

Specify type of "other" air bag present: _____

VEHICLE WEIGHT ITEMS

43. Vehicle Curb Weight 2,570
 Code weight to nearest 10 kilograms.
 (045) Less than 454 kilograms
 (612) 6,124 kilograms or more
 (999) Unknown
5,671 lbs X .4536 = 2,572.3 kgs

Source: _____

44. Vehicle Cargo Weight 0,050
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (454) 4,536 kilograms or more
 (999) Unknown
100 lbs X .4536 = 45.3 kgs

Source: _____

ROLLOVER DATA

45. Rollover 02
 (00) No rollover (no overturning)
Rollover (primarily about the longitudinal axis)
 (01-16) Code the number of quarter turns
 (17) Rollover, 17 or more quarter turns (specify): _____
 (98) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (99) Rollover (overturn), details unknown
46. Rollover Initiation Type 01
 (00) No rollover
 (01) Trip-over
 (02) Flip-over
 (03) Turn-over
 (04) Climb-over
 (05) Fall-over
 (06) Bounce-over
 (07) Collision with another vehicle
 (08) Other rollover initiation type specify): _____
 (98) Rollover--end-over-end
 (99) Unknown rollover initiation type
47. Location of Rollover Initiation 4
 (0) No rollover
 (1) On roadway
 (2) On shoulder - paved
 (3) On shoulder - unpaved
 (4) On roadside or divided trafficway median
 (8) Rollover--end-over-end
 (9) Unknown
48. Rollover Initiation Object Contacted 61
 (Note: Applicable codes on back of page)
49. Location on Vehicle Where Initial Principal Tripping Force Is Applied 1
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (6) Non-contact rollover forces (specify): _____
 (8) Rollover--end-over-end
 (9) Unknown
50. Direction of Initial Roll 1
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (8) Rollover--end-over-end
 (9) Unknown roll direction

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
- (01-30) — Vehicle Number

Noncollision

- (31) Turn-over — fall-over
- (32) No rollover impact initiation (end-over-end)
- (34) Jackknife

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail)
(specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify):

- (69) _____
Unknown fixed object

Collision with Nonfixed Object

- (70) Passenger car, light truck, van, or other vehicle not in-transport
- (71) Medium/heavy truck or bus not in-transport
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify):

- (89) _____
Unknown nonfixed object

- (98) Other event (specify):

- (99) _____
Unknown event or object

VERRIDE/UNDERRIDE (THIS VEHICLE)

51. Front Override/Underride (this Vehicle) 0

52. Rear Override/Underride (this Vehicle) 0
 (0) No override/underride, or not an end-to-end impact between two CDS applicable vehicles, and no medium/heavy truck or bus underride

Override (see specific CDC)
[Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49)]
 (1) 1st CDC
 (2) 2nd CDC
 (3) Other not automated CDC (specify):

Underride (see specific CDC)
[Between 2 CDS applicable vehicles (Bodytype, GV07 = 1-49)]
 (4) 1st CDC
 (5) 2nd CDC
 (6) Other not automated CDC (specify):

(7) Medium/heavy truck or bus override (of any configuration)
 (9) Unknown

ACCIDENT RECONSTRUCTION PROGRAMS HIGHEST DELTA V

58. Basis for Total (Resultant) Delta V (highest) 04

(00) No vehicle inspection

Delta V Calculated
 (01) Reconstruction program-damage only routine
 (02) Reconstruction program-damage and trajectory routine
 (03) Missing vehicle algorithm

Delta V Not Calculated
 (04) At least one vehicle (which may be this vehicle) is beyond the scope of an acceptable reconstruction program, regardless of collision conditions.

All vehicles within scope (CDC applicable) of reconstruction program but one of the collision conditions is beyond the scope of the reconstruction program or other acceptable reconstruction technique, regardless of adequacy of damage data.

(05) Rollover
 (06) Other non-horizontal forces
 (07) Sideswipe type damage
 (08) Severe override
 (09) Yielding object
 (10) Overlapping damage

HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V

Values: (000)-(359) Code actual value
 (996) Non-horizontal impact
 (997) Noncollision
 (998) Impact with object
 (999) Unknown

53. Heading Angle For This Vehicle 180

54. Heading Angle For Other Vehicle 297

(11) All vehicle and collision conditions are within scope of one of the acceptable reconstruction programs, but there is insufficient data available, (specify):

(98) Other, (specify): _____

RECONSTRUCTION DATA

55. Towed Trailing Unit 0
 (0) No towed unit
 (1) Yes—towed trailing unit
 (9) Unknown

56. Documentation of Trajectory Data for This Vehicle 1
 (0) No
 (1) Yes

57. Post Collision Condition of Tree or Pole (For Highest Delta V) 0
 (0) Not collision (for highest delta V) with tree or pole
 (1) Not damaged
 (2) Cracked/sheared
 (3) Tilted < 45 degrees
 (4) Tilted ≥ 45 degrees
 (5) Uprooted tree
 (6) Separated pole from base
 (7) Pole replaced
 (8) Other (specify):

 (9) Unknown

315

COMPUTER GENERATED CRASH SEVERITY

59. Total Delta V Highest
999

_____ Nearest kmph (highest)

_____ Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
 (160) 159.5 kmph and above
 (999) Unknown

60. Longitudinal Component of Delta V Highest
+ 999
- _____

_____ Nearest kmph (highest)

_____ Nearest kmph (secondary)

(NOTE: __000 means greater than -0.5 kmph and less than +0.5 kmph)
 (±160) ±159.5 kmph and above
 (_999) Unknown

61. Lateral Component of Delta V Highest
+ 999
- _____

_____ Nearest kmph (highest)

_____ Nearest kmph (secondary)

(NOTE: __000 means greater than -0.5 kmph and less than +0.5 kmph)
 (±160) ±159.5 kmph and above
 (_999) Unknown

62. Energy Absorption Highest
999.9 00

_____ Nearest 100 joules (highest)

_____ Nearest 100 joules (secondary)

(NOTE: 0000 means less than 50 joules)
 (9997) 999,650 joules or more
 (9999) Unknown

63. Impact Speed Highest
999

_____ Nearest kmph (highest)

_____ Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
 (160) 159.5 kmph and above
 (998) Trajectory algorithm not run
 (999) Unknown

DELTA V CONFIDENCE LEVEL

64. Confidence In Reconstruction Program Results (For Highest Delta V) 0
 (0) No reconstruction
 (1) Collision fits model — results appear reasonable
 (2) Collision fits model — results appear high
 (3) Collision fits model — results appear low
 (4) Borderline reconstruction — results appear reasonable

OTHER SPEED ESTIMATE

65. Barrier Equivalent Speed Highest

~~011~~
999

_____ Nearest kmph (highest)

_____ Nearest kmph (secondary)

(NOTE: 000 means less than 0.5 kmph)
 (160) 159.5 kmph and above
 (999) Unknown

ESTIMATED DELTA V	INSPECTION TYPE
<p>66. Estimated Highest Delta V (Researcher Determined) <u>8</u></p> <p>(0) Reconstruction Delta V coded</p> <p><i>Estimated Delta V</i></p> <p>(1) Less than 10 kmph (2) ≥ 10 kmph but < 25 kmph (3) ≥ 25 kmph but < 40 kmph (4) ≥ 40 kmph but < 55 kmph (5) ≥ 55 kmph</p> <p><i>Other estimates of damage severity</i></p> <p>(6) Minor (7) Moderate (8) Severe (9) Unknown</p>	<p>67. Type of Vehicle Inspection <u>3</u></p> <p>(0) No inspection (1) Vehicle fully repaired-no damage evident (2) Partial inspection (specify): _____ (3) Complete inspection</p> <hr/> <p style="text-align: center;">DELTA V EVENT NUMBER</p> <p>68. Delta V Event Number <u>01</u></p> <p>_____ Code the accident event sequence number that resulted in the Delta V that has been coded above for this vehicle (99) Unknown</p>
<p>*** IF THE CDS APPLICABLE VEHICLE WAS NOT INSPECTED (I.E., GV67 = 0), ***</p> <p>DO NOT COMPLETE THE EXTERIOR AND INTERIOR VEHICLE FORMS</p> <p>*** IF GV07 DOES NOT EQUAL 01-49, DO NOT COMPLETE ***</p> <p>THE EXTERIOR VEHICLE, INTERIOR VEHICLE, OCCUPANT ASSESSMENT, AND OCCUPANT INJURY FORMS.</p>	



EXTERIOR VEHICLE FORM

2pm

1. Primary Sampling Unit Number <u>75</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>158A</u>	

VEHICLE IDENTIFICATION

VIN 1GN GK26J7TJ [REDACTED] Model Year 96
 Vehicle Make (specify): Chevrolet Vehicle Model (specify): Suburban

LOCATOR

Locate the end of the damage with respect to the vehicle's damaged center point or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L	Location of Max Crush
01	Begins LF BC	BC to BC	C1
01	Begins LF BC	Begins LF BC	
02	TOP	NIA	

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

Specific Impact Number	Plane of Impact C-Measurements	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Width (CDC)	Max Crush								
01	Left	398	C4	399	30	49	47	60	52	62	+19.5
script	FreeSpace		21		0	6	6	6	0	11	
1302	Result				30	43	41	54	52	51	
97.5					33	33	33	33	33	33	
31.5					0	10	8	21	19	18	
01	Front	44	C1	160	75	31	18	17	21	31	62
* setup	FreeSpace				20	11	2	2	11	20	
575	Result				55	20	16	15	10	11	
559				-	16	16	16	16	16	16	
02	Rollover	289	158		39	4	0	0	0	0	
			-126								
			32								


00 TY D 0 04

ORIGINAL SPECIFICATIONS WORK SHEET

Wheelbase	<u>131.5</u>	inches	x 2.54	=	<u>334.0</u>	cm
Overall Length	<u>220.0</u>	inches	x 2.54	=	<u>558.8</u>	cm
Maximum Width	<u>76.7</u>	inches	x 2.54	=	<u>194.8</u>	cm
Curb Weight	GTI <u>5,671</u>	pounds	x .4536	=	<u>2,572.3</u>	kg
Average Track	_____	inches	x 2.54	=	_____	cm
Front Overhang	_____	inches	x 2.54	=	_____	cm
Rear Overhang	_____	inches	x 2.54	=	_____	cm
Undeformed End Width	_____	inches	x 2.54	=	_____	cm
Engine Size: cyl./displ.	<u>V-8 5.7L</u>	cc	x .001	=	_____	L
	_____	CID	x .0164	=	_____	L

VEHICLE DAMAGE SKETCH

TIRE - WHEEL DAMAGE a. Rotation physically restricted RF <u>2</u> LF <u>1</u> RR <u>2</u> LR <u>1</u> (1) Yes (2) No (8) NA (9) Unk.		ORIGINAL SPECIFICATIONS Wheelbase <u>334</u> cm Overall Length <u>559</u> cm Maximum Width <u>195</u> cm Curb Weight <u>2572</u> kg Average Track <u>NOT AVAILABLE</u> cm Front Overhang <u>↓</u> cm Rear Overhang <u>↓</u> cm Undeformed End Width <u>168</u> cm Engine Size: cyl./displ. <u>V-8 5.7L</u> L		WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only) RF ± <u> </u> ° LF ± <u>80</u> ° RR ± <u> </u> ° LR ± <u>05</u> ° Within ± 5 degrees	
TYPE OF TRANSMISSION <input type="checkbox"/> Manual <input checked="" type="checkbox"/> Automatic END SHIFT ≥ 10 CM <input type="checkbox"/> Yes <input checked="" type="checkbox"/> No		DRIVE WHEELS <input type="checkbox"/> FWD <input type="checkbox"/> RWD <input checked="" type="checkbox"/> 4WD		Approximate Tow package Cargo Weight <u>Brush guard +100 lbs</u> kg	

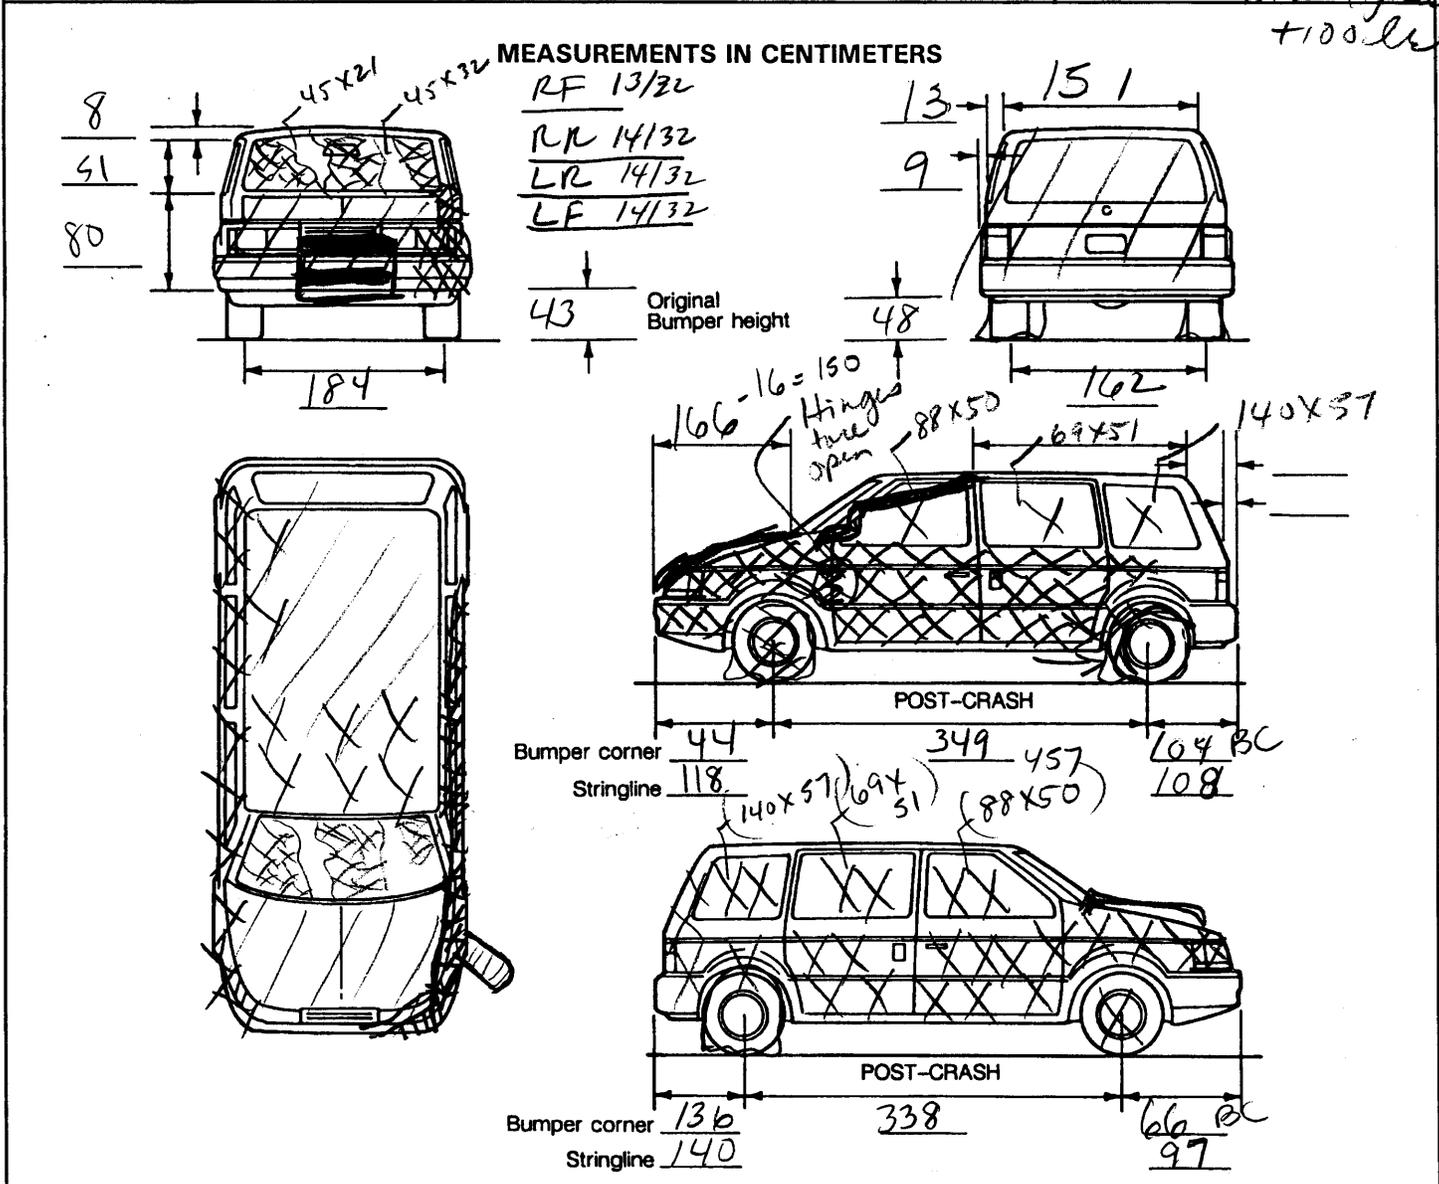

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page. Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>01</u>	6. <u>11</u>	7. <u>K</u> <u>F</u>	8. <u>D</u> <u>L</u>	9. <u>A</u> <u>E</u>	10. <u>W</u>	11. <u>02</u>

Second Highest Delta "V"

12. <u>030²</u>	13. <u>31</u>	14. <u>00</u>	15. <u>T</u>	16. <u>V</u>	17. <u>D</u>	18. <u>0</u>	19. <u>04</u>
----------------------------	---------------	---------------	--------------	--------------	--------------	--------------	---------------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
<u>399</u>	<u>000</u>	<u>010</u>	<u>008</u>	<u>024</u>	<u>019</u>	<u>018</u>	<u>020</u>
<u>168</u>	<u>039</u>	<u>004</u>	<u>000</u>	<u>000</u>	<u>000</u>	<u>000</u>	<u>-062</u>

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
_____	_____	_____	_____	_____	_____	_____	_____
_____	_____	_____	_____	_____	_____	_____	_____

26. Undeformed End Width
(Coded when highest severity impact is an end plane impact.)
Code to the nearest centimeter 168
(250) 250 centimeters or more
(998) No highest severity end plane impact
(999) Unknown

27. Direct Damage Width
(For highest severity impact)
Code to the nearest centimeter 044
(250) 250 centimeters or more
(999) Unknown

28. Original Wheelbase
Code to the nearest centimeter 334
(650) 650 centimeters or more
(999) Unknown
131.5 inches X 2.54 = _____ centimeters

29. Original Average Track Width
Code to the nearest centimeter 173
(185) 185 centimeters or more
(999) Unknown
_____ inches X 2.54 = 173 centimeters

FUEL SYSTEM

30. Are CDCs Documented but Not Coded on The Automated File? 0
 (0) No
 (1) Yes

31. Researcher's Assessment of Vehicle Disposition 1
 (0) Not towed due to vehicle damage
 (1) Towed due to vehicle damage
 (9) Unknown

32. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? 0
 (0) No post manufacturer modifications
 (1) Yes - post manufacturer modifications (specify): _____

 (Include photograph of CERTIFICATION PLACARD in case report)
 (9) Unknown if vehicle is modified

35. Location of Fuel Tank-1 Filler Cap 2

36. Location of Fuel Tank-2 Filler Cap 0
 (0) No fuel tank
 (1) On back plane
 (2) Aft of center of the rear wheels (rear axle) on left side plane
 (3) Aft of center of the rear wheels (rear axle) on right side plane
 (4) Forward of center of the rear wheels (rear axle) on left side plane
 (5) Forward of center of the rear wheels (rear axle) on right side plane
 (6) Over the center of the rear wheels (rear axle) on left side plane
 (7) Over the center of the rear wheels (rear axle) on right side plane
 (8) Other (specify): _____
 (9) Unknown

37. Type of Fuel Tank-1 2

38. Type of Fuel Tank-2 0
 (0) No fuel tank (electrical vehicle)
 (1) Metallic
 (2) Non-metallic
 (9) Unknown

39. Location of Fuel Tank-1 1

40. Location of Fuel Tank-2 0
 (0) No fuel tank
 (1) Aft of center of the rear wheels (rear axle) centered
 (2) Aft of center of the rear wheels (rear axle) left side
 (3) Aft of center of the rear wheels (rear axle) right side
 (4) Forward of center of the rear wheels (rear axle) centered
 (5) Forward of center of the rear wheels (rear axle) left side
 (6) Forward of center of the rear wheels (rear axle) right side
 (7) Over center of the rear wheels (rear axle)
 (8) Other (specify): _____
 (9) Unknown

41. Damage to Fuel Tank-1 1

42. Damage to Fuel Tank-2 0
 (0) No fuel tank
 (1) No damage to fuel tank
 (2) Deformed, no seam failure
 (3) Deformed, with a seam failure
 (4) Punctured
 (5) Lacerated (ripped)
 (6) Abraded (scraped)
 (7) Filler neck separation from the fuel tank
 (8) Other damage (specify): _____
 (9) Unknown

FIRE OCCURRENCE

33. Fire Occurrence 0
 (0) No fire
 Yes, fire occurred
 (1) Minor
 (2) Major
 (9) Unknown

34. Origin of Fire 0
 (0) No fire
 (1) Vehicle exterior (front, side, back, top)
 (2) Exhaust system
 (3) Fuel tank (and other fuel retention system parts)
 (4) Engine compartment
 (5) Cargo/trunk compartment
 (6) Instrument panel
 (7) Passenger compartment area
 (8) Other location (specify): _____
 (9) Unknown

<p>43. Leakage Location of Fuel System-1 1</p> <p>44. Leakage Location of Fuel System-2 0</p> <p>(0) No fuel tank (1) No fuel leakage</p> <p><i>Primary Area Of Leakage</i></p> <p>(2) Tank (3) Filler neck (4) Cap (5) Lines/pump/filter (6) Vent/emission recovery (8) Other (specify): _____ (9) Unknown</p> <p>45. Fuel Type-1 01</p> <p>46. Fuel Type-2 00</p> <p><i>Single Fuel Type</i></p> <p>(00) No fuel tank (01) Gasoline (02) Diesel (03) CNG (Compressed Natural Gas) (04) LPG (Liquid Petroleum Gas) also known as Propane (05) LNG (Liquid Natural Gas) (06) Methanol (M100 or M85) (07) Ethanol (E100 or E85) (08) Other (Hydrogen or others) (specify): _____</p> <p>_____</p> <p><i>Electric Powered or Electric/Solar Powered Vehicles</i></p> <p>(10) Lead Acid Battery (11) Nickel-Iron Battery (12) Nickel-Cadmium Battery (13) Sodium Metal Chloride Battery (14) Sodium Sulfur Battery (18) Other (Specify): _____</p> <p>(98) Other Hybrid (specify): _____</p> <p>_____</p> <p>(99) Unknown fuel type</p>	<p>47. Is This Vehicle Equipped With More Than Two Fuel Tanks? 0</p> <p>(0) No (one or two tanks only)</p> <p><i>Yes - More Than Two Tanks</i></p> <p>(1) Yes -- <u>no damage</u> to any tank or filler cap and <u>no fuel system leakage</u></p> <p>(2) Yes -- <u>no damage</u> to any tank or filler cap but <u>there is fuel system leakage</u> (specify leakage location): _____</p> <p>(3) Yes -- <u>damage</u> to an additional tank or filler cap and <u>there is fuel system leakage</u> (specify the following): Type of tank _____ Tank location _____ Filler cap location _____ Tank damage _____ Location of leakage _____ Type of fuel _____</p> <p>(9) Unknown if more than two tanks</p> <p style="text-align: center;">COMMENTS</p> <p>_____</p>
---	---

*** STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED ***

(GV10=0)

DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 75
 2. Case Number - Stratum 158A
 3. Vehicle Number 02

INTEGRITY

4. Passenger Compartment Integrity 98
 (00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door) 45x32
- (04) Roof
- (05) Roof glass 45x21
- (06) Side window
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):
Windshield, Side Window, LF Door
- (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 2 6. RF 3 7. LR 3 8. RR 1 9. TG/H 1

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify): _____
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 3 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

- (0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify): _____
- (9) Unknown

GLAZING

Type of Window/Windshield Glazing

15. WS 1 16. LF 2 17. RF 2 18. LR 2 19. RR 2
 20. BL 2 21. Roof 0 22. Other 2

- (0) No glazing
- (1) AS-1 - Laminated
- (2) AS-2 - Tempered
- (3) AS-3 - Tempered-tinted (original)
- (4) AS-2 - Tempered-with after market tint
- (5) AS-3 - Tempered-tinted (with additional after market tint)
- (6) AS-14 - Glass/Plastic
- (7) Glazing removed prior to accident
- (8) Other (specify): _____
- (9) Unknown

Window Precrash Glazing Status

23. WS 1 24. LF 2 25. RF 2 26. LR 2 27. RR 2
 28. BL 1 29. Roof 0 30. Other 1

- (0) No glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (7) Glazing removed prior to accident
- (9) Unknown

Glazing Damage from Impact Forces

31. WS 3 32. LF 6 33. RF 6 34. LR 6 35. RR 6
 36. BL 1 37. Roof 0 38. Other 6

- (0) No glazing
- (1) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (9) Unknown if damaged


Glazing Damage from Occupant Contact

39. WS 1 40. LF 1 41. RF 1 42. LR 1 43. RR 1
 44. BL 1 45. Roof 0 46. Other 1

- (0) No glazing
- (1) No occupant contact to glazing
- (2) Glazing contacted by occupant but no glazing damage
- (3) Glazing in place and cracked by occupant contact
- (4) Glazing in place and holed by occupant contact
- (5) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (6) Glazing out-of-place by occupant contact and holed by occupant contact
- (7) Glazing removed prior to accident
- (8) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

INTRUSION WORKSHEET

NOTE: SKETCH INTRUDED AREAS

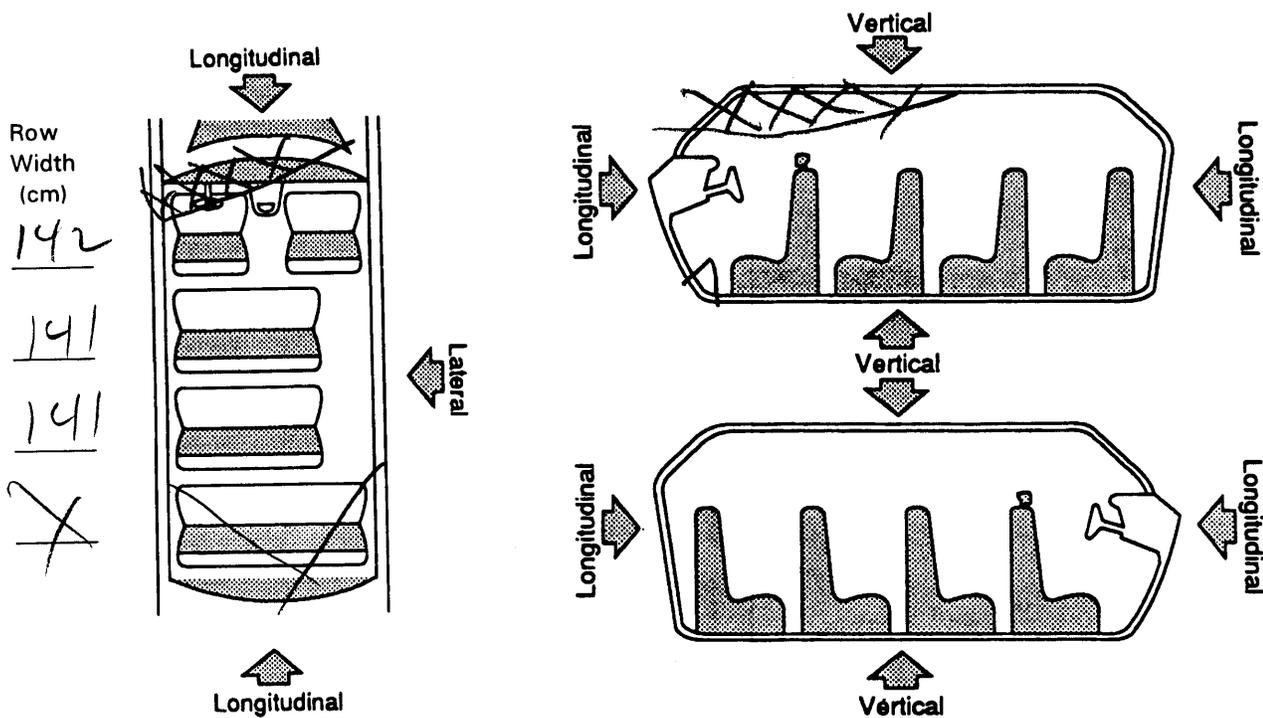

LOCATION OF INTRUSION	INTRUDED COMPONENT	(All Measurements Are In Centimeters)			DOMINANT CRUSH DIRECTION
		COMPARISON VALUE	INTRUDED VALUE	INTRUSION	
11	Roof	87	59	to seat C 28 (4)	Vert
12	↓	87	69	= 18 (6)	↓
13	↓	87	70	= 17 (7)	↓
11	A pillar	356	317	to rear of truck 39 (1)	Long
11	Door panel			7 an estimate 7	Lat
11	Floor pan	61	52	= 9	Vert
11	DASH	169	162	Dash to C-pillar 7	Long
12	↓	83	83	to r-side B pillar 0	Long
21	B pillar	270	232	to end of veh end 38 (2)	Long
11	Wind. Header	81	56	to seat C 25 (3)	Vert
12	↓	81	59	= 22 (4)	↓
13	↓	81	62	= 19 (1)	↓
11	Roof Side Rail	162	125	= 37 (3)	Lateral
13	DASH	83	84	to B pillar 0	Long
11	Panel A pillar	57	42	= 15 (10)	Lateral

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. <u>11</u>	48. <u>06</u>	49. <u>4</u>	50. <u>2</u>
2nd	51. <u>21</u>	52. <u>07</u>	53. <u>4</u>	54. <u>2</u>
3rd	55. <u>11</u>	56. <u>14</u>	57. <u>4</u>	58. <u>3</u>
4th	59. <u>11</u>	60. <u>13</u>	61. <u>3</u>	62. <u>1</u>
5th	63. <u>11</u>	64. <u>16</u>	65. <u>3</u>	66. <u>1</u>
6th	67. <u>12</u>	68. <u>16</u>	69. <u>3</u>	70. <u>1</u>
7th	71. <u>13</u>	72. <u>16</u>	73. <u>3</u>	74. <u>1</u>
8th	75. <u>12</u>	76. <u>13</u>	77. <u>3</u>	78. <u>1</u>
9th	79. <u>13</u>	80. <u>13</u>	81. <u>3</u>	82. <u>1</u>
10th	83. <u>11</u>	84. <u>10</u>	85. <u>3</u>	86. <u>3</u>

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- ~~(07) B-pillar~~
- (08) C-pillar
- (09) D-pillar
- (10) Side panel - forward of the A1/A2-pillar
- (11) Door panel (side)
- (12) Side panel - rear of the B-pillar
- (13) Roof (or convertible top)
- ~~(14) Roof side rail~~
- ~~(15) Windshield~~
- ~~(16) Windshield header~~
- ~~(17) Window frame~~
- ~~(18) Floor pan (includes sill)~~
- ~~(19) Backlight header~~
- ~~(20) Front seat back~~
- ~~(21) Second seat back~~
- ~~(22) Third seat back~~
- ~~(23) Fourth seat back~~
- ~~(24) Fifth seat back~~
- ~~(25) Seat cushion~~
- ~~(26) Back door/panel (e.g., tailgate)~~
- (27) Other interior component (specify): _____

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify): _____
- (32) Other exterior object in the environment (specify): _____
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): _____
- (99) Unknown

LOCATION OF INTRUSION

- Front Seat
- (11) Left
 - (12) Middle
 - (13) Right

- Fourth Seat
- (41) Left
 - (42) Middle
 - (43) Right

- Second Seat
- (21) Left
 - (22) Middle
 - (23) Right

- (97) Catastrophic
- (98) Other enclosed area (specify) _____

- Third Seat
- (31) Left
 - (32) Middle
 - (33) Right

- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)

COMPARISON VALUE	—	DAMAGE VALUE	=	DEFORMATION
------------------	---	--------------	---	-------------

	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--

	—		=	
--	---	--	---	--

--	--	--	--	--

STEERING COLUMN

INSTRUMENT PANEL

87. Steering Column Type 2
 (1) Fixed column
 (2) Tilt column
 (3) Telescoping column
 (4) Tilt and telescoping column
 (8) Other column type (specify):
 (9) Unknown

88. Tilt Steering Column Adjustment 1
 (0) No tilt steering column
 (1) Full up
 (2) Between full up and center
 (3) Center
 (4) Between center and full down
 (5) Full down
 (9) Unknown

89. Telescoping Steering Column Adjustment 0
 (0) No telescoping steering column
 (1) Full back
 (2) Between full back and midpoint
 (3) Midpoint
 (4) Between midpoint and full forward
 (5) Full forward
 (9) Unknown


90. Steering Rim/Spoke Deformation 00
 Code actual measured
 deformation to the nearest centimeter
 (00) No steering rim deformation
 (01-14) Actual measured value in centimeters
 (15) 15 centimeters or more
 (98) Observed deformation cannot be measured
 (99) Unknown

91. Location of Steering Rim/Spoke Deformation 00
 (00) No steering rim deformation

- Damage appears to be from roof collapse*
- Quarter Sections**
 (01) Section A
 (02) Section B
 (03) Section C
 (04) Section D



- Half Sections**
 (05) Upper half of rim/spoke
 (06) Lower half of rim/spoke
 (07) Left half of rim/spoke
 (08) Right half of rim/spoke
 (09) Complete steering wheel collapse
 (10) Undetermined location
 (99) Unknown



92. Odometer Reading 036,000
 kilometers
 Code to the nearest 1,000 kilometers
 (000) No odometer
 (001) Less than 1,500 kilometers
 (500) 499,500 kilometers or more
 (999) Unknown
022,487 miles X 1.6093 = 36,178.6 kilometers

Source: [REDACTED]

93. Instrument Panel Damage from Occupant Contact? 1
 (0) No
 (1) Yes
 (9) Unknown

94. Type of Knee Bolster Covering 2
 (0) No knee bolster
 (1) Padded
 (2) Rigid plastic
 (8) Other (specify):
 (9) Unknown

95. Knee Bolsters Deformed from Occupant Contact? 2
 (0) No knee bolster
 (1) No deformation
 (2) Yes - deformation
 (9) Unknown



96. Did Glove Compartment Door Open During Collision(s)? 2
 (0) No glove compartment door
 (1) No - door did not open
 (2) Yes - door opened
 (9) Unknown

97. Adaptive (Assistive) Driving Equipment 0
 (0) No adaptive driving equipment
 (1) Adaptive driving equipment installed (Check all that apply.)
 Hand controls for braking/acceleration
 Steering control devices (attached to OEM steering wheel)
 Steering knob attached to steering wheel
 Low effort power steering (unit or device)
 Replacement steering wheel (i.e., reduced diameter)
 Joy-stick steering controls
 Wheelchair tie-downs
 Modification to seat belts (specify):
 Additional or relocated switches (specify):
 Raised roof
 Wall-mounted head rest (used behind wheelchair)
 Other adaptive device (specify):

(9) Unknown

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

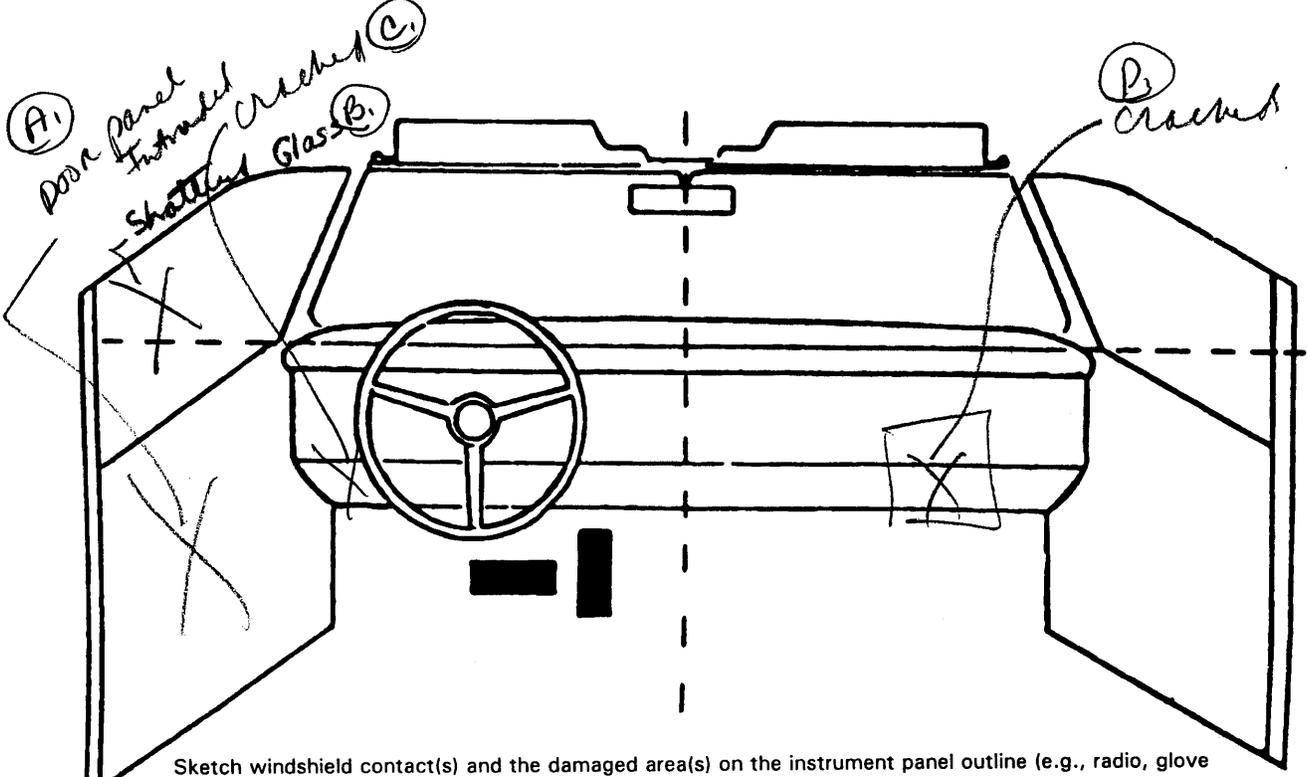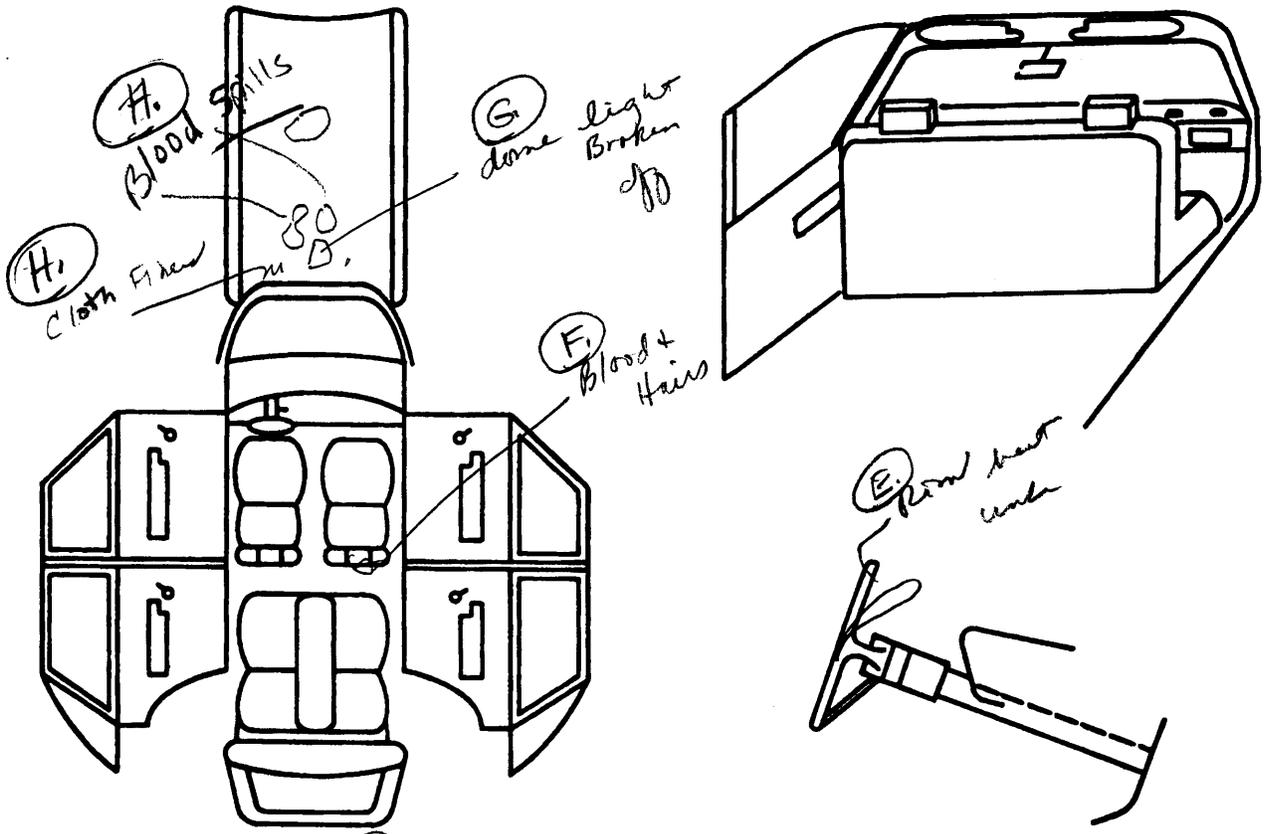

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).
 Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
 Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	051	01	L. Side	Intruded	2
B	056	01	Head	Flying Glass	2
C	010	01	L. Knee	panel cracked	2
D	013	02	Knees	cracked	2
E	004	01	chest	dent	3
F	155	02	Head	Hair strands + Blood	2
G	205	01	Head	dome light Broken	2
H	205	01	unk	Blood Spots, Cloth Fibers	2
I					
J					
K					
L					
M					
N					

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object, (specify): _____
- (019) Other front object (specify): _____

CODES FOR INTERIOR COMPONENTS

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____
- RIGHT SIDE**
- (101) Right side interior surface, excluding hardware or armrests
- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____
- AIR BAG**
- (170) Air bag-driver side
- (175) Air bag compartment cover-driver side
- (180) Air bag-passenger side
- (185) Air bag compartment cover-passenger side
- (190) Other air bag (specify) _____
- (195) Other air bag compartment cover (specify) _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof
- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form. If a child safety seat is present, encode the data on the back of this page 11. If the vehicle has automatic restraints available, encode the appropriate data on page 6.

		Left	Center	Right
FIRST	A-Availability	4	X	4
	B-Evidence of usage	04		00
	C-Used in this crash?	04		00
	D-Proper Use	1		00
	E-Failure Modes	1		00
	F-Anchorage Adjustment	2		4
SECOND	A-Availability	4	3	4
	B-Evidence of usage	00	00	00
	C-Used in this crash?	00	00	00
	D-Proper Use	0	0	0
	E-Failure Modes	0	0	0
	F-Anchorage Adjustment	1	1	1
OTHER	A-Availability	4		4
	B-Evidence of usage	00		00
	C-Used in this crash?	00		00
	D-Proper Use	0		0
	E-Failure Modes	0		0
	F-Anchorage Adjustment	1		1

- | | | |
|---|---|--|
| <p>A-Manual (Active) Belt System Availability</p> <ul style="list-style-type: none"> (0) None available (1) Belt removed/destroyed (2) Shoulder belt (3) Lap belt (4) Lap and shoulder belt (5) Belt available - type unknown <p><i>Integral Belt Partially Destroyed</i></p> <ul style="list-style-type: none"> (6) Shoulder belt (lap belt destroyed/removed) (7) Lap belt (shoulder belt destroyed/removed) (8) Other belt (specify): _____ (9) Unknown <p>B/C-Manual (Active) Belt System Use</p> <ul style="list-style-type: none"> (00) None used, not available, or belt removed/destroyed (01) Inoperable (specify): _____ (02) Shoulder belt (03) Lap belt (04) Lap and shoulder belt (05) Belt used - type unknown (08) Other belt used (specify): _____ (12) Shoulder belt used with child safety seat (13) Lap belt used with child safety seat (14) Lap and shoulder belt used with child safety seat (15) Belt used with child safety seat - type unknown (18) Other belt used with child safety seat (specify): _____ (99) Unknown if belt used | <p>D-Proper Use of Manual (Active) Belts</p> <ul style="list-style-type: none"> (0) None used or not available (1) Belt used properly (2) Belt used properly with child safety seat <p><i>Belt Used Improperly</i></p> <ul style="list-style-type: none"> (3) Shoulder belt worn under arm (4) Shoulder belt worn behind back or seat (5) Belt worn around more than one person (6) Lap belt worn on abdomen (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____ (8) Other improper use of manual belt system (specify): _____ (9) Unknown <p>E-Manual (Active) Belt Failure Modes During Accident</p> <ul style="list-style-type: none"> (0) No manual belt used or not available (1) No manual belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): _____ (6) Broken retractor (7) Combination of above (specify): _____ (8) Other manual belt failure (specify): _____ (9) Unknown | <p>F-Shoulder Belt Upper Anchorage Adjustment</p> <ul style="list-style-type: none"> (0) No shoulder belt (1) No upper anchorage adjustment for shoulder belt <p><i>Adjustable shoulder Belt Upper Anchorage</i></p> <ul style="list-style-type: none"> (2) In full up position (3) In mid position (4) In full down position (5) Position unknown (9) Unknown if position has adjustable upper anchorage adjustment |
|---|---|--|

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Frontal Air Bags--Left Front	Frontal Air Bags-Right Front	Other Air Bag
FIRST	Availability/Function	/	/	
	Deployment	/	/	
	Failure	/	/	

Air Bag System Availability/Function

- (0) Not equipped/not available
- (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify): _____
- (3) Air bag not reinstalled _____
- (9) Unknown

Air Bag System Deployment (This Occupant Position)

- (0) Not equipped/not available
- (1) Deployed during accident (as a result of impact)
- (2) Deployed inadvertently just prior to accident
- (3) Deployed, accident sequence undetermined
- (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (5) Unknown if deployed
- (7) Nondeployed
- (9) Unknown

Are There Indications of Air Bag System Failure? (This Occupant Position)

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____
- (9) Unknown

AUTOMATIC BELTS

		Left	Right
FIRST	A-Availability/Function	/	/
	B-Use	/	/
	C-Type	/	/
	D-Proper Use	/	/
	E-Failure Modes	/	/

A-Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown
- Non-functional*
- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

B-Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

C-Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

D-Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or

automatic shoulder belt used improperly with child safety seat (specify): _____

- (8) Other improper use of automatic belt system (specify): _____
- (9) Unknown

E-Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

FIRST SEAT FRONTAL AIR BAGS

NOTES: Encode the applicable data *for the driver and first seat passenger* in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

	Driver	Passenger
A-Type of air bag?	1	X
B-Flaps open at tear points?	2	
C-Flaps damaged?	1	
D-Air bag damaged?	01	
E-Source of air bag damage	01	
F-Air bag tethered?	2	
G-Air bag have vent ports?	2	
H-Other occupant contact air bag?	3	
I-Occupant wearing eyewear?	4	

A-Type of Air Bag

- (0) Not equipped/not available
- (1) Original manufacturer installed system
- (2) Retrofitted air bag
- (3) Replacement air bag
- (8) Unknown type of air bag
- (9) Unknown

B-Did Air Bag Module Cover Flap(s) Open At Designated Tear Points?

- (0) Not equipped/not available
- (1) No
- (2) Yes
- (3) Deployed, unknown if flap(s) opened at designated tear points
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

C-Were Air Bag Module Cover Flap(s) Damaged?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if air bag module cover flap(s) damaged
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

D-Was There Damage To The Air Bag?

- (00) Not equipped/not available
- (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
- (03) Cut
- (04) Torn
- (05) Holed
- (06) Burned
- (07) Abraded
- (88) Other damage (specify):

E-Source of Air Bag Damage

- (00) Not equipped/not available
- (01) Not damaged
- (02) Object worn by occupant, (specify):
- (03) Object carried by occupant, (specify):
- (04) Adaptive/assistive controls, (specify):
- (05) Fire in vehicle
- (06) Thermal burns
- (07) Rescue or emergency efforts
- (88) Other damage source (specify):
- (95) Damaged, unknown source
- (96) Deployed, unknown if damaged
- (97) Not deployed
- (98) Unknown if deployed
- (99) Unknown

F-Was The Air Bag Tethered?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of tether straps):
- 3
- (3) Deployed, unknown if tethered
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

G-Did The Air Bag Have Vent Ports?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify number of vent ports):
- 2
- (3) Deployed, unknown if vent ports present
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown

H-Was the Air Bag in this Occupant's Position Contacted by Another Occupant?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify):
- (3) Deployed, unknown if other occupant contact to air bag
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown


I-Was This Occupant Wearing Eye-wear?

- (0) Not equipped/not available
- (1) No
- (2) Eyeglasses/sunglasses
- (3) Contact lenses
- (4) Deployed, unknown if eyewear worn
- (7) Not deployed
- (8) Unknown if deployed
- (9) Unknown


eyeglasses
found in
vehicle

DRIVER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Front)

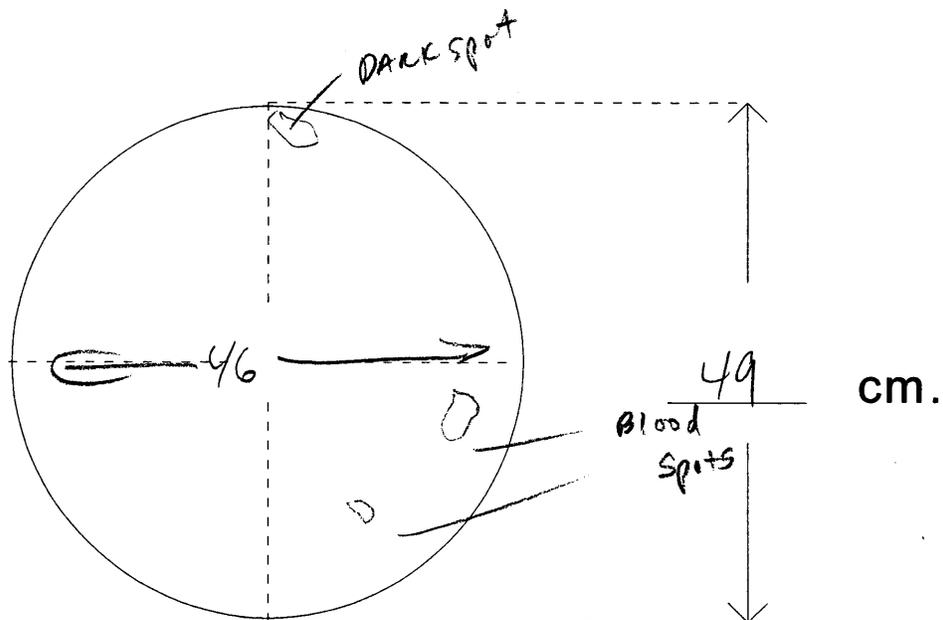


2. SKETCH DAMAGE AND CONTACT EVIDENCE ON DRIVER AIR BAG (Back)

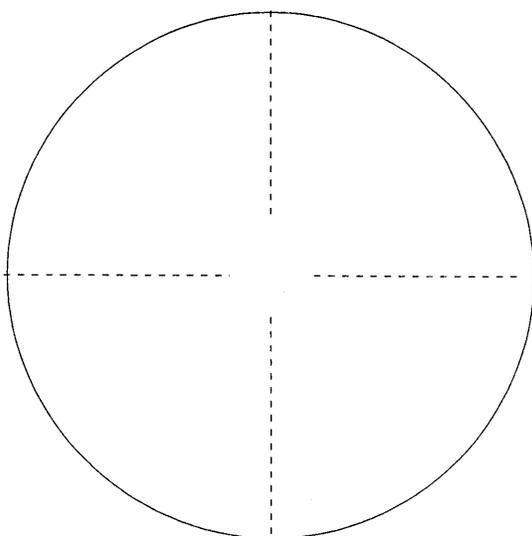

DRIVER AIR BAG SKETCHES (Cont'd)


3. DRIVER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

width (W_U) _____ width (W_L) _____
 height (H) _____

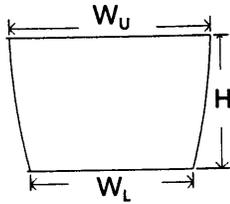

4. DRIVER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)


a. Upper Flap b. Lower Flap
 width (W_U) _____ width (W_L) _____
 height (H_U) _____ height (H_L) _____

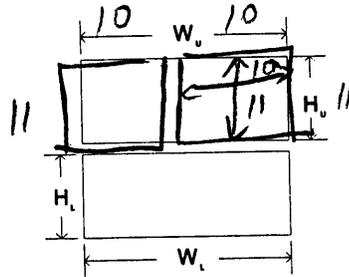

5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE


6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

7. SKETCH LOCATION OF CIRCULAR AIR BAG VENT PORTS

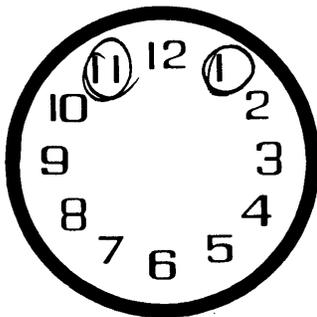


PASSENGER AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Front)

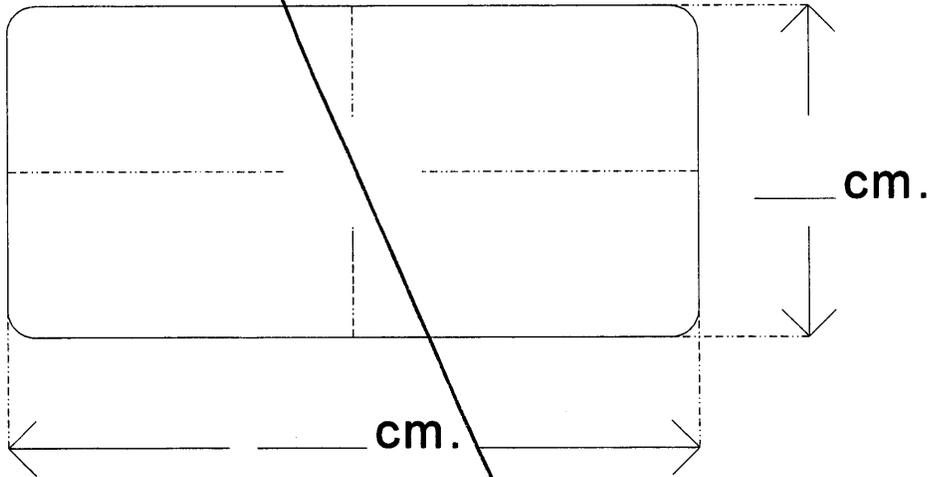

2. SKETCH DAMAGE AND CONTACT EVIDENCE ON PASSENGER AIR BAG (Back) *NIA*

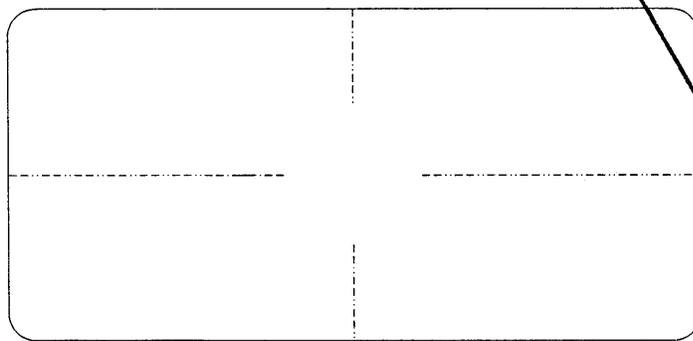


PASSENGER AIR BAG SKETCHES (Cont'd)

3. PASSENGER AIR BAG MODULE COVER FLAP SIZE (SINGLE)

width (W) _____

height (H) _____

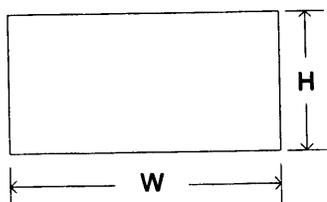

4. PASSENGER AIR BAG MODULE COVER FLAP SIZE (DOUBLE)

a. Upper Flap


b. Lower Flap

width (W_U) _____

width (W_L) _____

height (H_U) _____

height (H_L) _____

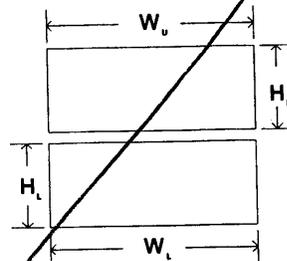


5. SKETCH OF OTHER TYPE OF AIR BAG MODULE FLAP AND SIZE

N/A

6. SKETCH OF OTHER TYPE OF AIR BAG VENT PORTS

7. SKETCH LOCATION OF RECTANGULAR AIR BAG VENT PORTS

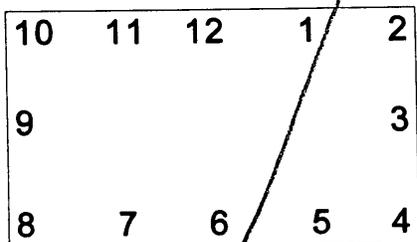

"OTHER" AIR BAG DAMAGE AND CONTACT SKETCHES

1. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Front)

NIA


2. SKETCH DAMAGE AND CONTACT EVIDENCE ON "OTHER" AIR BAG (Back)

"OTHER" AIR BAG SKETCHES (Cont'd)

3. SKETCH AIR BAG MODULE FLAP AND SIZE OR OPENING FOR AIRBAG

4. SKETCH AIR BAG VENT PORTS

N/A

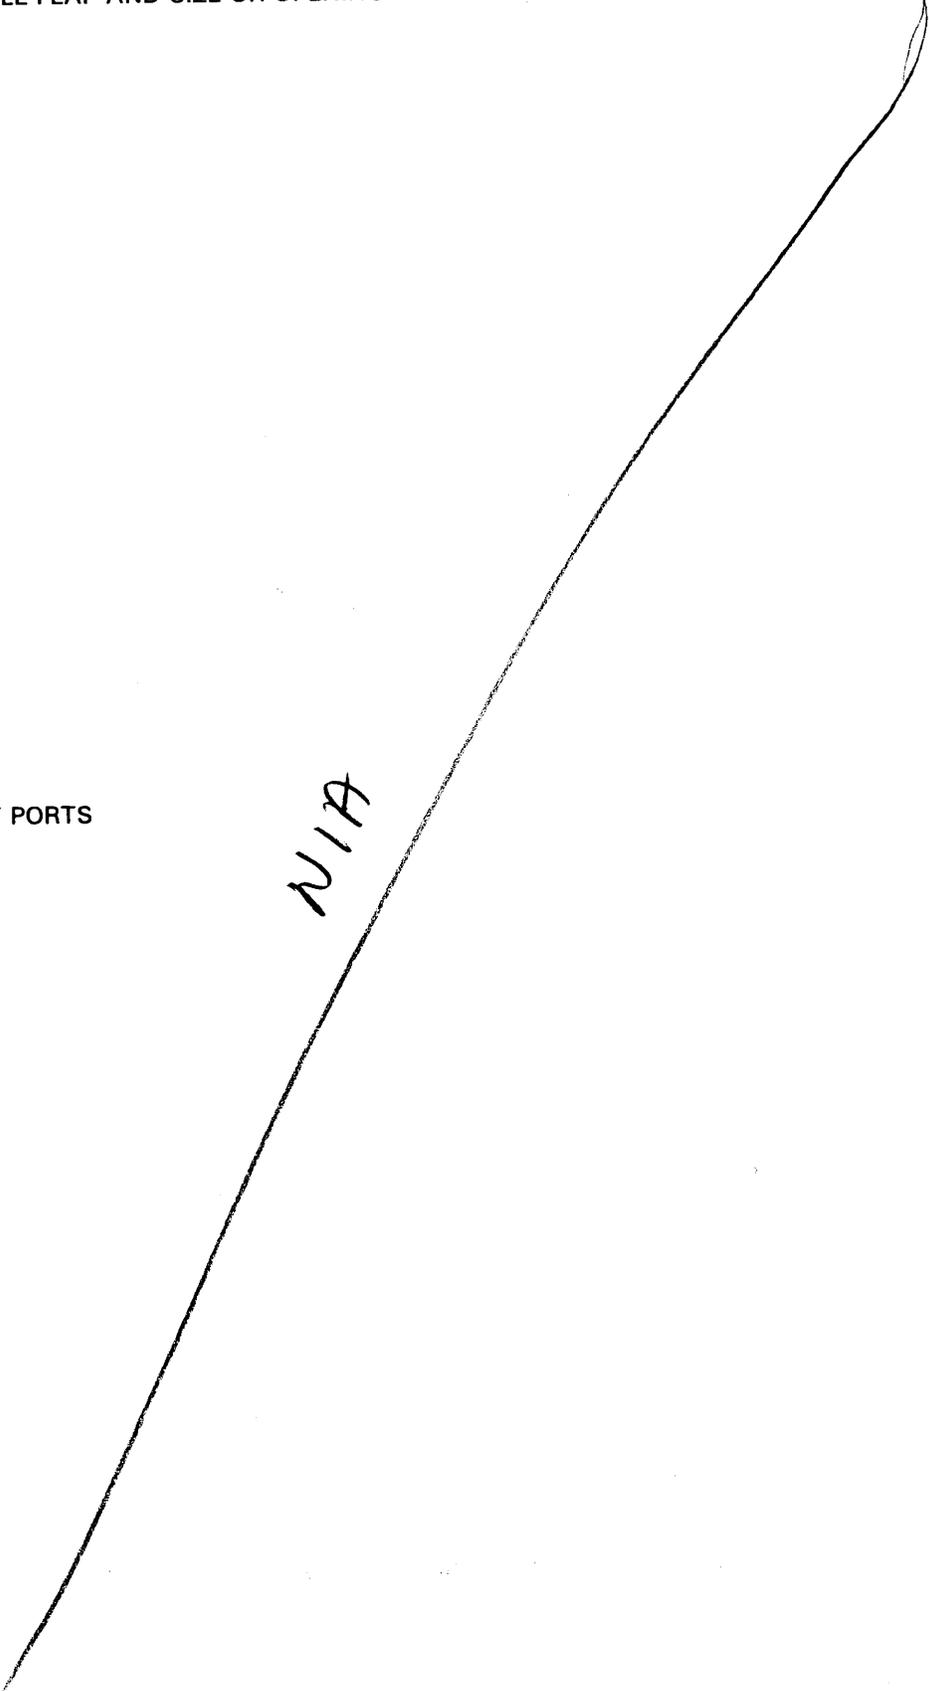

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found on the next page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
FIRST	A-Head Restraint Type/Damage	4	Center	3
	B-Seat Type	01		01
	C-Seat Orientation	1		1
	D-Seat Track Position	3		3
	E-Seat Back Incline Pre/Post Impact	13		14
	F-Seat Performance	6		1
SECOND	A-Head Restraint Type/Damage	3	0	3
	B-Seat Type	05	05	05
	C-Seat Orientation	1	1	1
	D-Seat Track Position	1	1	1
	E-Seat Back Incline Pre/Post Impact	01	01	01
	F-Seat Performance	6	6 <small>LT Door panel</small>	6
THIRD	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			
OTHER	A-Head Restraint Type/Damage			
	B-Seat Type			
	C-Seat Orientation			
	D-Seat Track Position			
	E-Seat Back Incline Pre/Post Impact			
	F-Seat Performance			

**DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE
(I.E., UNUSUAL OCCUPANT CONTACT PATTERN)**

HEAD RESTRAINTS/SEAT EVALUATION

A-Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other (Specify): _____
- (9) Unknown

B-Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Box mounted seat (i.e., van type)
- (10) Other seat type (specify): _____
- (99) Unknown

C-Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

D-Seat Track Adjusted Position Prior To Impact

- (0) Occupant not seated or no seat
 - (1) Non-adjustable seat track
- Adjustable Seat Track*
- (2) Seat at forward most track position
 - (3) Seat between forward most and middle track positions
 - (4) Seat at middle track position
 - (5) Seat between middle and rear most track positions
 - (6) Seat at rear most track position
 - (9) Unknown

E-Seat Back Incline Prior and Post Impact

- (00) Occupant not seated or no seat
- (01) Not adjustable

Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

Slightly reclined prior to impact




- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position
- (99) Unknown

F-Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): Floor Pan Intruded
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

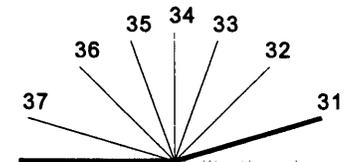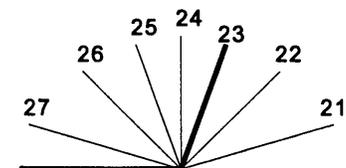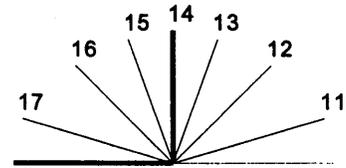

Coding diagrams for Seat Back Incline Position Prior and Post Impact

DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

1. Type of Child Safety Seat

- (0) No child safety seat
- (1) Infant seat
- (2) Toddler seat
- (3) Convertible seat
- (4) Booster seat
- (7) Other type child safety seat (specify):

- (8) Unknown child safety seat type
- (9) Unknown if child safety seat used

2. Child Safety Seat Orientation

- (00) No child safety seat
- Designed for Rear Facing for This Age/Weight
- (01) Rear facing
- (02) Forward facing
- (08) Other orientation (specify):

- (09) Unknown orientation
- Designed for Forward Facing for This Age/Weight
- (11) Rear facing
- (12) Forward facing
- (18) Other orientation (specify):

- (19) Unknown orientation
- Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
- (21) Rear facing
- (22) Forward facing
- (28) Other orientation (specify):

- (29) Unknown orientation
- (99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage

- 4. Child Safety Seat Shield Usage
- 5. Child Safety Seat Tether Usage
Note: Options Below Are Used for Variables 3-5.
- (00) No child safety seat
- Not Designed with Harness/Shield/Tether
- (01) After market harness/shield/tether added, not used
- (02) After market harness/shield/tether used
- (03) Child safety seat used, but no after market harness/shield/tether added
- (09) Unknown if harness/shield/tether added or used
- Designed With Harness/Shield/Tether
- (11) Harness/shield/tether not used
- (12) Harness/shield/tether used
- (19) Unknown if harness/shield/tether used

- Unknown If Designed With Harness/Shield/Tether
- (21) Harness/shield/tether not used
- (22) Harness/shield/tether used
- (29) Unknown if harness/shield/tether used
- (99) Unknown if child safety seat used

6. Child Safety Seat Make/Model
(Specify make/model and occupant number)

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No [] Yes []

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

- (8) Other area (e.g., back of pickup, etc.) (specify): _____

- (9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____

(5) Integral structure

- (8) Other medium (specify): _____

- (9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No [] Yes []

Describe entrapment mechanism: _____

Component(s): _____

(Note on vehicle interior sketch)



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 75
 2. Case Number - Stratum 158A
 3. Vehicle Number 02
 4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 58
 Code actual age at time of accident.
 (00) Less than one year old (specify by month): _____
 (97) 97 years and older _____
 (99) Unknown _____

6. Occupant's Sex 1
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

7. Occupant's Height 188
 Code actual height to the nearest centimeter.
 (999) Unknown
74 inches X 2.54 = 187.9 centimeters

8. Occupant's Weight 122
 Code actual weight to the nearest kilogram.
 (999) Unknown
270 pounds X .4536 = 122.4 kilograms

9. Occupant's Role 1
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 9
 (0) Normal posture

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

- (5) Integral structure
- (8) Other medium (specify):

- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 2

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - mechanically restrained
- (2) Could not exit vehicle due to jammed doors,
fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 1

- (0) Occupant fatal before removed from vehicle
- (1) Removed from vehicle while unconscious or not oriented to time or place
- (2) Removed from vehicle due to perceived serious injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (8) Removed from vehicle for other reasons
(specify): _____
- (9) Unknown

BELT SYSTEM FUNCTION

- | | |
|---|--|
| <p>18. Manual (Active) Belt System Availability <u>4</u></p> <p>(0) None available
 (1) Belt removed/destroyed
 (2) Shoulder belt
 (3) Lap belt
 (4) Lap and shoulder belt
 (5) Belt available—type unknown</p> <p><i>Integral Belt Partially Destroyed</i>
 (6) Shoulder belt (lap belt destroyed/removed)
 (7) Lap belt (shoulder belt destroyed/removed)
 (8) Other belt (specify): _____</p> <p>(9) <u>Unknown</u></p> | <p>22. Manual Shoulder Belt Upper Anchorage Adjustment <u>2</u></p> <p>(0) No manual shoulder belt
 (1) No upper anchorage adjustment for manual shoulder belt</p> <p><i>Adjustable shoulder Belt Upper Anchorage</i>
 (2) In full up position
 (3) In mid position
 (4) In full down position
 (5) Position unknown
 (9) Unknown if position has adjustable upper anchorage adjustment</p> |
| <p>19. Manual (Active) Belt System Use <u>04</u></p> <p>(00) None used, not available, or belt removed/destroyed
 (01) Inoperative (specify): _____</p> <p>(02) <u>Shoulder belt</u>
 (03) Lap belt
 (04) Lap and shoulder belt
 (05) Belt used—type unknown
 (08) Other belt used (specify): _____</p> <p>(12) <u>Shoulder belt used with child safety seat</u>
 (13) Lap belt used with child safety seat
 (14) Lap and shoulder belt used with child safety seat
 (15) Belt used with child safety seat—type unknown
 (18) Other belt used with child safety seat (specify): _____</p> <p>(99) <u>Unknown if belt used</u></p> | <p>23. Automatic (Passive) Belt System Availability/Function <u>0</u></p> <p>(0) Not equipped/not available
 (1) 2 point automatic belts
 (2) 3 point automatic belts
 (3) Automatic belts - type unknown</p> <p><i>Non-functional</i>
 (4) Automatic belts destroyed or rendered inoperative
 (9) Unknown</p> <p>24. Automatic (Passive) Belt System Use <u>0</u></p> <p>(0) Not equipped/not available/destroyed or rendered inoperative
 (1) Automatic belt in use
 (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
 (3) Automatic belt use unknown
 (9) Unknown</p> |
| <p>20. Proper Use of Manual (Active) Belts <u>1</u></p> <p>(0) None used or not available
 (1) Belt used properly
 (2) Belt used properly with child safety seat</p> <p><i>Belt Used Improperly</i>
 (3) Shoulder belt worn under arm
 (4) Shoulder belt worn behind back or seat
 (5) Belt worn around more than one person
 (6) Lap belt worn on abdomen
 (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____</p> <p>(8) <u>Other improper use of manual belt system (specify): _____</u></p> <p>(9) <u>Unknown</u></p> | <p>25. Automatic (Passive) Belt System Type <u>0</u></p> <p>(0) Not equipped/not available
 (1) Non-motorized system
 (2) Motorized system
 (9) Unknown</p> <p>26. Proper Use of Automatic (Passive) Belt System <u>0</u></p> <p>(0) Not equipped/not available/not used
 (1) Automatic belt used properly
 (2) Automatic belt used properly with child safety seat</p> <p><i>Automatic Belt Used Improperly</i>
 (3) Automatic shoulder belt worn under arm
 (4) Automatic shoulder belt worn behind back
 (5) Automatic belt worn around more than one person
 (6) Lap portion of automatic belt worn on abdomen
 (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____</p> <p>(8) <u>Other improper use of automatic belt system (specify): _____</u></p> <p>(9) Unknown</p> |
| <p>21. Manual (Active) Belt Failure Modes During Accident <u>1</u></p> <p>(0) No manual belt used or not available
 (1) No manual belt failure(s)
 (2) Torn webbing (stretched webbing not included)
 (3) Broken buckle or latchplate
 (4) Upper anchorage separated
 (5) Other anchorage separated (specify): _____</p> <p>(6) <u>Broken retractor</u>
 (7) Combination of above (specify): _____</p> <p>(8) <u>Other manual belt failure (specify): _____</u></p> <p>(9) <u>Unknown</u></p> | <p>27. Automatic (Passive) Belt Failure Modes During Accident <u>0</u></p> <p>(0) Not equipped/not available/not in use
 (1) No automatic belt failure(s)
 (2) Torn webbing (stretched webbing not included)
 (3) Broken buckle or latchplate
 (4) Upper anchorage separated
 (5) Other anchorage separated (specify): _____</p> <p>(6) <u>Broken retractor</u>
 (7) Combination of above (specify): _____
 (8) Other automatic belt failure (specify): _____</p> <p>(9) <u>Unknown</u></p> |

POLICE REPORTED RESTRAINT USE

AIR BAG SYSTEM FUNCTION

28. Police Reported Belt Use 0
- (0) None used
 - (1) Police did not indicate belt use
 - (2) Shoulder belt
 - (3) Lap belt
 - (4) Lap and shoulder belt
 - (5) Belt used, type not specified
 - (6) Child safety seat
 - (7) Automatic belt
 - (8) Other type belt, (specify):

(9) Police indicated "unknown"

29. Police Reported Air Bag Availability/Function 1
- (0) No air bag available
 - (1) Police did not indicate air bag availability/function
 - (2) Deployed
 - (3) Not deployed
 - (4) Unknown if deployed
 - (9) Police indicated "unknown"

Check the Primary Source Used In Determining Belt Use.

- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify):

Unknown if belt used

30. Frontal Air Bag System Availability/Function (This Occupant Position) 1
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify):
 - (3) Air bag not reinstalled
 - (9) Unknown

31. Frontal Air Bag System Deployment (This Occupant Position) 1
- (0) Not equipped/not available
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) 0
- (0) Not equipped/not available
 - (1) Air bag
- Non-functional*
- (2) Air bag disconnected (specify):
 - (3) Air bag not reinstalled
 - (9) Unknown
- Specify type of "other" air bag present:*
- _____

33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) 0
- (0) Not equipped with an "other" air bag
 - (1) Deployed during accident (as a result of impact)
 - (2) Deployed inadvertently just prior to accident
 - (3) Deployed, details unknown
 - (4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 - (5) Unknown if deployed
 - (7) Nondeployed
 - (9) Unknown

34. Are There Indications of Air Bag System Failure? (This Occupant Position) 1
- (0) Not equipped/not available
 - (1) No
 - (2) Yes (specify):
 - (9) Unknown

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 1

- (0) Not equipped/not available
 (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
 (3) One previous accident with deployment
 (4) More than one previous accident with at least one deployment
 (8) Previous accidents, unknown deployment status
 (9) Unknown

36. Type of Air Bag 1

- (0) Not equipped/not available
 (1) Original manufacturer installed system
 (2) Retrofitted air bag
 (3) Replacement air bag
 (8) Unknown type of air bag
 (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 1

- (0) Not equipped/not available
 (1) No prior maintenance
 (2) Yes, prior maintenance (specify):

(9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 01

- (00) Not equipped/not available
 _____ Code the accident event sequence number that initiated the air bag deployment
 (96) Deployed, unknown event
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

39. CDC For Air Bag Deployment Impact 1

- (0) Not equipped/not available
 (1) Highest delta V
 (2) Second highest delta V
 (3) Other non-coded delta V (specify):

- _____
- (6) Deployed, unknown event
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + 996

- (_000) Not equipped/not available
Code the value of the delta V for the impact that initiated the air bag deployment
 (_996) Deployment, unknown longitudinal Delta V
 (_997) Not deployed
 (_998) Unknown if deployed
 (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 2

- (0) Not equipped/not available
 (1) No
 (2) Yes
 (3) Deployed, unknown if flap(s) opened at designated tear points
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 1

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____
 (3) Deployed, unknown if air bag module cover flap(s) damaged
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

43. Was There Damage To The Air Bag? 01

- (00) Not equipped/not available
 (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
 (03) Cut
 (04) Torn
 (05) Holed
 (06) Burned
 (07) Abraded
 (88) Other damage (specify): _____
 (95) Damaged, details unknown
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 01
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (08) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):
3
 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 2
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):
2
 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 1
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 1
 (0) Not air bag equipped/air bag not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION

49. Head Restraint Type/Damage by Occupant at This Occupant Position 4
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 01
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 3
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track


Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION *continued*

53. Seat Back Incline Prior and Post Impact 13
 (00) Occupant not seated or no seat
 (01) Not adjustable


Upright prior to impact

- (11) Moved to completely rearward position
- (12) Moved to rearward midrange position
- (13) Moved to slightly rearward position
- (14) Retained pre-impact position
- (15) Moved to slightly forward position
- (16) Moved to forward midrange position
- (17) Moved to completely forward position

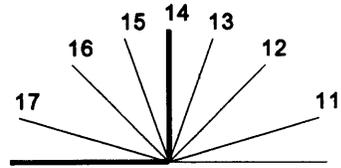


Slightly reclined prior to impact

- (21) Moved to completely rearward position
- (22) Moved to rearward midrange position
- (23) Retained pre-impact position
- (24) Moved to upright position
- (25) Moved to slightly forward position
- (26) Moved to forward midrange position
- (27) Moved to completely forward position

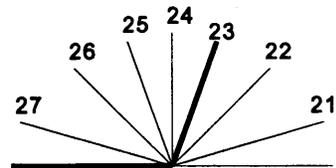

Completely reclined prior to impact

- (31) Retained pre-impact position
- (32) Moved to rearward midrange position
- (33) Moved to slightly rearward position
- (34) Moved to upright position
- (35) Moved to slightly forward position
- (36) Moved to forward midrange position
- (37) Moved to completely forward position

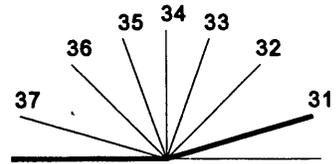

(99) Unknown

54. Seat Performance (this Occupant Position) 6

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed
 (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion, (specify): Floor pan intruded
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

56. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat - with shield
 (5) Booster seat - without shield
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight

(21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 00

59. Child Safety Seat Shield Usage 00

60. Child Safety Seat Tether Usage 00

Note: Options below applicable to
 Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

61. Injury Severity (Police Rating) 4

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 1

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

(9) Unknown

64. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 02

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

EMERGENCY RESPONSE INFORMATION

EMS Notification

- (1) Not notified ROAD VEHICLE
- (2) Notified
- (9) Unknown AIR VEHICLE

EMS Notification Time (first unit)
(9999) Unknown

_____ ROAD VEHICLE _____
_____ AIR VEHICLE _____

EMS Arrival Time (first unit)
(9998) EMS cancelled or did not arrive
(9999) Unknown

_____ ROAD VEHICLE _____
_____ AIR VEHICLE _____

EMS Departure Time To Treatment Facility (transporting unit)

- (9997) EMS arrived, provided treatment, but did not transport _____ ROAD VEHICLE _____
- (9998) EMS arrived, but was not used _____ AIR VEHICLE _____
- (9999) Unknown

EMS Arrival Time At Treatment Facility
(9999) Unknown

_____ ROAD VEHICLE _____
_____ AIR VEHICLE _____

EMS Type

- (01) Fire department FIRST UNIT TRANSPORTING UNIT
- (02) Rescue squad _____
- (03) Police department ROAD VEHICLE
- (04) Trauma unit _____
- (05) Disaster unit AIR VEHICLE
- (06) Ambulance service unit
- (07) Hospital
- (08) Mortuaries/funeral homes
- (98) Other, specify: _____
- (99) Unknown

EMS Care

- (01) No care administered ON-SCENE DURING TRANSPORT
- (02) First aid _____
- (03) Resuscitation ROAD VEHICLE
- (04) CPR _____
- (05) Emergency cardiac care AIR VEHICLE
- (06) Life support system monitoring (blood pressure, pulse rate, respiration, EKG)
- (07) Emergency burn care
- (08) Combination of above, specify: _____
- (98) Other, specify: _____
- (99) Unknown

STOP WORK HERE VARIABLES 66-74 TO BE CODED BY THE ZONE CENTER

TO BE CODED BY THE ZONE CENTER

INJURY CONSEQUENCES

TRAUMA DATA

66. Time to Death 01
 Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
 (00) Not fatal
 (96) Fatal - ruled disease
 (99) Unknown

67. 1st Medically Reported Cause of Death 99

68. 2nd Medically Reported Cause of Death 00

69. 3rd Medically Reported Cause of Death 00
 Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
 (00) Not fatal or no additional causes
 (96) Mode of death given but specific injuries are not linked to cause of death. (specify):
 (97) Other result (includes fatal ruled disease) (specify):
 (99) Unknown

70. Number of Recorded Injuries for This Occupant 02
 Code the actual number of injuries recorded for this occupant.
 (00) No recorded injuries
 (97) Injured, details unknown
 (99) Unknown if injured

71. Glasgow Coma Scale (GCS) Score 01
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

72. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

73. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>75</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>158A</u>	4. Occupant Number <u>01</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	A.I.S. - 90							Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
	Source of Injury Data	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				
1st	5. <u>7</u>	6. <u>4</u>	7. <u>4</u>	8. <u>14</u>	9. <u>99</u>	10. <u>3</u>	11. <u>3</u>	12. <u>051</u>	13. <u>2</u>	14. <u>1</u>	15. <u>97</u>
2nd	16. <u>7</u>	17. <u>8</u>	18. <u>5</u>	19. <u>26</u>	20. <u>00</u>	21. <u>2</u>	22. <u>9</u>	23. <u>052</u>	24. <u>2</u>	25. <u>1</u>	26. <u>97</u>
3rd	27. ___	28. ___	29. ___	30. ___	31. ___	32. ___	33. ___	34. ___	35. ___	36. ___	37. ___
4th	38. ___	39. ___	40. ___	41. ___	42. ___	43. ___	44. ___	45. ___	46. ___	47. ___	48. ___
5th	49. ___	50. ___	51. ___	52. ___	53. ___	54. ___	55. ___	56. ___	57. ___	58. ___	59. ___
6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head		Specific injuries are assigned consecutive two-digit numbers beginning with 02. To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(1) Right
(2) Face			(2) Left
(3) Neck			(3) Bilateral
(4) Thorax			(4) Central
(5) Abdomen			(5) Anterior
(6) Spine			(6) Posterior
(7) Upper Extremity			(7) Superior
(8) Lower Extremity			(8) Inferior
(9) Unspecified			(9) Unknown
			(0) Whole region
Type of Anatomic Structure	<u>Whole Area</u>		
(1) Whole Area	(02) Skin - Abrasion		
(2) Vessels	(04) Skin - Contusion		
(3) Nerves	(06) Skin - Laceration		
(4) Organs (includes Muscles/ligaments)	(08) Skin - Avulsion		
(5) Skeletal (includes joints)	(10) Amputation		
(6) Head - LOC	(20) Burn		
(9) Skin	(30) Crush		
	(40) Degloving		
	(50) Injury - NFS		
	(90) Trauma, other than mechanical		
	<u>Head - LOC</u>		
	(02) Length of LOC		
	(04) Level		
	(06) of		
	(08) Consciousness		
	(10) Concussion		
	<u>Spine</u>		
	(02) Cervical		
	(04) Thoracic		
	(06) Lumbar		
		Abbreviated Injury Scale	
		(1) Minor Injury	
		(2) Moderate Injury	
		(3) Serious Injury	
		(4) Severe Injury	
		(5) Critical Injury	
		(6) Maximum (untreatable)	
		(7) Injured, unknown severity	

SOURCE OF INJURY DATA

INJURY SOURCE

DIRECT/INDIRECT INJURY

OFFICIAL RECORDS

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL RECORDS

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify):
- (9) Police

CONFIDENCE LEVEL

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify) _____
- (195) Other air bag compartment cover (specify) _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR OF OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

Restrained?

No

Yes

Blood Alcohol Level
(mg/dl)

BAL = ____

Glasgow Coma
Scale Score

GCSS = ____

Units of Blood
Given

Units = ____



Arterial Blood Gases

pH = ____

PO₂ = ____


PCO₂ ____

HCO₃ ____

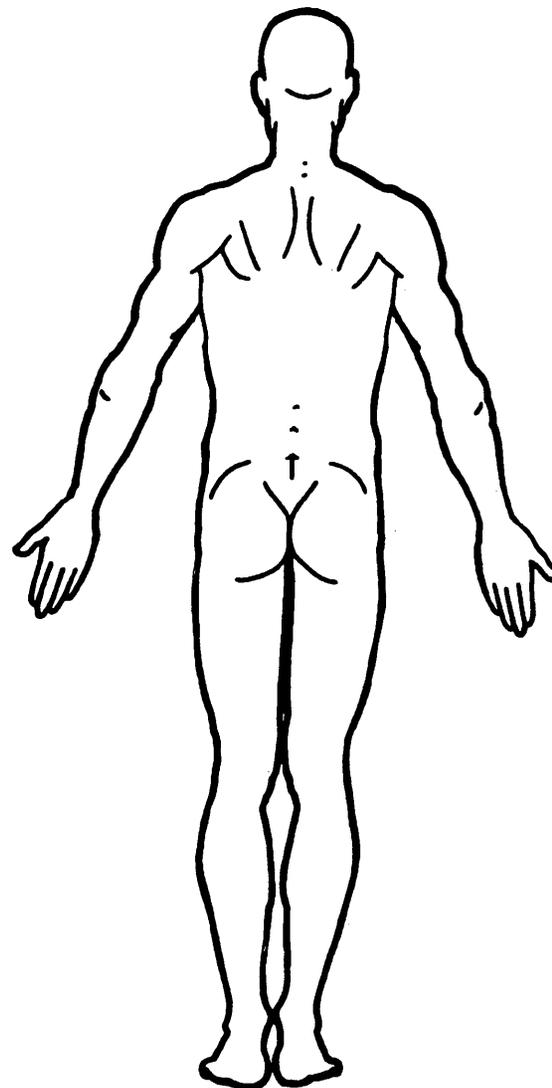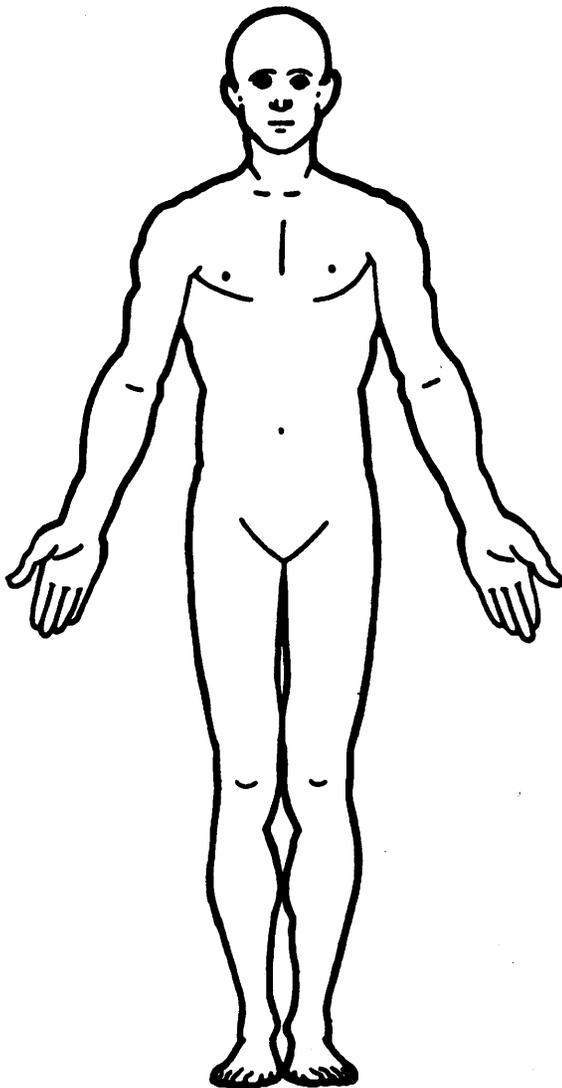



OFFICIAL INJURY DATA — SKELETAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

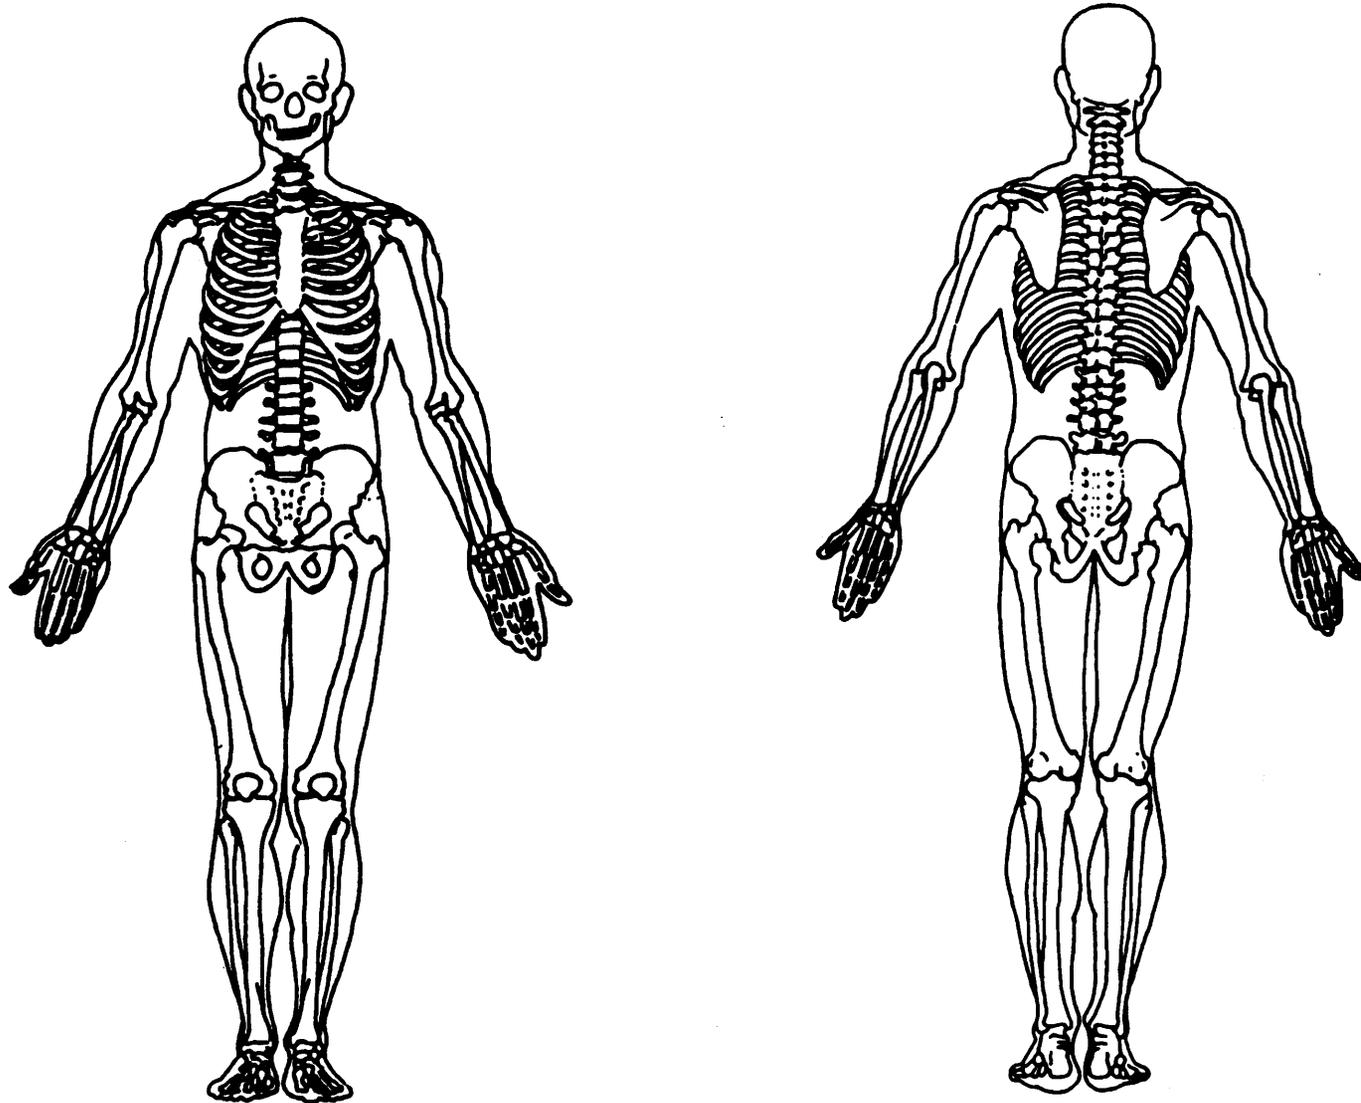

OFFICIAL INJURY DATA – INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

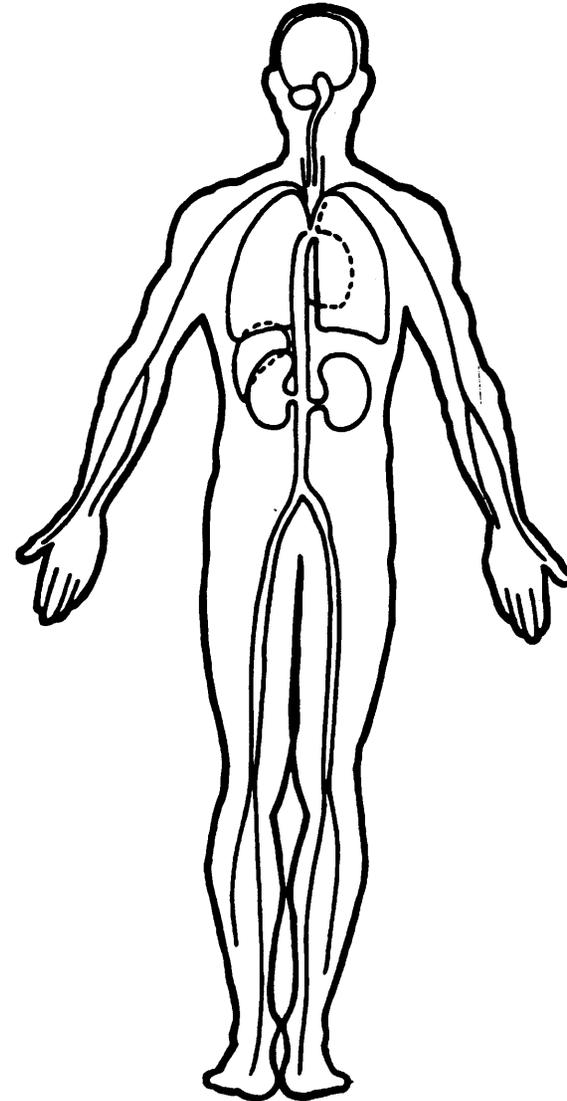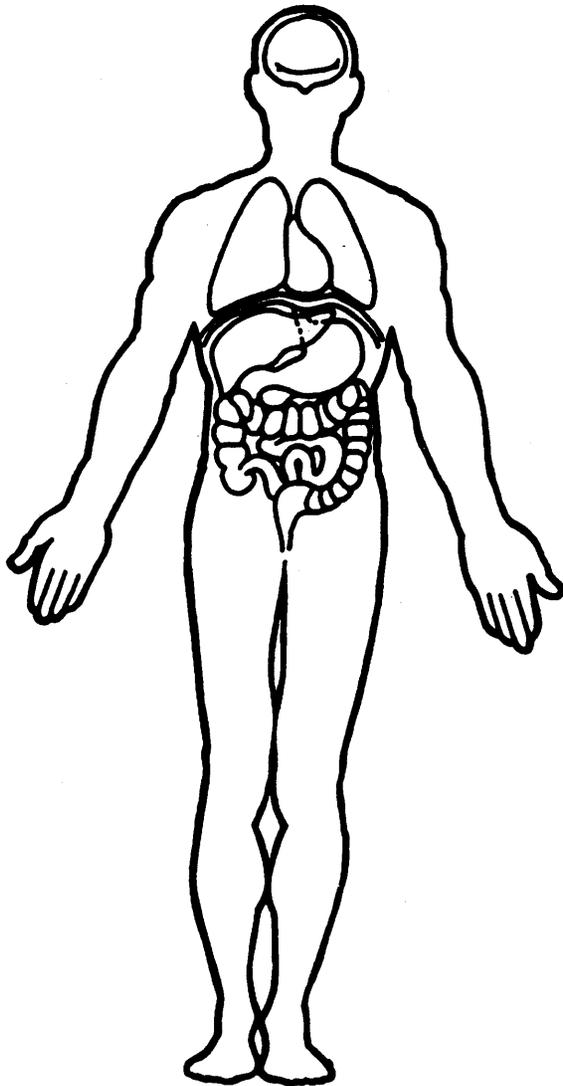



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 75
 2. Case Number - Stratum 158A
 3. Vehicle Number 02
 4. Occupant Number 02

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 52
 Code actual age at time of accident.
 (00) Less than one year old (specify by month): _____
 (97) 97 years and older _____
 (99) Unknown _____

6. Occupant's Sex 1
 (1) Male
 (2) Female-not reported pregnant
 (3) Female-pregnant-1st trimester(1st-3rd month)
 (4) Female-pregnant-2nd trimester(4th-6th month)
 (5) Female-pregnant-3rd trimester(7th-9th month)
 (6) Female-pregnant-term unknown
 (9) Unknown

7. Occupant's Height 183
 Code actual height to the nearest
 centimeter.
 (999) Unknown
72 inches X 2.54 = 182.8 centimeters

8. Occupant's Weight 091
 Code actual weight to the nearest
 kilogram.
 (999) Unknown
200 pounds X .4536 = 90.7 kilograms

9. Occupant's Role 2
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 13
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 0
 (0) Normal posture

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with
 another occupant or to look out a rear
 window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in
 front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection 0

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

13. Ejection Area 0

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.)
(specify): _____
- (9) Unknown

14. Ejection Medium 0

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

- (5) Integral structure
- (8) Other medium (specify):

- (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

16. Entrapment 2

- (0) Not entrapped/exit not inhibited
- (1) Entrapped/pinned - ~~mechanically restrained~~
- (2) Could not exit vehicle due to jammed doors,
fire, etc.
(specify): _____
- (9) Unknown

17. Occupant Mobility 2

- (0) Occupant fatal before removed from
vehicle
- (1) Removed from vehicle while unconscious or
not oriented to time or place
- (2) Removed from vehicle due to perceived
serious injuries
- (3) Exited vehicle with some assistance
- (4) Exited vehicle under own power
- (5) Occupant fully ejected
- (8) Removed from vehicle for other reasons
(specify): _____
- (9) Unknown

BELT SYSTEM FUNCTION

18. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify):

(9) Unknown

19. Manual (Active) Belt System Use 04

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify):

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify):

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify):
- (99) Unknown if belt used

20. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify):

(8) Other improper use of manual belt system (specify):

(9) Unknown

21. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):

(6) Broken retractor

(7) Combination of above (specify):

(8) Other manual belt failure (specify):

(9) Unknown

22. Manual Shoulder Belt Upper Anchorage Adjustment 4

- (0) No manual shoulder belt
- (1) No upper anchorage adjustment for manual shoulder belt

Adjustable shoulder Belt Upper Anchorage

- (2) In full up position
- (3) In mid position
- (4) In full down position
- (5) Position unknown
- (9) Unknown if position has adjustable upper anchorage adjustment

23. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

24. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):
- (3) Automatic belt use unknown
- (9) Unknown

25. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

26. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or

automatic shoulder belt used improperly with child safety seat (specify):

(8) Other improper use of automatic belt system (specify):

(9) Unknown

27. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):

(6) Broken retractor

(7) Combination of above (specify):

(8) Other automatic belt failure (specify):

(9) Unknown

POLICE REPORTED RESTRAINT USE	AIR BAG SYSTEM FUNCTION
<p>28. Police Reported Belt Use ○</p> <p>(0) None used</p> <p>(1) Police did not indicate belt use</p> <p>(2) Shoulder belt</p> <p>(3) Lap belt</p> <p>(4) Lap and shoulder belt</p> <p>(5) Belt used, type not specified</p> <p>(6) Child safety seat</p> <p>(7) Automatic belt</p> <p>(8) Other type belt, (specify):</p> <p>_____</p> <p>(9) Police indicated "unknown"</p>	<p>30. Frontal Air Bag System Availability/Function (This Occupant Position) ○</p> <p>(0) Not equipped/not available</p> <p>(1) Air bag</p> <p><i>Non-functional</i></p> <p>(2) Air bag disconnected (specify):</p> <p>_____</p> <p>(3) Air bag not reinstalled</p> <p>(9) Unknown</p>
<p>29. Police Reported Air Bag Availability/Function </p> <p>(0) No air bag available</p> <p>(1) Police did not indicate air bag availability/function</p> <p>(2) Deployed</p> <p>(3) Not deployed</p> <p>(4) Unknown if deployed</p> <p>(9) Police indicated "unknown"</p>	<p>31. Frontal Air Bag System Deployment (This Occupant Position) ○</p> <p>(0) Not equipped/not available</p> <p>(1) Deployed during accident (as a result of impact)</p> <p>(2) Deployed inadvertently just prior to accident</p> <p>(3) Deployed, details unknown</p> <p>(4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)</p> <p>(5) Unknown if deployed</p> <p>(7) Nondeployed</p> <p>(9) Unknown</p>
<p>Check the Primary Source Used In Determining Belt Use.</p> <p><input checked="" type="checkbox"/> Vehicle inspection</p> <p><input type="checkbox"/> Official injury data</p> <p><input type="checkbox"/> Driver/occupant interview</p> <p><input type="checkbox"/> Other (specify):</p> <p>_____</p> <p><input type="checkbox"/> Unknown if belt used</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>	<p>32. Other Than First Seat Frontal Air Bag Availability/Function (This Occupant Position) ○</p> <p>(0) Not equipped/not available</p> <p>(1) Air bag</p> <p><i>Non-functional</i></p> <p>(2) Air bag disconnected (specify):</p> <p>_____</p> <p>(3) Air bag not reinstalled</p> <p>(9) Unknown</p> <p><i>Specify type of "other" air bag present:</i></p> <p>_____</p>
	<p>33. Air Bag(s) Deployment, Other Than First Seat Frontal (This Occupant Position) ○</p> <p>(0) Not equipped with an "other" air bag</p> <p>(1) Deployed during accident (as a result of impact)</p> <p>(2) Deployed inadvertently just prior to accident</p> <p>(3) Deployed, details unknown</p> <p>(4) Deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)</p> <p>(5) Unknown if deployed</p> <p>(7) Nondeployed</p> <p>(9) Unknown</p>
	<p>34. Are There Indications of Air Bag System Failure? (This Occupant Position) ○</p> <p>(0) Not equipped/not available</p> <p>(1) No</p> <p>(2) Yes (specify):</p> <p>_____</p> <p>(9) Unknown</p>

FIRST SEAT FRONTAL AIR BAG SYSTEM EVALUATION

35. Had Vehicle Been in Previous Accident(s)? 0

- (0) Not equipped/not available
 (1) No previous accidents

Yes

- (2) Previous accident(s) without deployment(s)
 (3) One previous accident with deployment
 (4) More than one previous accident with at least one deployment
 (8) Previous accidents, unknown deployment status
 (9) Unknown

36. Type of Air Bag 0

- (0) Not equipped/not available
 (1) Original manufacturer installed system
 (2) Retrofitted air bag
 (3) Replacement air bag
 (8) Unknown type of air bag
 (9) Unknown

37. Had Any Prior Maintenance/Service Been Performed On This Air Bag System? 0

- (0) Not equipped/not available
 (1) No prior maintenance
 (2) Yes, prior maintenance (specify): _____
 (9) Unknown

38. Air Bag Deployment Accident Event Sequence Number 00

- (00) Not equipped/not available
 _____ Code the accident event sequence number that initiated the air bag deployment
 (96) Deployed, unknown event
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

39. CDC For Air Bag Deployment Impact 0

- (0) Not equipped/not available
 (1) Highest delta V
 (2) Second highest delta V
 (3) Other non-coded delta V (specify): _____
 (6) Deployed, unknown event
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

40. Longitudinal Component of Delta V For Air Bag Deployment Impact + - 000

- (_000) Not equipped/not available
Code the value of the delta V for the impact that initiated the air bag deployment
 (_996) Deployment, unknown longitudinal Delta V
 (_997) Not deployed
 (_998) Unknown if deployed
 (_999) Unknown

41. Did Air Bag Module Cover Flap(s) Open At Designated Tear Points? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes
 (3) Deployed, unknown if flap(s) opened at designated tear points
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

42. Were Air Bag Module Cover Flap(s) Damaged? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____
 (3) Deployed, unknown if air bag module cover flap(s) damaged
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

43. Was There Damage To The Air Bag? 00

- (00) Not equipped/not available
 (01) Not damaged

Yes - Air Bag Damage

- (02) Ruptured
 (03) Cut
 (04) Torn
 (05) Holed
 (06) Burned
 (07) Abraded
 (88) Other damage (specify): _____

- (95) Damaged, details unknown
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown

**FIRST SEAT FRONTAL AIR BAG SYSTEM
EVALUATION** *continued*

44. Source of Air Bag Damage 00
 (00) Not equipped/not available
 (01) Not damaged
 (02) Object worn by occupant, (specify):

 (03) Object carried by occupant, (specify):

 (04) Adaptive/assistive controls, (specify):

 (05) Fire in vehicle
 (06) Thermal burns
 (07) Rescue or emergency efforts
 (88) Other damage source (specify):

 (95) Damaged, unknown source
 (96) Deployed, unknown if damaged
 (97) Not deployed
 (98) Unknown if deployed
 (99) Unknown
45. Was The Air Bag Tethered? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of tether straps):

 (3) Deployed, unknown if tethered
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
46. Did The Air Bag Have Vent Ports? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify number of vent ports):

 (3) Deployed, unknown if vent ports present
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
47. Was the Air Bag in this Occupant's Position Contacted by Another Occupant? 0
 (0) Not equipped/not available
 (1) No
 (2) Yes (specify):

 (3) Deployed, unknown if other occupant contact to air bag
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown
48. Was This Occupant Wearing Eye-wear? 0
 (0) Not air bag equipped/air bag not available
 (1) No
 (2) Eyeglasses/sunglasses
 (3) Contact lenses
 (4) Deployed, unknown if eyewear worn
 (7) Not deployed
 (8) Unknown if deployed
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION

49. Head Restraint Type/Damage by Occupant at This Occupant Position 3
 (0) No head restraints
 (1) Integral—no damage
 (2) Integral—damaged during accident
 (3) Adjustable—no damage
 (4) Adjustable—damaged during accident
 (5) Add-on—no damage
 (6) Add-on—damaged during accident
 (8) Other (specify):

 (9) Unknown
50. Seat Type (this Occupant Position) 01
 (00) Occupant not seated or no seat
 (01) Bucket
 (02) Bucket with folding back
 (03) Bench
 (04) Bench with separate back cushions
 (05) Bench with folding back(s)
 (06) Split bench with separate back cushions
 (07) Split bench with folding back(s)
 (08) Pedestal (i.e., column supported)
 (09) Box mounted seat (i.e., van type)
 (10) Other seat type (specify):

 (99) Unknown
51. Seat Orientation (this Occupant Position) 1
 (0) Occupant not seated or no seat
 (1) Forward facing seat
 (2) Rear facing seat
 (3) Side facing seat (inward)
 (4) Side facing seat (outward)
 (8) Other (specify):

 (9) Unknown
52. Seat Track Adjusted Position Prior To Impact 3
 (0) Occupant not seated or no seat
 (1) Non-adjustable seat track


Adjustable Seat Track
 (2) Seat at forward most track position
 (3) Seat between forward most and middle track positions
 (4) Seat at middle track position
 (5) Seat between middle and rear most track positions
 (6) Seat at rear most track position
 (9) Unknown

HEAD RESTRAINT AND SEAT EVALUATION *continued*53. Seat Back Incline Prior and Post Impact 14


- (00) Occupant not seated or no seat
 (01) Not adjustable

Upright prior to impact


- (11) Moved to completely rearward position
 (12) Moved to rearward midrange position
 (13) Moved to slightly rearward position
 (14) Retained pre-impact position
 (15) Moved to slightly forward position
 (16) Moved to forward midrange position
 (17) Moved to completely forward position

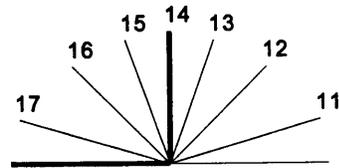***Slightly reclined prior to impact***

- (21) Moved to completely rearward position
 (22) Moved to rearward midrange position
 (23) Retained pre-impact position
 (24) Moved to upright position
 (25) Moved to slightly forward position
 (26) Moved to forward midrange position
 (27) Moved to completely forward position

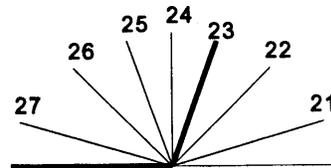***Completely reclined prior to impact***

- (31) Retained pre-impact position
 (32) Moved to rearward midrange position
 (33) Moved to slightly rearward position
 (34) Moved to upright position
 (35) Moved to slightly forward position
 (36) Moved to forward midrange position
 (37) Moved to completely forward position

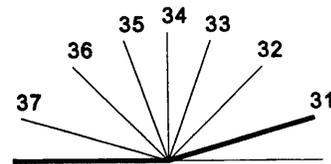

(99) Unknown

54. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
 (1) No seat performance failure(s)
 (2) Seat adjusters failed
 (3) Seat back folding locks or "seat back" failed
 (specify): _____
 (4) Seat track/anchors failed
 (5) Deformed by impact of occupant
 (6) Deformed by passenger compartment intrusion, (specify): _____
 (7) _____
 Combination of above (specify): _____
 (8) Other (specify): _____
 (9) Unknown

CHILD SAFETY SEAT

55. Child Safety Seat Make/Model 000
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

56. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat - with shield
 (5) Booster seat - without shield
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

57. Child Safety Seat Orientation 00
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight

(21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

(99) Unknown if child safety seat used

58. Child Safety Seat Harness Usage 00

59. Child Safety Seat Shield Usage 00

60. Child Safety Seat Tether Usage 00

Note: Options below applicable to
 Variables OA58-OA60.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

61. Injury Severity (Police Rating) 3

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

62. Treatment - Mortality 3

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (7) Treatment - other (specify):

- (8) Transported to a medical facility-unknown if treated
- (9) Unknown

63. Type Of Medical Facility (for Initial Treatment) 1

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

64. Hospital Stay 05

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

65. Working Days Lost 28

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

EMERGENCY RESPONSE INFORMATION

EMS Notification

- (1) Not notified ROAD VEHICLE
- (2) Notified
- (9) Unknown AIR VEHICLE

EMS Notification Time (first unit)

- (9999) Unknown ROAD VEHICLE
- AIR VEHICLE

EMS Arrival Time (first unit)

- (9998) EMS cancelled or did not arrive ROAD VEHICLE
- (9999) Unknown AIR VEHICLE

EMS Departure Time To

- Treatment Facility (transporting unit)
- (9997) EMS arrived, provided treatment, but did not transport ROAD VEHICLE
- AIR VEHICLE
- (9998) EMS arrived, but was not used
- (9999) Unknown

EMS Arrival Time At

- Treatment Facility ROAD VEHICLE
- (9999) Unknown AIR VEHICLE

EMS Type

- (01) Fire department FIRST UNIT TRANSPORTING UNIT
- (02) Rescue squad
- (03) Police department ROAD VEHICLE
- (04) Trauma unit
- (05) Disaster unit AIR VEHICLE
- (06) Ambulance service unit
- (07) Hospital
- (08) Mortuaries/funeral homes
- (98) Other, specify: _____
- (99) Unknown

EMS Care

- (01) No care administered ON-SCENE DURING TRANSPORT
- (02) First aid
- (03) Resuscitation ROAD VEHICLE
- (04) CPR AIR VEHICLE
- (05) Emergency cardiac care
- (06) Life support system monitoring (blood pressure, pulse rate, respiration, EKG)
- (07) Emergency burn care
- (08) Combination of above, specify: _____
- (98) Other, specify: _____
- (99) Unknown

STOP WORK HERE VARIABLES 66-74 TO BE CODED BY THE ZONE CENTER

TO BE CODED BY THE ZONE CENTER**INJURY CONSEQUENCES****TRAUMA DATA**

66. Time to Death 00
Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
(00) Not fatal
(96) Fatal - ruled disease
(99) Unknown
67. 1st Medically Reported Cause of Death 00
68. 2nd Medically Reported Cause of Death 00
69. 3rd Medically Reported Cause of Death 00
Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
(00) Not fatal or no additional causes
(96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown
70. Number of Recorded Injuries for This Occupant 12
12 Code the actual number of injuries recorded for this occupant.
(00) No recorded injuries
(97) Injured, details unknown
(99) Unknown if injured
71. Glasgow Coma Scale (GCS) Score 02
(at Medical Facility)
(00) Not injured
(01) Injured - not treated at medical facility
(02) No GCS Score at medical facility
(03-15) Code the actual value of the initial GCS Score recorded at medical facility.
(97) Injured, details unknown
(99) Unknown if injured
72. Was the Occupant Given Blood? 1
(1) No - blood not given
(2) Yes - blood given
(specify units): _____
(9) Unknown if blood given
73. Arterial Blood Gases (ABG) - HCO₃ 01
(00) Not injured
(01) Injured, ABGs not measured or reported
(02-50) Code the actual value of the HCO₃
(96) ABGs reported, HCO₃ unknown
(97) Injured, details unknown
(99) Unknown if injured

BELT USE DETERMINATION

74. Primary Source of Belt Use Determination 1
(0) Not equipped/not available/destroyed or rendered inoperative
(1) Vehicle inspection
(2) Official injury data
(3) Driver/occupant interview
(8) Other (specify): _____
(9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>75</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>158A</u>	4. Occupant Number <u>02</u>

INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	A.I.S. - 90										
	Source of Injury Data	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect	Injury Source	Injury Source Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
1st	5. <u>2</u>	6. <u>1</u>	7. <u>6</u>	8. <u>04</u>	9. <u>06</u>	10. <u>2</u>	11. <u>0</u>	12. <u>204</u>	13. <u>2</u>	14. <u>1</u>	15. <u>97</u>
2nd	16. <u>2</u>	17. <u>4</u>	18. <u>4</u>	19. <u>10</u>	20. <u>02</u>	21. <u>3</u>	22. <u>4</u>	23. <u>101</u>	24. <u>3</u>	25. <u>1</u>	26. <u>00</u>
3rd	27. <u>3</u>	28. <u>2</u>	29. <u>9</u>	30. <u>02</u>	31. <u>02</u>	32. <u>1</u>	33. <u>7</u>	34. <u>204</u>	35. <u>2</u>	36. <u>1</u>	37. <u>97</u>
4th	38. <u>3</u>	39. <u>2</u>	40. <u>9</u>	41. <u>06</u>	42. <u>00</u>	43. <u>1</u>	44. <u>0</u>	45. <u>204</u>	46. <u>2</u>	47. <u>1</u>	48. <u>97</u>
5th	49. <u>2</u>	50. <u>2</u>	51. <u>9</u>	52. <u>04</u>	53. <u>02</u>	54. <u>1</u>	55. <u>0</u>	56. <u>204</u>	57. <u>2</u>	58. <u>1</u>	59. <u>97</u>
6th	60. <u>2</u>	61. <u>6</u>	62. <u>9</u>	63. <u>04</u>	64. <u>02</u>	65. <u>1</u>	66. <u>0</u>	67. <u>151</u>	68. <u>2</u>	69. <u>1</u>	70. <u>00</u>
7th	71. <u>3</u>	72. <u>7</u>	73. <u>9</u>	74. <u>02</u>	75. <u>02</u>	76. <u>1</u>	77. <u>2</u>	78. <u>151</u>	79. <u>3</u>	80. <u>1</u>	81. <u>00</u>
8th	82. <u>2</u>	83. <u>7</u>	84. <u>9</u>	85. <u>04</u>	86. <u>02</u>	87. <u>1</u>	88. <u>2</u>	89. <u>151</u>	90. <u>3</u>	91. <u>1</u>	92. <u>00</u>
9th	93. <u>3</u>	94. <u>8</u>	95. <u>9</u>	96. <u>02</u>	97. <u>02</u>	98. <u>1</u>	99. <u>1</u>	100. <u>013</u>	101. <u>2</u>	102. <u>1</u>	103. <u>00</u>
10th	104. <u>2</u>	105. <u>8</u>	106. <u>9</u>	107. <u>04</u>	108. <u>02</u>	109. <u>1</u>	110. <u>1</u>	111. <u>013</u>	112. <u>2</u>	113. <u>1</u>	114. <u>00</u>

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Level of Injury	Aspect
(1) Head		Specific injuries are assigned consecutive two-digit numbers beginning with 02.	(1) Right
(2) Face			(2) Left
(3) Neck		To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(3) Bilateral
(4) Thorax			(4) Central
(5) Abdomen		The exceptions to this rule apply to:	(5) Anterior
(6) Spine			(6) Posterior
(7) Upper Extremity		<u>Vessels, Nerves, Organs, Bones, Joints</u> are assigned consecutive two digit numbers beginning with 02.	(7) Superior
(8) Lower Extremity			(8) Inferior
(9) Unspecified		The exceptions to this rule apply to:	(9) Unknown
			(0) Whole region
Type of Anatomic Structure	<u>Whole Area</u>		
(1) Whole Area	(02) Skin - Abrasion	Abbreviated Injury Scale	(1) Minor Injury
(2) Vessels	(04) Skin - Contusion		(2) Moderate Injury
(3) Nerves	(06) Skin - Laceration	(3) Serious Injury	(3) Serious Injury
(4) Organs (includes Muscles/ligaments)	(08) Skin - Avulsion	(4) Severe Injury	(4) Severe Injury
(5) Skeletal (includes joints)	(10) Amputation	(5) Critical Injury	(5) Critical Injury
(6) Head - LOC	(20) Burn	(6) Maximum (untreatable)	(6) Maximum (untreatable)
(9) Skin	(30) Crush	(7) Injured, unknown severity	(7) Injured, unknown severity
	(40) Degloving		
	(50) Injury - NFS		
	(90) Trauma, other than mechanical		
	<u>Head - LOC</u>		
	(02) Length of LOC		
	(04) Level		
	(06) of		
	(08) Consciousness		
	(10) Concussion		
	<u>Spine</u>		
	(02) Cervical		
	(04) Thoracic		
	(06) Lumbar		

SOURCE OF INJURY DATA**INJURY SOURCE****DIRECT/INDIRECT INJURY**OFFICIAL RECORDS

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL RECORDS

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): _____
- (9) Police

CONFIDENCE LEVEL

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

INJURY SOURCES

FRONT

- (001) Windshield
- (002) Mirror
- (003) Sunvisor
- (004) Steering wheel rim
- (005) Steering wheel hub/spoke
- (006) Steering wheel (combination of codes 004 and 005)
- (007) Steering column, transmission selector lever, other attachment
- (008) Cellular telephone or CB radio
- (009) Add on equipment (e.g., tape deck, air conditioner)
- (010) Left instrument panel and below
- (011) Center instrument panel and below
- (012) Right instrument panel and below
- (013) Glove compartment door
- (014) Knee bolster
- (015) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (016) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (017) Windshield reinforced by exterior object (specify): _____
- (019) Other front object (specify): _____

LEFT SIDE

- (051) Left side interior surface, excluding hardware or armrests
- (052) Left side hardware or armrest
- (053) Left A (A1/A2)-pillar
- (054) Left B-pillar
- (055) Other left pillar (specify): _____
- (056) Left side window glass
- (057) Left side window frame
- (058) Left side window sill
- (059) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (060) Other left side object (specify): _____

RIGHT SIDE

- (101) Right side interior surface, excluding hardware or armrests

- (102) Right side hardware or armrest
- (103) Right A (A1/A2)-pillar
- (104) Right B-pillar
- (105) Other right pillar (specify): _____
- (106) Right side window glass
- (107) Right side window frame
- (108) Right side window sill
- (109) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (110) Other right side object (specify): _____

INTERIOR

- (151) Seat, back support
- (152) Belt restraint webbing/buckle
- (153) Belt restraint B-pillar or door frame attachment point
- (154) Other restraint system component (specify): _____
- (155) Head restraint system
- (160) Other occupants (specify): _____
- (161) Interior loose objects
- (162) Child safety seat (specify): _____
- (163) Other interior object (specify): _____

AIR BAG

- (170) Air bag-driver side
- (171) Air bag-driver side and eyewear
- (172) Air bag-driver side and jewelry
- (173) Air bag-driver side and object held
- (174) Air bag-driver side and object in mouth
- (175) Air bag compartment cover-driver side
- (176) Air bag compartment cover-driver side and eyewear
- (177) Air bag compartment cover-driver side and jewelry
- (178) Air bag compartment cover-driver side and object held
- (179) Air bag compartment cover-driver side and object in mouth
- (180) Air bag-passenger side
- (181) Air bag-passenger side and eyewear
- (182) Air bag-passenger side and jewelry

- (183) Air bag-passenger side and object held
- (184) Air bag-passenger side and object in mouth
- (185) Air bag compartment cover-passenger side
- (186) Air bag compartment cover-passenger side and eyewear
- (187) Air bag compartment cover-passenger side and jewelry
- (188) Air bag compartment cover-passenger side and object held
- (189) Air bag compartment cover-passenger side and object in mouth
- (190) Other air bag (specify): _____
- (195) Other air bag compartment cover (specify): _____

ROOF

- (201) Front header
- (202) Rear header
- (203) Roof left side rail
- (204) Roof right side rail
- (205) Roof or convertible top

FLOOR

- (251) Floor (including toe pan)
- (252) Floor or console mounted transmission lever, including console
- (253) Parking brake handle
- (254) Foot controls including parking brake

REAR

- (301) Backlight (rear window)
- (302) Backlight storage rack, door, etc.
- (303) Other rear object (specify): _____

ADAPTIVE (ASSISTIVE) DRIVING EQUIPMENT

- (401) Hand controls for braking/acceleration
- (402) Steering control devices (attached to OEM steering wheel)
- (403) Steering knob attached to steering wheel
- (405) Replacement steering wheel (i.e., reduced diameter)
- (406) Joy stick steering controls
- (407) Wheelchair tie-downs
- (408) Modification to seat belts, (specify): _____
- (409) Additional or relocated switches, (specify): _____
- (410) Raised roof

- (411) Wall mounted head rest (used behind wheel chair)
- (412) Other adaptive device (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (451) Hood
- (452) Outside hardware (e.g., outside mirror, antenna)
- (453) Other exterior surface or tires (specify): _____
- (454) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (501) Front bumper
- (502) Hood edge
- (503) Other front of vehicle (specify): _____
- (504) Hood
- (505) Hood ornament
- (506) Windshield, roof rail, A-pillar
- (507) Side surface
- (508) Side mirrors
- (509) Other side protrusions (specify): _____
- (510) Rear surface
- (511) Undercarriage
- (512) Tires and wheels
- (513) Other exterior of other motor vehicle (specify): _____
- (514) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (551) Ground
- (598) Other vehicle or object (specify): _____
- (599) Unknown vehicle or object

NONCONTACT INJURY

- (601) Fire in vehicle
- (602) Flying glass
- (603) Other noncontact injury source (specify): _____
- (604) Air bag exhaust gases
- (697) Injured, unknown source

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

Restrained?

No

Yes

Blood Alcohol Level (mg/dl)

BAL = 0

Glasgow Coma Scale Score

GCSS =

Units of Blood Given

Units =


Arterial Blood Gases

pH =

PO₂ =



PCO₂ =

HCO₃ =

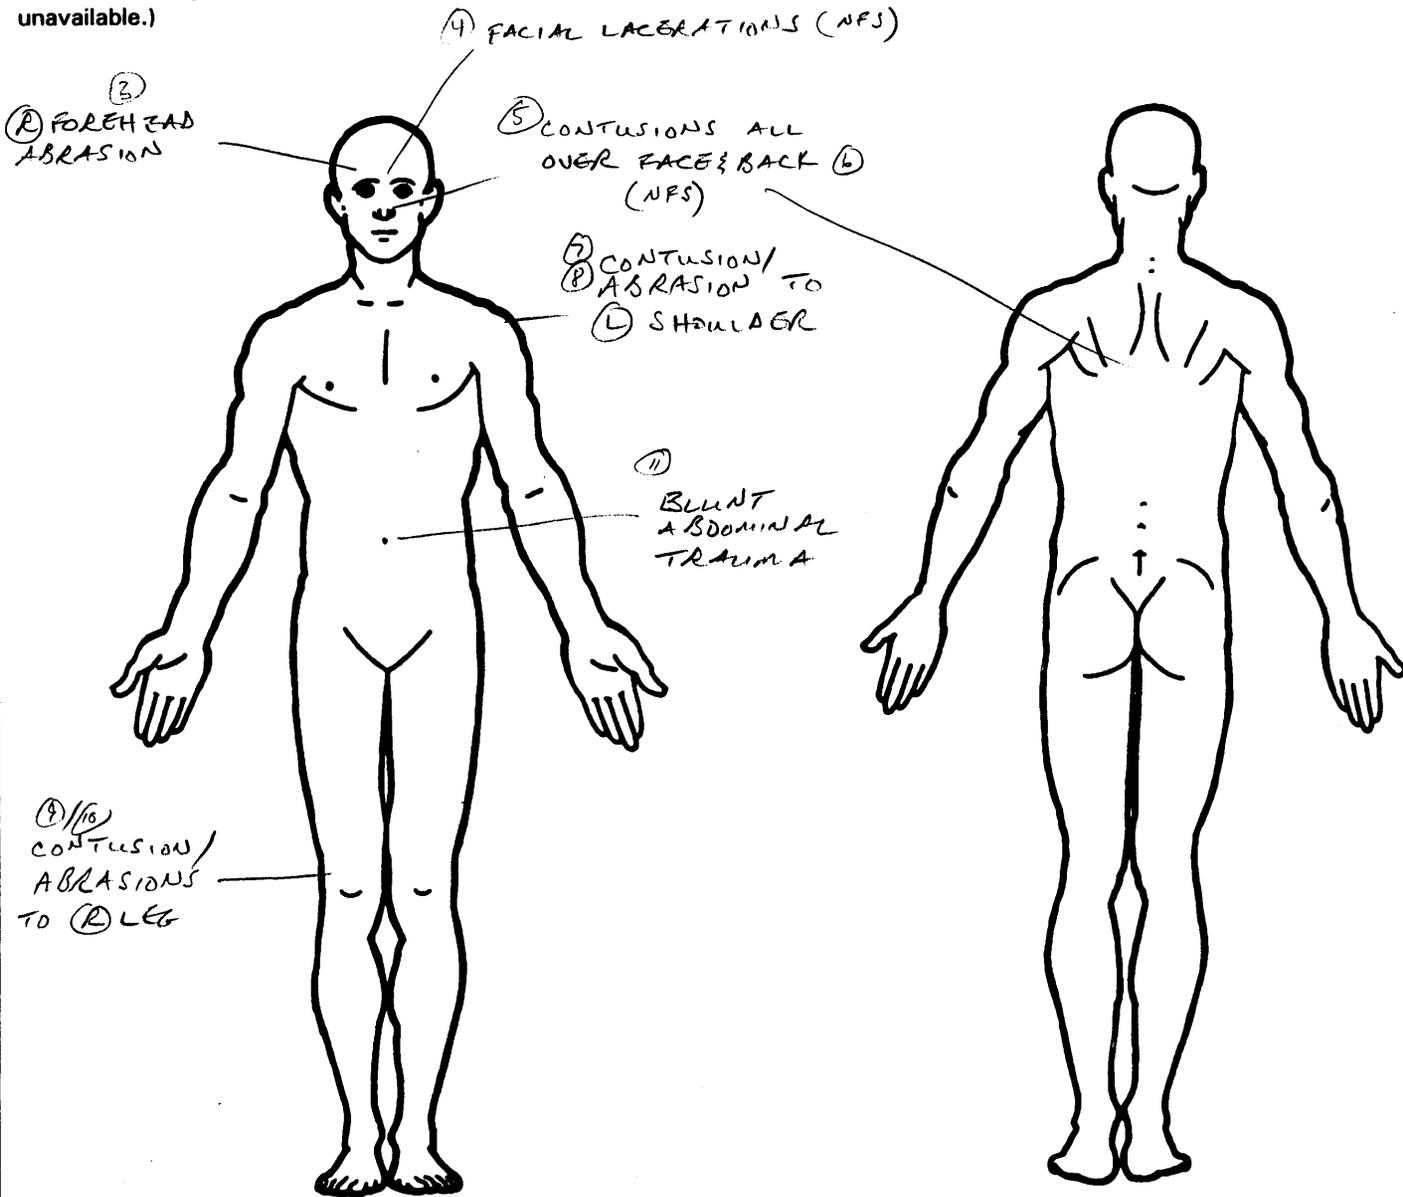


OFFICIAL INJURY DATA — SKELETAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

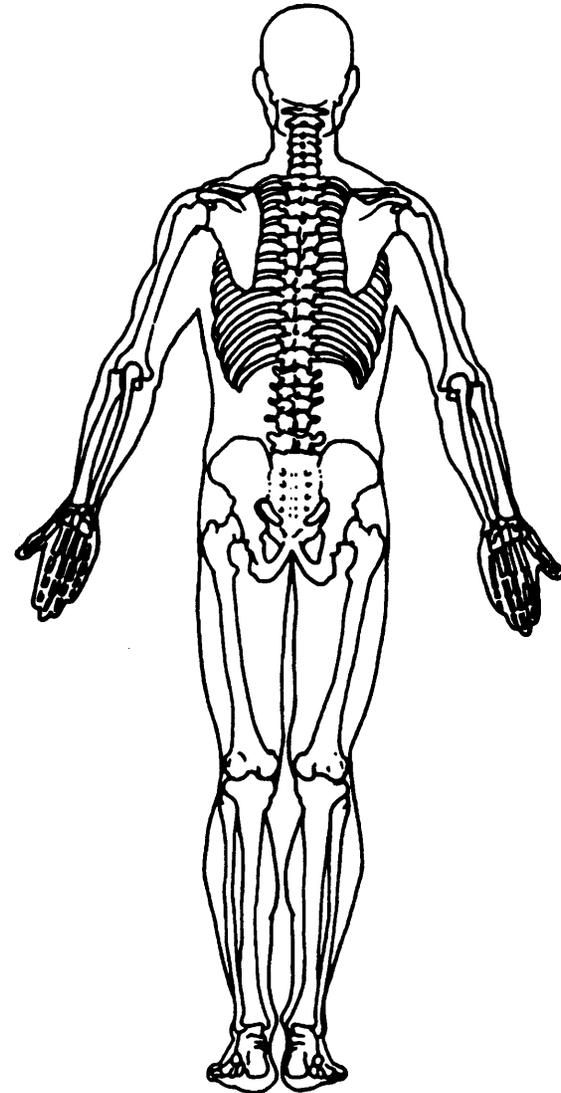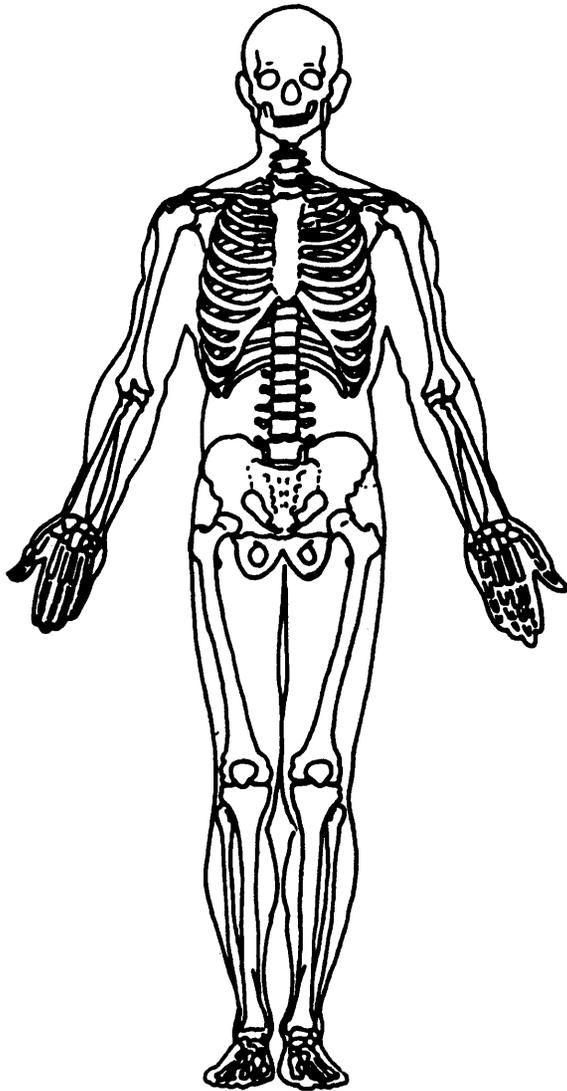

OFFICIAL INJURY DATA – INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

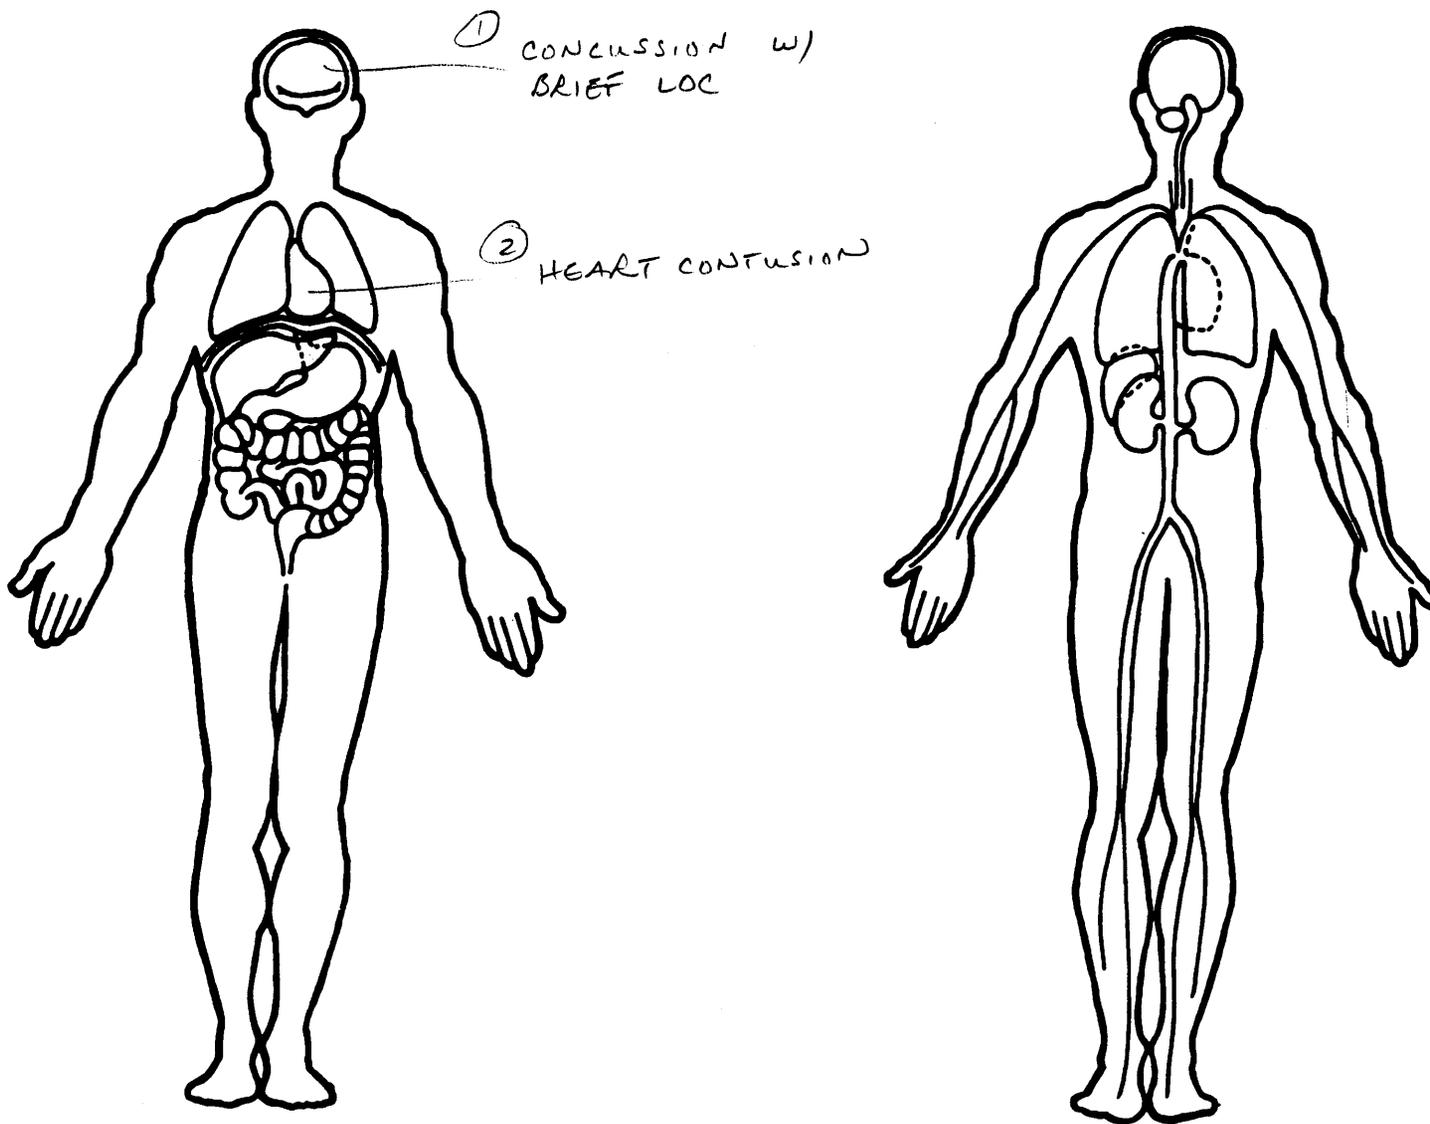



NOT COOED - TOO LOW
SMASH PROGRAM SUMMARY

(All Measurements in Metric)

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

Identifying Title

75

Primary Sampling Unit

158A

Case No.-Stratum

01

Accident Event Sequence No.

1 96

Date (Month, day, year) of Run

GENERAL INFORMATION

VEHICLE 1

VEHICLE 2

NASS Vehicle Number

02

NASS Vehicle Number

Year

1996

Year

Make

Chevrolet

Make

Model

Suburban

Model

Body Style

4W

Body Style

CDC

11 L D A W 2

CDC

BARRIER

Damaged Side

FLEW

Damaged Side

PDOF

± 20°

PDOF

± _____°

Heading Angle

± 180°

Heading Angle

± _____°

VEHICLE SPECIFICATIONS

VEHICLE 1

VEHICLE 2

Wheelbase

334 cm

Wheelbase

_____ cm

Overall Length

559 cm

Overall Length

_____ cm

Overall Width

195 cm

Overall Width

_____ cm

Weight

2572 + 213 + 45 = 2830 kg

Weight

_____ + _____ + _____ = _____ kg

Engine Displacement

5.7 L

Engine Displacement

_____ L

Drive System

4WD

Drive System

Size

6

Size

Stiffness

6

Stiffness

DAMAGE INFORMATION

VEHICLE 1

VEHICLE 2

Damage known?

168

Damage known?

Damage Length

399 cm

Damage Length

_____ cm

Damage Offset

± 20 cm -62

Damage Offset

± _____ cm

Crush Depth:

C1 39 cm 39
C2 10 cm 4
C3 8 cm 0
C4 21 cm 0
C5 19 cm 0
C6 18 cm 1

Crush Depth:

C1 _____ cm
C2 _____ cm
C3 _____ cm
C4 _____ cm
C5 _____ cm
C6 _____ cm

SCENE INFORMATION

Rest and Impact Positions [] No [] Yes

	VEHICLE 1			VEHICLE 2	
Rest	X	_____ . ____ m	Rest	X	_____ . ____ m
Position	Y	_____ . ____ m	Position	Y	_____ . ____ m
	PSI	_____ °		PSI	_____ °
Impact	X	_____ . ____ m	Impact	X	_____ . ____ m
Position	Y	_____ . ____ m	Position	Y	_____ . ____ m
	PSI	_____ °		PSI	_____ °
Slip Angle (-180 to +180)		_____ °	Slip Angle (-180 to +180)		_____ °

VEHICLE MOTION

Sustained Contact [] No [] Yes		Sustained Contact [] No [] Yes	
VEHICLE 1		VEHICLE 2	
Vehicle Rotation [] No [] Yes		Vehicle Rotation [] No [] Yes	
Rotation Stop Before Rest [] No [] Yes		Rotation Stop Before Rest [] No [] Yes	
End of Rotation	X _____ . ____ m	End of Rotation	X _____ . ____ m
Position	Y _____ . ____ m	Position	Y _____ . ____ m
	PSI _____ °		PSI _____ °
Curved Path [] No [] Yes		Curved Path [] No [] Yes	
Point on Path	X _____ . ____ m Y _____ . ____ m	Point on Path	X _____ . ____ m Y _____ . ____ m
Rotation Direction [] None [] CW [] CCW		Rotation Direction [] None [] CW [] CCW	
Rotation > 360° [] No [] Yes		Rotation > 360° [] No [] Yes	

FRICITION INFORMATION

Coefficient of Friction _____

Rolling Resistance Option 1

Vehicle 1 Rolling Resistance		Vehicle 2 Rolling Resistance	
LF _____	RF _____	LF _____	RF _____
LR _____	RR _____	LR _____	RR _____

IF THIS COMMON IMPACT WAS WITH A CDS VEHICLE NOT IN TRANSPORT, FILL IN THE INFORMATION BELOW.

Model Year: _____

Make: _____

Model: _____

VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate damage sketch and dimensions to the form.

Summary of Results Using Damage

Speed Change
(Damage)

Vehicle #1

Total 13 km/h (8 mph)
 Longitudinal -12 km/h (-8 mph)
 Latitudinal 4 km/h (3 mph)
 PDOF Angle -20 °
 Energy Dissipated = 19764 Joules (14575 Ft-Lb)
 Barrier Equivalent Speed = 13.1 km/h (8.1 mph)
 Calculated using size and stiffness categories.

Vehicle #2

Total 0 km/h (0 mph)
 Longitudinal 0 km/h (0 mph)
 Latitudinal 0 km/h (0 mph)
 PDOF Angle 0 °
 Energy Dissipated = 0 Joules (0 Ft-Lb)
 Barrier Equivalent Speed = 0.0 km/h (0.0 mph)
 Calculated using size and stiffness categories.

General Information

	Vehicle #1	Vehicle #2
Year	1996	1900
Make	chevrolet	
Model	suburban	
CDC	11FDEW2	BARRIER
Side Damaged	F	
PDOF Angle	-20 °	0 °
Heading Angle	180 °	0 °

Calculation method:	Size and Stiffness	Size and Stiffness
Size Category	6	11
Stiffness Category	6	11
Vehicle Weight	2830 kgs (6239 lbs)	453592 kgs (999999 lbs)

Damage Information


Vehicle Damage Known	Vehicle #1		Vehicle #2	
	Yes		Yes	
Crush Length	168.0 cm	(66 in)	0.0 cm	(0 in)
C1	39.0 cm	(15 in)	0.0 cm	(0 in)
C2	4.0 cm	(2 in)	0.0 cm	(0 in)
C3	0.0 cm	(0 in)	0.0 cm	(0 in)
C4	0.0 cm	(0 in)	0.0 cm	(0 in)
C5	0.0 cm	(0 in)	0.0 cm	(0 in)
C6	0.1 cm	(0 in)	0.0 cm	(0 in)
D	-61.9 cm	(-24 in)	0.0 cm	(0 in)
D'	-130.6 cm	(-51 in)	0.0 cm	(0 in)

Vehicle Dimensions

	Vehicle #1		Vehicle #2	
Length	559.0 cm	(220 in)	0.0 cm	(0 in)
Width	195.0 cm	(77 in)	0.0 cm	(0 in)
Wheelbase	334.0 cm	(131 in)	254.0 cm	(100 in)
Weight	2830 kgs	(6239 lbs)	453592 kgs	(999999 lbs)
CG to Front of Veh	264.7 cm	(104 in)	127.0 cm	(50 in)
Engine Displacement	5.7 liters		0.0 liters	
Moment of Inertia	798930 kgs	(70715 lbs)	29375740821 kgs (2600101632 l	
Vehicle Mass	2830 kgs	(16.2 lb-s ² /in)	453515 kgs (2600.1 lb-s ² /in)	

1996 chevrolet suburban

PDOF

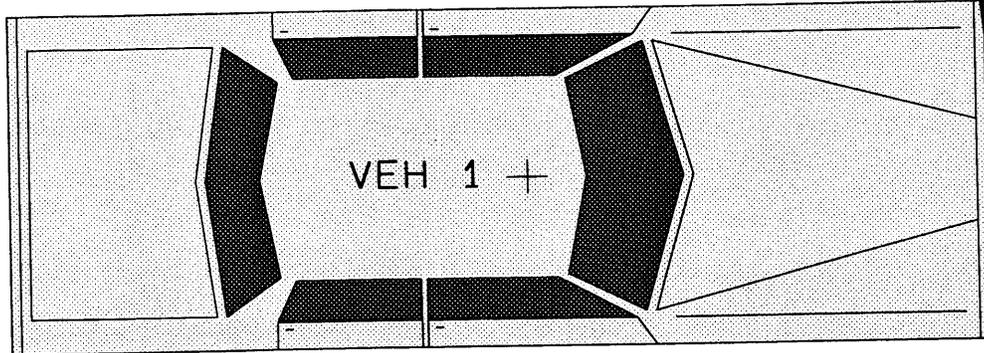

1996

final

75158A00000011[REDACTED]969.0400000000000209000001002[REDACTED]96[REDACTED]96[REDACTED]97[REDACTED]96036320000
00100000003632029 0507
75158A00010012[REDACTED]969.0410000000000145F0216F
75158A00020012[REDACTED]969.0410000000000216T3100N
75158A01000021 9.04 0000000009607482401B6KF26CXTS[REDACTED]0109708909600[REDACTED]10
0211231000010108011250
75158A01000022 9.04 0000000001010112099910900000000000031518011004999 999 99
9999999909997301
75158A01000031 9.04 000000000010281FDEW02 190029026023022016011+
026 19013934217001900402050101002000
75158A01000041 9.04 00000000007310000000012200200122001001110060011100100
75158A01000042 9.04 000000000110222110612122612
210000002202110
75158A01010051 9.04 0000000005811730831110000004404111000005111001111011 99
621010112111071423100000000000026500000000000001021011
75158A01010161 9.04 0000000007752000220512100
75158A02000021 9.04 0000000009620431161GNGK26J7TJ[REDACTED]0108908909600[REDACTED]90
0211231000010162011151
75158A02000022 9.04 000000000102021202570050201461110018031501004999 999 99
9999999909998301
75158A02000031 9.04 000000000010111FLEW02023100TYD004168039004000000000000-
062 16804433417301000202010101001000
75158A02000041 9.04 00000000098233113000012222202122221013666610611111101
75158A02000042 9.04 0000000001106422107421114431113311116311216311316311213
31131331111033210000003612220
75158A02010051 9.04 0000000005811881221119000021404112000000111001111011 99
62101012211401131360000000000041000620199000002011011
75158A02010161 9.04 0000000007441499330512197
75158A02010261 9.04 0000000007852600290522197
75158A02020051 9.04 0000000005211830912130000022404114000000100000000000 00
00000000003011314100000000000033105280000000012021011
75158A02020161 9.04 0000000002160406202042197
75158A02020261 9.04 0000000002441002341013100
75158A02020361 9.04 0000000003290202172042197
75158A02020461 9.04 0000000003290600102042197
75158A02020561 9.04 0000000002290402102042197
75158A02020661 9.04 0000000002290402102042197
75158A02020761 9.04 0000000003790202121512100
75158A02020861 9.04 0000000002790402121513100
75158A02020961 9.04 0000000003890202110132100
75158A02021061 9.04 0000000002890402110132100
75158A02021161 9.04 0000000002515099701522100
75158A02021261 9.04 0000000007297402112042197

75158A00000066 9.04 000000000PICKUP/UTILITY VEH.-ANGLE IMPT
75158A00000171 9.04 000000000 VEHICLE NUMBER ONE WAS NORTHBOUND ON A TW
0 LANE, TWO-WAY STATE HIGHWAY.
75158A00000271 9.04 000000000

75158A00000371 9.04 000000000THE ROADWAY WAS WET WITH SLUSH FILED ALONG THE
ROAD EDGE AND ACCUMULATED
75158A00000471 9.04 000000000

75158A00000571 9.04 000000000ALONG THE CENTER LANE LINE. VEHICLE NUMBER ONE
WAS PULLING A SMALL HOME-MADE
75158A00000671 9.04 000000000

75158A00000771 9.04 000000000TRAILER HAULING A MOTORCYCLE. VEHICLE NUMBER
TWO WAS SOUTHBOUND ON THE SAME
75158A00000871 9.04 000000000

75158A00000971 9.04 000000000ROADWAY. THE TRAFFIC VOLUME WAS FAIRLY HEAVY
AND TRAFFIC WAS TRAVELING AT
75158A00001071 9.04 000000000

75158A00001171 9.04 000000000THE MAXIMUM SPEED LIMIT. AS V#1 CONTINUED NOR
THBOUND THE TRAILER STARTED TO
75158A00001271 9.04 000000000

75158A00001371 9.04 000000000FISHTAIL BACK AND FORTH. THEN THE MOMENTUM OF
THE TRAILOR CAUGHT UP WITH THE
75158A00001471 9.04 000000000

75158A00001571 9.04 000000000PICKUP AND CAUSED THE PICKUP TO ROTATE CCW AND
ENTERED THE SOUTHBOUND TRAVEL
75158A00001671 9.04 000000000

75158A00001771 9.04 000000000LANE. THEN THE RIGHT FRONT OF V#1 CONTACTED T
HE FRONT LEFT OF V#2. V#1
75158A00001871 9.04 000000000

75158A00001971 9.04 000000000RODTATED COUNTER CLOCKWISE AS IT ENGAGED THE LE
FT SIDE OF V#2. THEN
75158A00002071 9.04 000000000

75158A00002171 9.04 000000000V#1 TRAVELED OFF THE WEST SIDE OF THE ROAD AND
CAME TO REST PARTIALLY ON THE
75158A00002271 9.04 000000000

75158A00002371 9.04 000000000DIRT SHOULDER FACING WEST. AFTER IMPACT V#2 W
ENT OFF THE RIGHT SIDE OF THE
75158A00002471 9.04 000000000

75158A00002571 9.04 000000000ROAD AND ROLLED TWO QUARTER TURNS TO THE RIGHT
AND CAME TO REST ON ITS ROOF
75158A00002671 9.04 000000000

75158A00002771 9.04 000000000FACING SOUTHEAST. BOTH VEHICLES WERE TOWED FR
OM THE SCENE AND THE OCCUPANT
75158A00002871 9.04 000000000

75158A00002971 9.04 000000000F V#2 WAS TRANSPORTED. THE DRIVER OF V#2 DIE
D AT THE SCENE.

INTERIOR VEHICLE Vehicle: 2

11

INTRA ERRORS

OCC0531 2 ***** THIS CASE SHOWS A DOOR OR HATCH OR GATE OPENING *****
 CC0532 ***** CHECK YOUR DATA AND IF CORRECT, NOTIFY YOUR ZONE *****
 CC0533 DOOR LEFT FRONT IV05 equals 2 or IV06 equals 2 or IV07 equals 2
 CC0534 or IV08 equals 2 or IV09 equals 2.

CC0541 2 ***** THIS CASE SHOWS A POSSIBLE HOLED WINDSHIELD. *****
 CC0542 ***** CHECK YOUR DATA AND IF CORRECT, NOTIFY YOUR ZONE *****
 CC0543 GLAZING WINDSHIELD IV31 equals 3 or 5 or CONTACT WINDSHIELD IV39
 CC0544 equals 4 or 6.

0

OCCUPANT ASSESSMENT Vehicle: 2 Occupant: 1

11

INTRA ERRORS

OHH0071 2 Given OCCUPANT AGE OA05 and OCCUPANT SEX OA06, OCCUPANT WEIGHT
 HH0072 OA08 is questionable. See Table A2.

011

INTER ERRORS

OGH0091 2 If BODY TYPE GV07 is not equal to 01-07, 14-16, 20, 21, 30 or
 GH0092 31, then AIR BAG AVAILABILITY/FUNCTION OA30 should equal 0.
 GH0093 GV=01 OA=01

EH0011 2 If TREATMENT OA62 equals 1, then 1st DEFORMATION EXTENT EV11
 EH0012 should be greater than 03. GV=02 OA=01

MM0081 2 If 1st OBJECT CONTACTED EV05(n) equals VEHICLE NUMBER GV03(m)
 MM0082 and BODYTYPE GV07(m) is less than 40 and EV05(m) is not blank,
 MM0083 then BASIS FOR DELTA V GV58(n) should not equal 04.

01

PSU75

ERROR SUMMARY SCREEN

████████/97

CASE 158A

CURRENT VERSION: 9.04

FORM NAME	NUMBER OF DOLLAR SIGNS	NUMBER OF LEVEL 1 ERRORS	NUMBER OF LEVEL 2 ERRORS	VERSION NUMBER CONSISTENT
Accident	0	0	0	Y
General Vehicle	0	0	0	Y
Vehicle Exterior	0	0	0	Y
Vehicle Interior	0	0	2	Y
Occupant Assessment	0	0	1	Y
Occupant Injury	0	0	0	Y
Total Inter Errors		0	3	
Total Case Errors	0	0	6	



SLIDE INDEX

Primary Sampling Unit Number 75

Case Number - Stratum 158A

Slide No.	Vehicle No.	Direction of Picture	Description of Slide Subject Matter
1-3	01	N	Direction of travel
4	01	N	P.O.I.
5-9	01	NW	travel after impact
10	01	W	Final Rest Area
11-13	01	SE/S	Looking Back
14-16	02	S	Direction of travel
17	02	S	POI
18-21	02	SW	Travel after impact
22-24	02	SW	Rollover Area
25-26	02	-	Final Rest
27-29	02	NE/N	Looking Back
30-40	01	-	Exterior Views
41-42	01	-	GAS Cap + Tank
43-51	01	-	EXT. Views
52-70	01	-	Interior Views
71-72	01	-	Trailer Views
73-85	02	-	Exterior Views
86-87	02	-	GAS Cap + Tank
88-99	02	-	EXT Views
100-133	02	-	Interior Views
134	02	-	Seat Belt Latch E.G.

Set up on
2 different planes
for each
vehicle
2A



FSU 75-158A (1998) #1



PSU 75-158A (1996) #2



PSU 75-158A (1998) #3



PSU 75-158A (1996) #4



PSU 75-158A (1996) #5



PSU 75-158A (1996) #6



PSU 75-158A (1996) #7



PSU 75-158A (1996) #8



PSU 75-158A (1996) #9



PSU 75-158A (1996) #10



PSU 75-158A (1998) #11



PSU 75-158A (1998) #12



PSU 75-158A (1996) #13



PSU 75-158A (1996) #14
Best Available



PSU 75-158A (1996) #15



PSU 75-158A (1996) #16



PSU 75-158A (1998) #17



PSU 75-158A (1996) #18



PSU 75-158A (1996) #19



PSU 75-158A (1998) #20



PSU 75-158A (1996) #21



PSU 75-158A (1996) #22
Best Available



PSU 75-158A (1996) #23



PSU 75-158A (1996) #24



PSU 75-158A (1996) #25



PSU 75-158A (1996) #26



PSU 75-158A (1996) #27



PSU 75-158A (1996) #28




PSU 75-158A (1996) #29



PSU 75-158A (1998) #30



PSU 75-158A (1996) #31

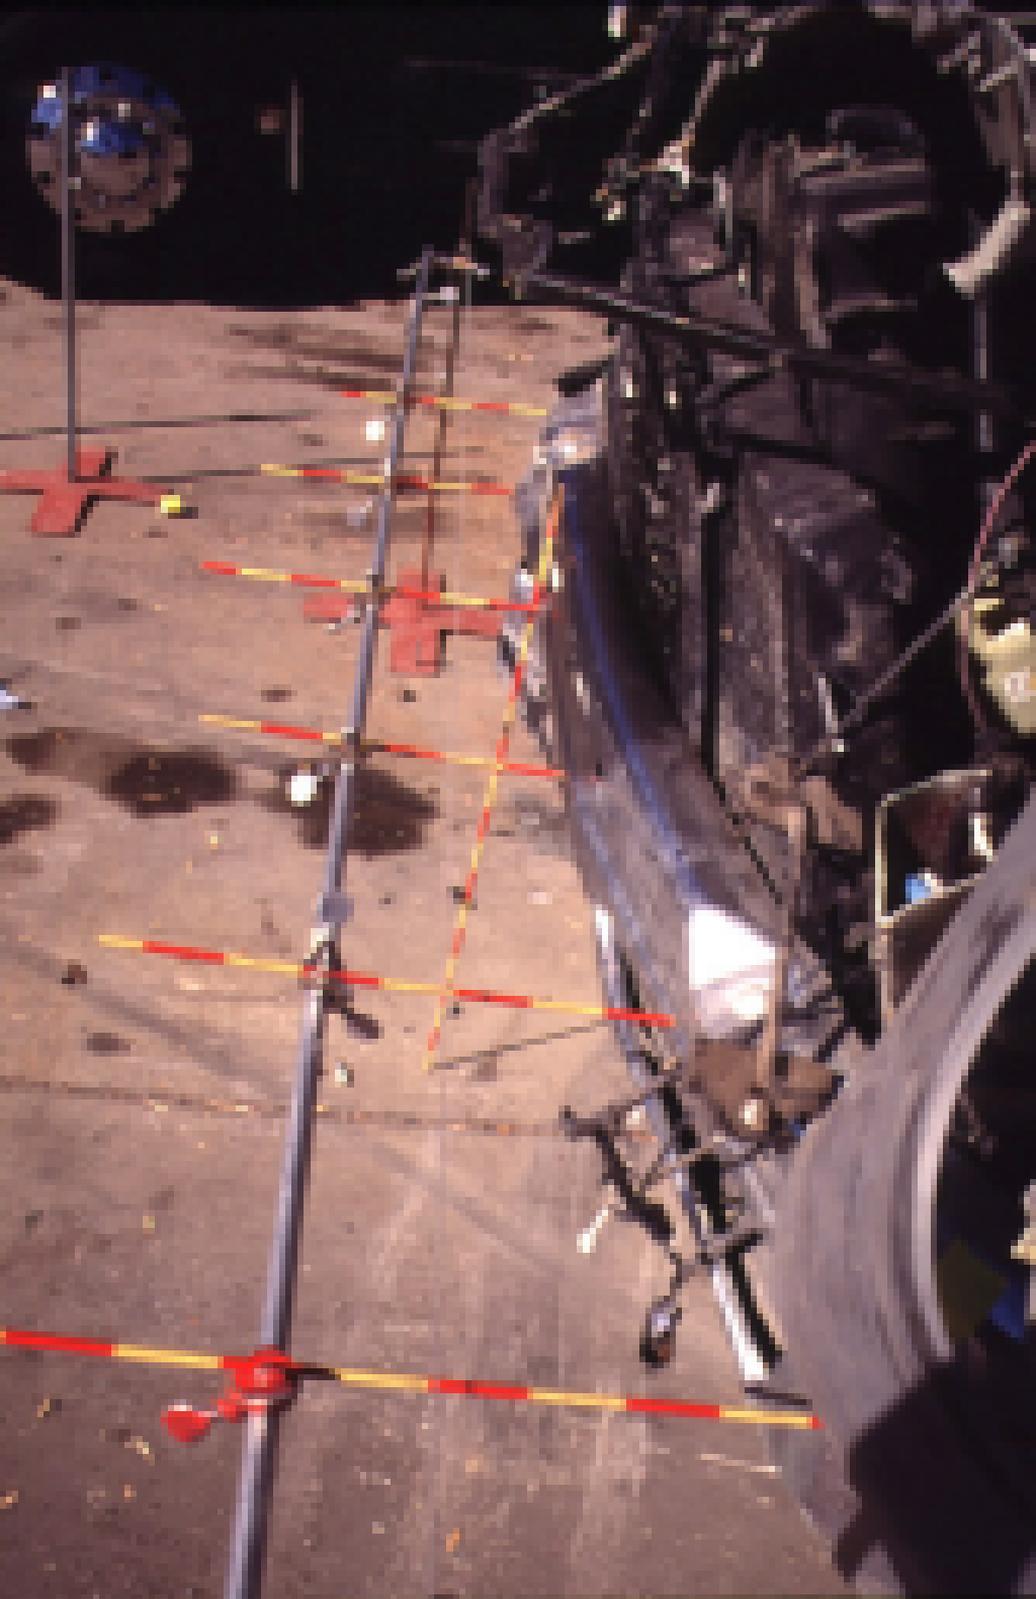

PSU 75-158A (1896) #32



PSU 75-158A (1996) #33



PSU 75-158A (1996) #34



PSU 75-158A (1996) #35



PSU 75-158A (1996) #36



PSU 75-158A (1996) #37



PSU 75-158A (1996) #38



PSU 75-158A (1996) #39



PSU 75-158A (1996) #40



PSU 75-158A (1996) #41



PSU 75-158A (1996) #42



PSU 75-158A (1996) #43



PSJ 75-158A (1996) #44



PSU 75-158A (1996) #45



PSU 75-158A (1996) #46

Best Available



FSU 75-158A (1996) #47



PSU 75-158A (1996) #48



PSU 75-158A (1998) #49



PSU 75-158A (1996) #50



PSU 75-158A (1996) #51



PSU 75-158A (1896) #52



PSU 75-158A (1996) #53



PSU 75-158A (1996) #54



PSU 75-158A (1996) #55



PSU 75-158A (1996) #56



PSU 75-158A (1998) #57



PSU 75-158A (1986) #58



PSU 75-158A (1996) #59



PSU 75-158A (1996) #60



PSU 75-158A (1996) #61



PSU 75-158A (1996) #62



PSU 75-158A (1996) #63



PSU 75-158A (1996) #64



PSU 75-158A (1996) #65



PSU 75-158A (1996) #66



PSU 75-158A (1996) #67



PSU 75-158A (1996) #68



PSU 75-158A (1996) #69



PSU 75-158A (1995) #70



PSU 75-158A (1996) #71



PSU 75-158A (1996) #72



PSU 75-158A (1998) #73



PSU 75-158A (1996) #74



PSU 75-158A (1996) #75



PSU 75-158A (1986) #76



PSU 75-158A (1996) #77



PSU 75-158A (1996) #78



PSU 75-158A (1996) #79



PSU 75-158A (1996) #60



PSU 75-158A (1996) #61



PSU 75-158A (1996) #82



PSU 75-158A (1996) #83



PSU 75-158A (1996) #84



PSU 75-158A (1996) #85



PSU 75-158A (1996) #86



PSU 75-158A (1996) #87



PSU 75-158A (1996) #88



PSU 75-158A (1996) #89



PSU 75-158A (1996) #90



PSU 75-158A (1996) #91



PSU 75-158A (1996) #92



PSU 75-158A (1996) #93



PSU 75-158A (1995) #94



PSU 75-158A (1996) #95



PSU 75-158A (1995) #96



PSU 75-168A (1996) #97



PSU 75-158A (1996) #98



PSU 75-158A (1996) #99



PSU 75-158A (1996) #100



PSU 75-158A (1996) #101
Best Available



PSU 75-158A (1996) #102
Best Available



PSU 75-158A (1998) #103



PSU 75-159A (1996) #104

Best Available



PSU 75-158A (1998) #105
Best Available



PSU 75-158A (1996) #106
Best Available



PSU 75-158A (1996) #107



PSU 75-158A (1996) #108



PSU 75-158A (1996) #109



PSU 75-158A (1996) #110



PSU 75-158A (1996) #111



PSU 75-158A (1996) #112



PSU 75-158A (1996) #113
Best Available



PSU 75-158A (1996) #114
Best Available



PSU 75-158A (1996) #115
Best Available



PSU 75-158A (1996) #116
Best Available



PSU 75-158A (1996) #117
Best Available



PSU 75-158A (1996) #118

Best Available



PSU 75-158A (1996) #119



PSU 75-158A (1996) #120



PSU 75-158A (1996) #121



PSU 75-158A (1896) #122



PSU 75-158A (1996) #123



PSU 75-158A (1998) #124



PSU 75-158A (1996) #125
Best Available



PSU 75-158A (1996) #126
Best Available



PSU 75-158A (1996) #127
Best Available



PSU 75-158A (1996) #128
Best Available




PSU 75-158A (1996) #129



PSU 75-158A (1986) #130



PSU 75-158A (1996) #131

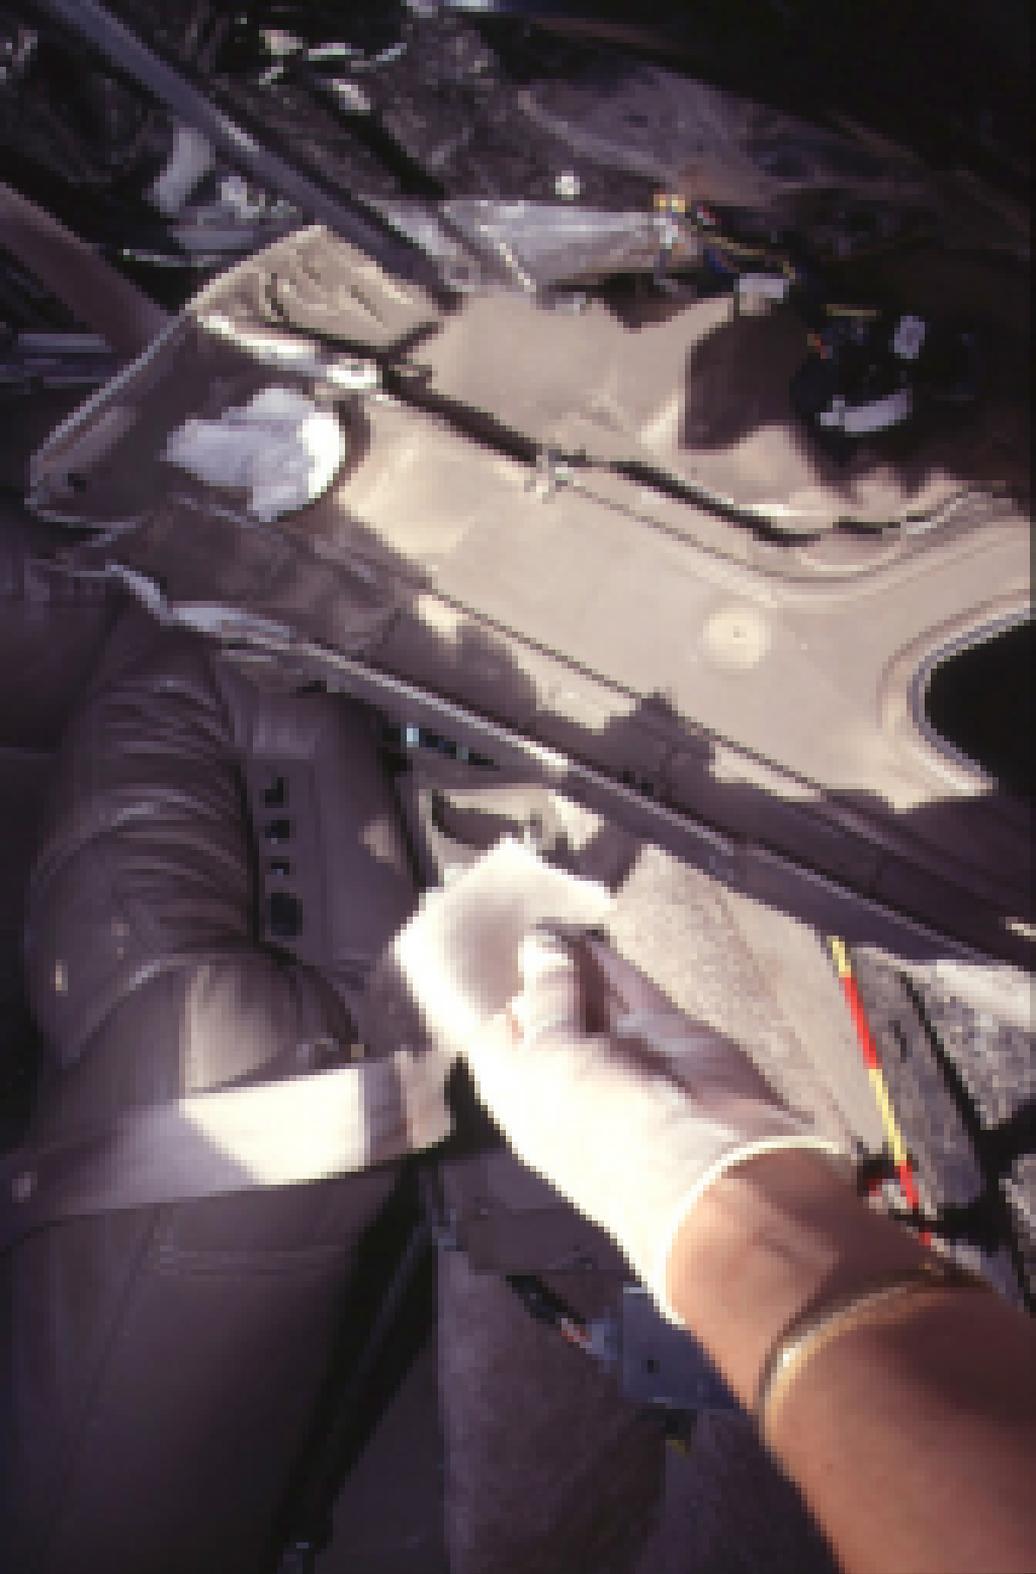

PSU 75-158A (1996) #132



PSU 75-158A (1996) #133



PSU 75-158A (1996) #134
Best Available