



U.S. Department
of Transportation

**National Highway
Traffic Safety
Administration**

400 Seventh Street, S.W.
Washington, D.C. 20590

Dear Crash Data Researchers/Users:

Thank you for choosing crash data from the National Highway Traffic Safety Administration (NHTSA) for your research or other use. The information contained in this motor vehicle crash report is collected, maintained and distributed in accordance with Public Law 89-564. In accordance with this Public Law, NHTSA is required not to release any case information until completion of quality control procedures. These procedures include a review of the case material to extract all names, licenses and registration numbers, non-coded interview material, non-research related researcher comments in the margins, non-factual data, and the production number portion of the vehicle identification number (VIN).

If you requested NHTSA to query its database files in order to identify a specific crash, then that query was made using non-personal descriptors you provided for use in our search. This motor vehicle crash may have been identified from a data search and matches the general, non-personal descriptors you provided, but we cannot confirm that this is the specific crash report you requested.

If you have any questions with regard to the above procedures, please contact the Field Operations Branch, Crash Investigation Division, National Center for Statistics and Analysis at 202-366-4820. Again, please be advised that we cannot confirm that this is the case that you have specifically requested nor can we certify the information to be correct.

*** **



AUTO SAFETY HOTLINE
(800) 424-9393
Wash. D.C. Area 366-0123



CASE SUMMARY

PSU 79 CASE NO. 044B TYPE OF ACCIDENT Car Broadside Car

A. DESCRIPTION OF THE ACCIDENT SEQUENCE AND ACCIDENT PECULIARITIES

(Provide a summary of the accident sequence as well as any particular event of the accident that is noteworthy. Injury mechanism and vehicle crashworthiness is the focus, not driver culpability. Do not include any personal identifiers.) V1 was W/B int #1 lane of an undivided 7 lane road approaching an intersecting undivided 7 lane road. V2 was S/B in the #3 (fast) lane of the intersecting road. As both vehicles entered the intersection the front of V2 struck the right side of V1. The impact forced V1 to rotate CCW and V2 to rotate CW while maintaing contact--the right side of V1 scraped along the left side of V2. Due to the force and rotation of the impact V1 was knocked onto its left side causing its rear bumper to strike the left rear side of V2 at a non horizontal angle. This impact pulled V1 back onto its wheels causing V1 to rotate CCW and travel S/W across the intersection. While moving to the S/W corner the left rear wheel of V1 struck the southwest curb flattening the tire and causing rim damage. The left rear of V1 then contacted a .5 meter diameter concrete street light pole. That impact caused V1 to continue rotating CCW and come to rest heading W/B in the #1 E/B curb lane. V2 rotated CW and unknown number of times and came to rest facing S/B in the west crosswalk of the intersection. Both vehicles were towed due to damage. The Driver and sole occupant of V1 was transported with type "B" injuries. The driver and right front passenger of V2 were transported with type "C" injuries. The left rear passenger of V2 was ejected during V2's rotation and pronounced dead at the scene.

B. VEHICLE PROFILE(S)

Vehicle No.	Class of Vehicle	Year/Make/Model	Most Severe Damage Based on Vehicle Inspection		Component Failure
			Damage Plane	Severity Description	
1	Subcompact	'81 Toyota Corolla	R Side	Severe	None
2	Subcompact	'90 Ford Escort	Front	Severe	None

DO NOT SANITIZE THIS FORM

C. PERSON PROFILE(S)

Vehicle No.	Person Role	Seat Position	Restraint Use	Most Severe Injury (TO BE COMPLETED BY ZONE CENTER)			
				Body Region	Injury Type	AIS	Injury Source
1	Driver	L Front	Lap & Shoulder	ARM	LACERATION	1	FLYING GLASS
2	Driver	L Front	Lap & motorized Shoulder	HIP	CONTUSION	2	SEATBELT
2	Pass.	R Front	Lap & motorized Shoulder	CHEST	CONTUSION	1	SEATBELT
2	Pass	L Rear	NONE	SKULL	FX'S	3	GROUND (NON-RESTRAINED)

Body Region

Abdomen
Ankle—foot
Arm (upper)
Back-thoracolumbar spine
Brain
Chest
Ears
Eye
Elbow
Face
Forearm
Head—skull
Heart
Kidneys
Knee
Leg (lower)
Liver
Lower limbs(s) (whole or unknown part)
Mouth
Neck—cervical spine
Nose

Pelvic—hip
Pulmonary—lungs
Shoulder
Spleen
Thigh
Thyroid, other endocrine gland
Upper limb(s) (whole or unknown part)
Vertebrae
Whole body
Wrist—hand

Injury Type

Abrasion
Amputation
Avulsion
Burn
Concussion
Contusion
Crush
Detachment, separation
Dislocation

Fracture
Fracture and dislocation
Laceration
Other
Perforation, puncture
Rupture
Sprain
Strain
Total severance, transection
Unknown

Abbreviated Injury Scale

- (1) Minor injury
- (2) Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity

DO NOT SANITIZE THIS FORM




ACCIDENT COLLISION DIAGRAM

PSU No. 79

Case Number—Stratum 044B

Indicate
North

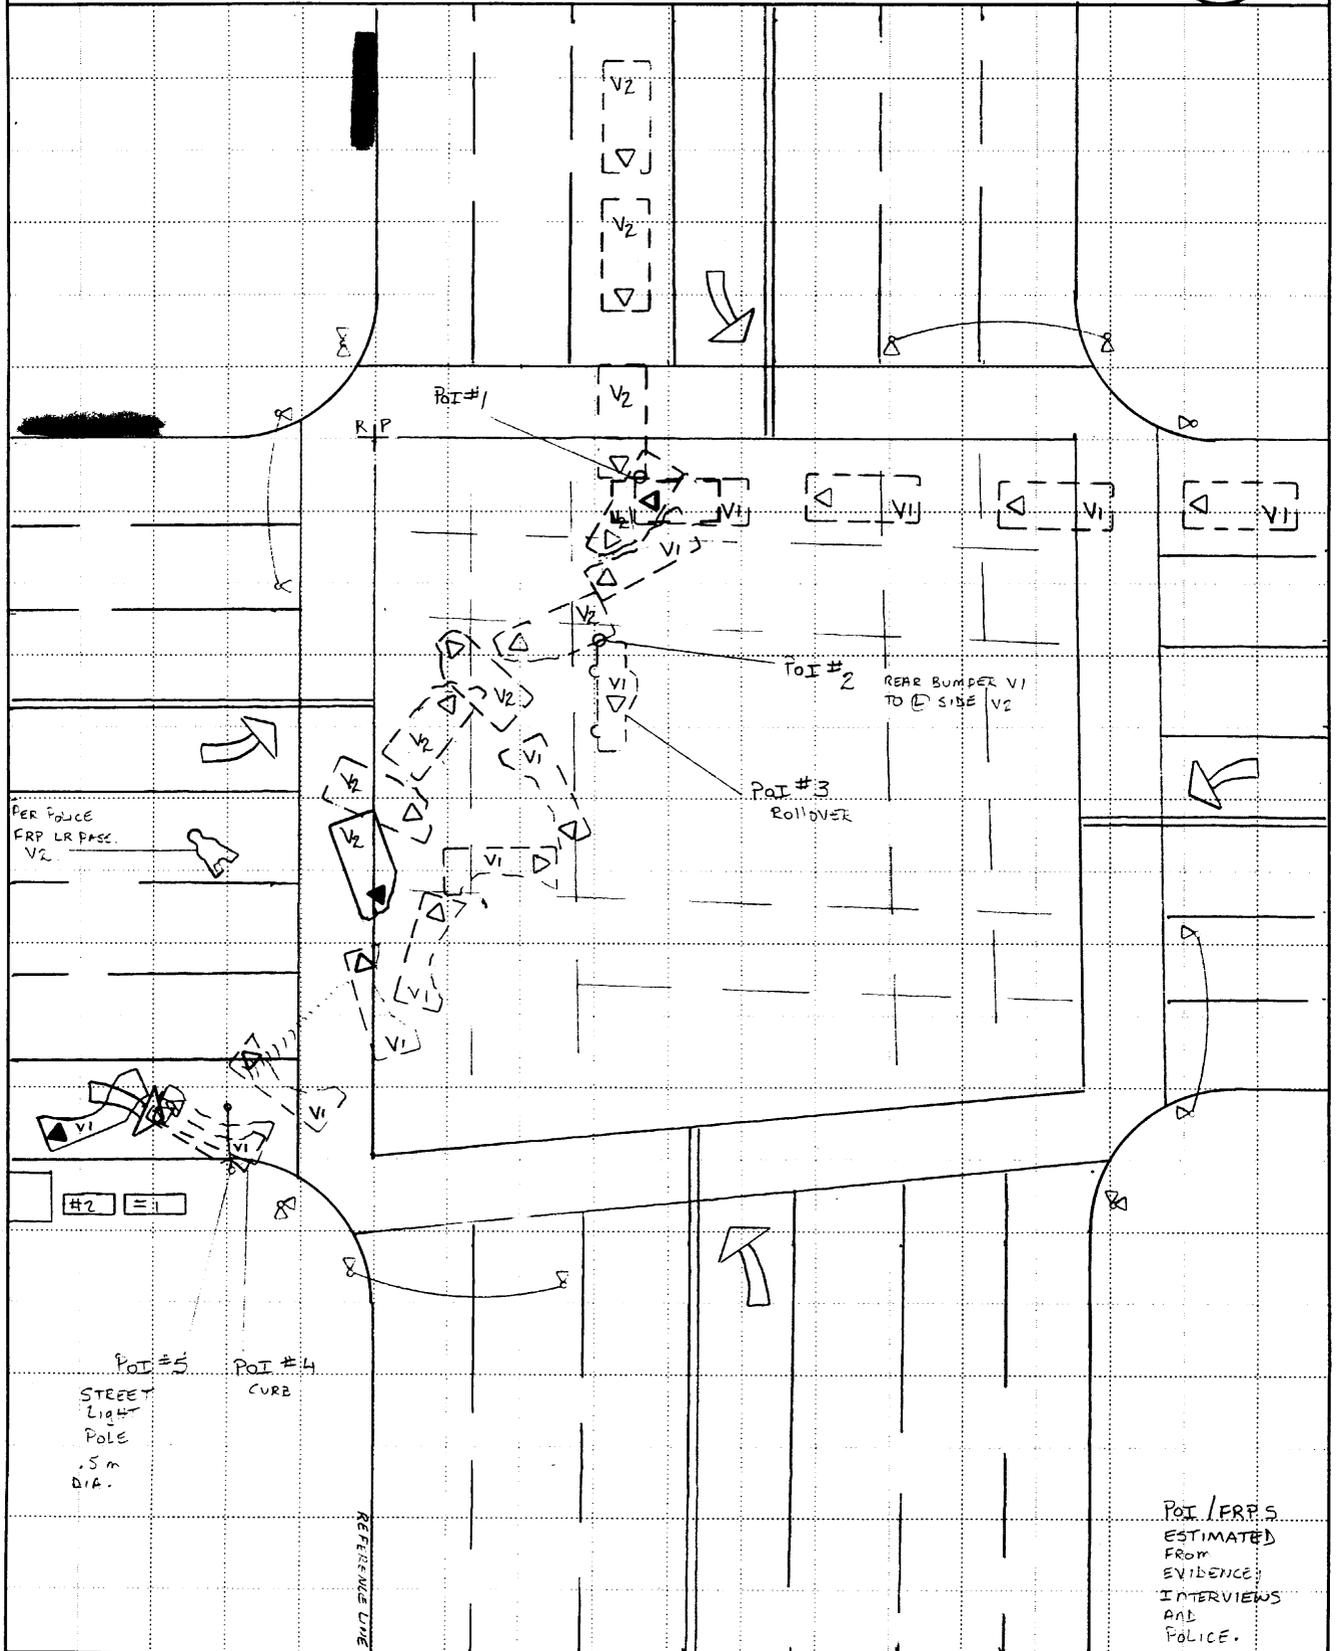



ACCIDENT COLLISION DIAGRAM


PSU No. 79

Case Number - Stratum 04413
24

Indicate
North



- ASPHALT
- LEVEL
- WORN
- TRI-COLOR SIGNALS
- NO PHYSICAL EVIDENCE

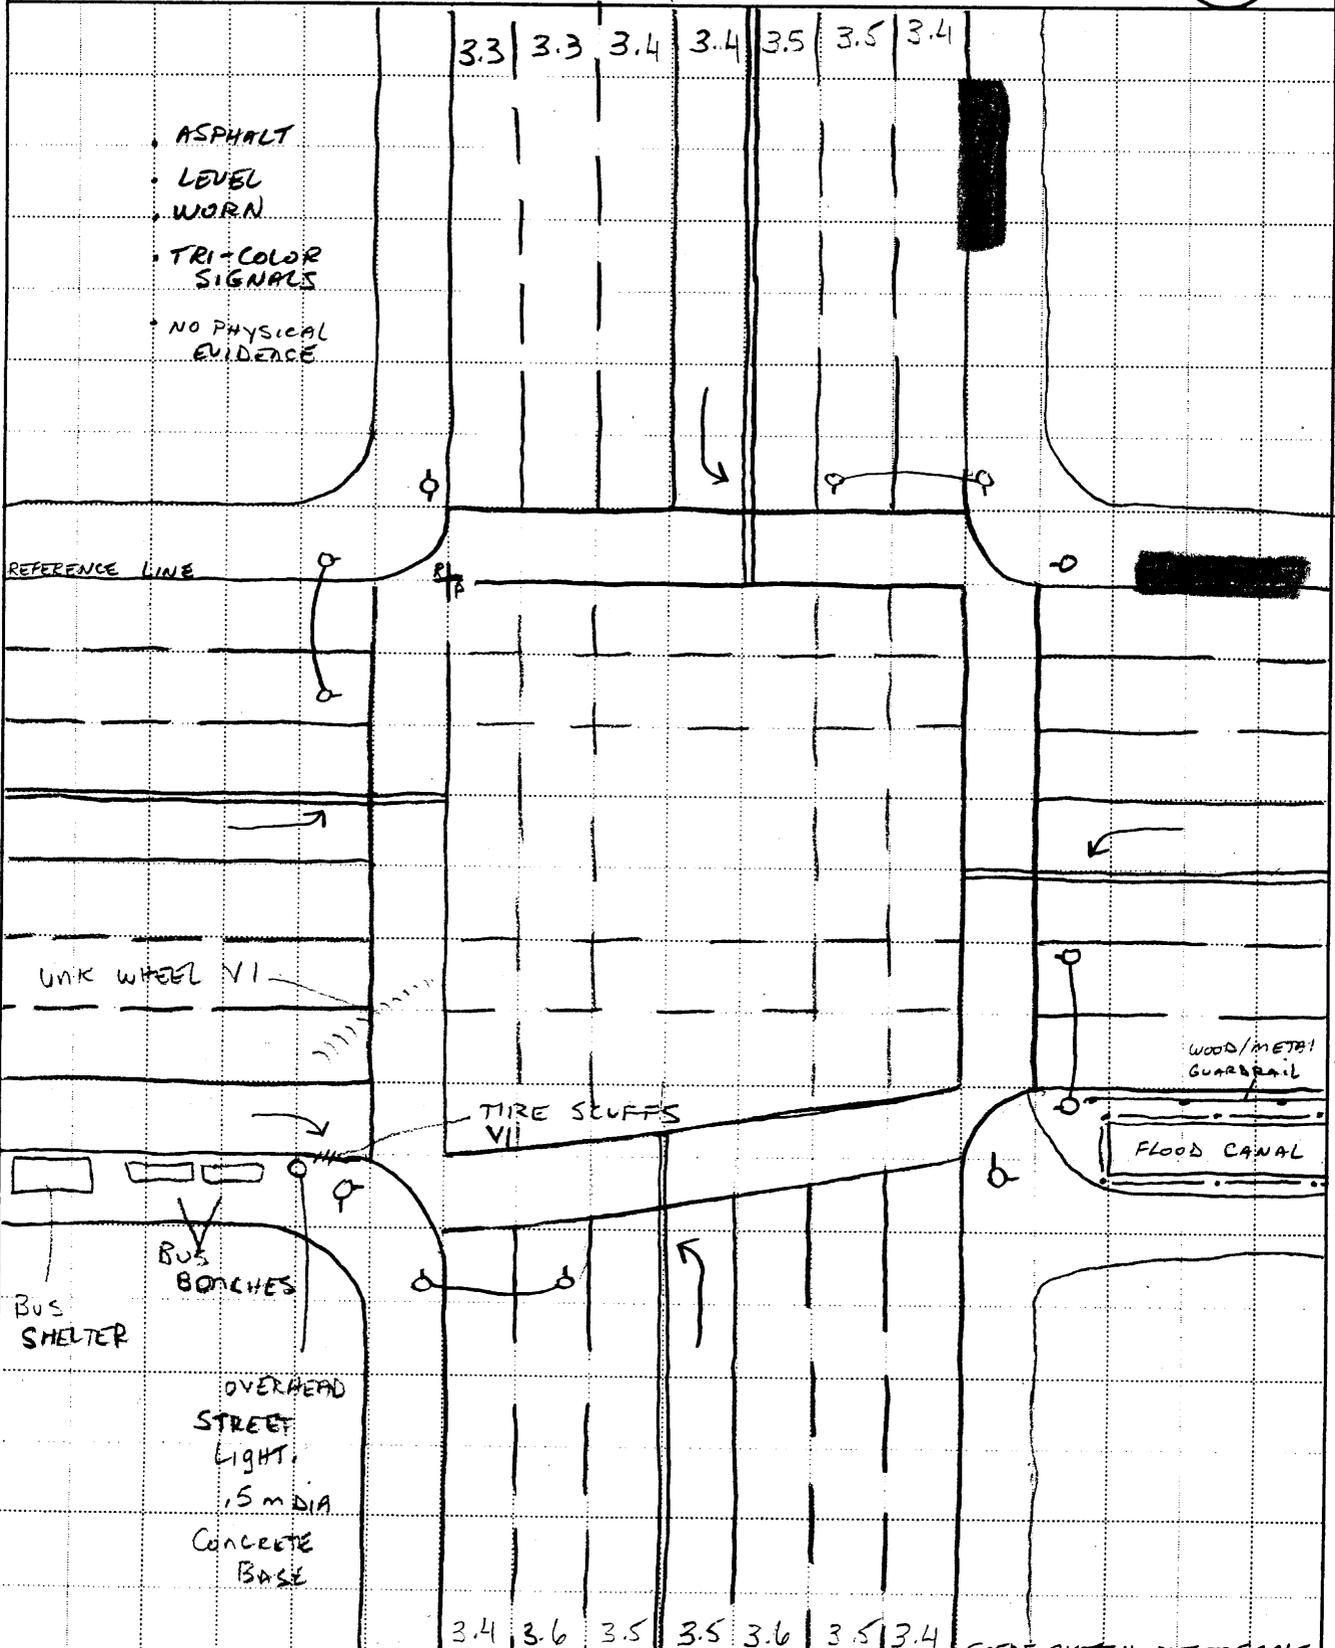

24.9

21.9

SCENE SKETCH NOT TO SCALE



ACCIDENT COLLISION MEASUREMENT TABLE

Primary Sampling Unit Number 79

Case Number—Stratum 044B

ACCIDENT COLLISION DIAGRAM		CRASH DATA		
LEVEL I PHYSICAL EVIDENCE ABSENT	LEVEL II (Cont'd) physical evidence is present:	VEH. #1	VEH. #2	VEH. #3
To be accomplished when there is no physical evidence present at the scene:	* document reference point and reference line relative to physical features present at the scene	Heading Angle	<u>270</u>	<u>180</u> <u>N/A</u>
* approximate vehicle orientation at impact and final rest	* scaled documentation of all accident induced physical evidence	Surface Type	<u>ASPHALT</u>	
* applicable road/roadway delineation (e.g., curbs/edge lines, lane markings, median markings, pavement markings, etc.)	* scaled documentation of all roadside objects contacted	Surface Condition	<u>WORN</u>	
* applicable traffic controls (e.g., speed limit)	* roadway surface type and condition of applicable roadways	Grade (v/h) Measurement (between impact and final rest)	<u>LEVEL</u>	
* north arrow placed on diagram	* grade measurements for all applicable roadways and at location of rollover initiation	Grade (v/h) Measurement (at location of rollover initiation)	<u>N/A</u>	
* sketch required	* scaled representations of the vehicle(s) at pre-impact, impact, and final rest based upon either: a) physical evidence, or b) reconstructed accident dynamics			
LEVEL II PHYSICAL EVIDENCE PRESENT				
In addition to the level I tasks noted above, the following must be accomplished when				

Reference Point: INTERSECT W/CURB [REDACTED]
§ N/CURB [REDACTED]

Reference line: N/CURB [REDACTED]

Item	Distance and Direction from Reference Point	Distance and Direction from Reference Line
RP	0	0
begin curb	17.8 S	.7 W
end curb	22.1 S	4.4 W
begin VI LR @ curb begin	24.9 S	4.5 W
end VI LR @ curb	24.9 S	4.9 W
street light pole FOE	25.4 S	4.9 W
begin evidence	26.2 S	6.5 W
end evidence	26.2 S	8.5 W
begin " "	26.2 S	8.8 W
end " "	26.2 S	10.6 W
begin use meter	25.5 S	11.1 W
curb	FAULT	

UNABLE TO MARK DUE TO VERY HEAVY TRAFFIC



ACCIDENT FORM

1. Primary Sampling Unit Number 79
2. Case Number - Stratum 044B

IDENTIFICATION

3. Number of General Vehicle Forms Submitted 02
4. Date of Accident (Month,Day,Year) 04/23/94
5. Time of Accident 2020
Code reported military time of accident.
NOTE: Midnight = 2400
Unknown = 9999

SPECIAL STUDIES - INDICATORS

Check (✓) each special study (SS14-SS18 below) that has been completed; code 1 for the checked special studies and 0 for the special studies not checked.

6. ___SS15 Administrative Use 0
7. ___SS16 Pedestrian Crash Data Study 0
8. ___SS17 Impact Fires 0
9. ___SS18 _____ 0
10. ___SS19 _____ 0

NUMBER OF EVENTS

11. Number of Recorded Events in This Accident 05
Code the number of events which occurred in this accident.

ACCIDENT EVENTS

For each event that occurred in the accident, code the lowest numbered vehicle in the left columns and the other involved vehicle or object on the right.

Accident Event Sequence Number	Vehicle Number	Class Of Vehicle	General Area of Damage	Vehicle Number or Object Contacted	Class Of Vehicle	General Area of Damage
12. <u>01</u>	13. <u>01</u>	14. <u>01</u>	15. <u>R</u>	16. <u>02</u>	17. <u>01</u>	18. <u>F</u>
19. <u>02</u>	20. <u>01</u>	21. <u>01</u>	22. <u>B</u>	23. <u>02</u>	24. <u>01</u>	25. <u>L</u>
26. <u>03</u>	27. <u>01</u>	28. <u>01</u>	29. <u>L</u>	30. <u>31</u>	31. <u>00</u>	32. <u>N</u>
33. <u>04</u>	34. <u>01</u>	35. <u>01</u>	36. <u>L</u>	37. <u>63</u>	38. <u>00</u>	39. <u>0</u>
40. <u>05</u>	41. <u>01</u>	42. <u>01</u>	43. <u>L</u>	44. <u>52</u>	45. <u>00</u>	46. <u>0</u>

IF GREATER THAN FIVE EVENTS, CONTINUE CODING ON THE ACCIDENT EVENT SUPPLEMENT

CODES FOR CLASS OF VEHICLE

- (00) Not a motor vehicle
- (01) Subcompact/mini (wheelbase < 254 cm)
- (02) Compact (wheelbase ≥ 254 but < 265 cm)
- (03) Intermediate (wheelbase ≥ 265 but < 278 cm)
- (04) Full size (wheelbase ≥ 278 but < 291 cm)
- (05) Largest (wheelbase ≥ 291 cm)
- (09) Unknown passenger car size
- (11) Compact utility vehicle
- (12) Large utility vehicle (≤ 4,500 kgs GVWR)
- (13) Passenger van (≤ 4,500 kgs GVWR)
- (14) Other van (≤ 4,500 kgs GVWR)
- (15) Pickup truck (≤ 4,500 kgs GVWR)
- (18) Other truck (≤ 4,500 kgs GVWR)
- (19) Unknown light truck type
- (20) School bus
- (21) Other bus
- (22) Truck (> 4,500 kgs GVWR)
- (23) Tractor without trailer
- (24) Tractor-trailer(s)
- (25) Motored cycle
- (28) Other vehicle
- (99) Unknown

CODES FOR GENERAL AREA OF DAMAGE (GAD)

CDS APPLICABLE AND OTHER VEHICLES

- (O) Not a motor vehicle
- (N) Noncollision
- (F) Front
- (R) Right side
- (L) Left side
- (B) Back
- (T) Top
- (U) Undercarriage
- (9) Unknown

TDC APPLICABLE VEHICLES

- (O) Not a motor vehicle
- (N) Noncollision
- (F) Front
- (R) Right side
- (L) Left side
- (B) Back of unit with cargo area (rear of trailer or straight truck)
- (D) Back (rear of tractor)
- (C) Rear of cab
- (V) Front of cargo area
- (T) Top
- (U) Undercarriage
- (9) Unknown

CODES FOR VEHICLE NUMBER OR OBJECT CONTACTED

(01-30) — Vehicle Number

Noncollision

- (31) Overturn — rollover
- (32) Fire or explosion
- (33) Jackknife
- (34) Other intraunit damage (specify): _____

- (35) Noncollision injury
- (38) Other noncollision (specify): _____

- (39) Noncollision — details unknown

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail) (specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify): _____
- (69) Unknown fixed object

Collision with Nonfixed Object

- (71) Motor vehicle not in-transport
- (72) Pedestrian
- (73) Cyclist or cycle
- (74) Other nonmotorist or conveyance

- (75) Vehicle occupant
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify): _____

- (89) Unknown nonfixed object

- (98) Other event (specify): _____

- (99) Unknown event or object

OCCUPANT RELATED

- 16. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
- 17. Number of Occupants This Vehicle 0 1
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
- 18. Number of Occupant Forms Submitted 0 1

- 24. Rollover 1
 (0) No rollover (no overturning)

Rollover (primarily about the longitudinal axis)
 (1) Rollover, 1 quarter turn only
 (2) Rollover, 2 quarter turns
 (3) Rollover, 3 quarter turns
 (4) Rollover, 4 or more quarter turns (specify):

 (5) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (9) Rollover (overturn), details unknown

VEHICLE WEIGHT ITEMS

- 19. Vehicle Curb Weight 2,090
 091 Code weight to nearest 10 kilograms.
 (045) Less than 450 kilograms
 (610) 6,100 kilograms or more
 (999) Unknown

2,185 lbs X .4536 = 991.1 kgs

 Source: '8' AUTO NEWS
- 20. Vehicle Cargo Weight 0 0 0 0
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (450) 4,500 kilograms or more
 (999) Unknown

 _____ lbs X .4536 = _____ kgs

OVERRIDE/UNDERRIDE (THIS VEHICLE)

- 25. Front Override/Underride (this Vehicle) 0
- 26. Rear Override/Underride (this Vehicle) 0

 (0) No override/underride, or not an end-to-end impact

Override (see specific CDC)
 (1) 1st CDC
 (2) 2nd CDC
 (3) Other not automated CDC (specify):

Underride (see specific CDC)
 (4) 1st CDC
 (5) 2nd CDC
 (6) Other not automated CDC (specify):

 (7) Medium/heavy truck or bus override
 (9) Unknown

RECONSTRUCTION DATA

- 21. Towed Trailing Unit 0
 (0) No towed unit
 (1) Yes--towed trailing unit
 (9) Unknown
- 22. Documentation of Trajectory Data for This Vehicle 1
 (0) No
 (1) Yes
- 23. Post Collision Condition of Tree or Pole (For Highest Delta V) 0
 (0) Not collision (for highest delta V) with tree or pole
 (1) Not damaged
 (2) Cracked/sheared
 (3) Tilted <45 degrees
 (4) Tilted ≥45 degrees
 (5) Uprooted tree
 (6) Separated pole from base
 (7) Pole replaced
 (8) Other (specify):

 (9) Unknown

HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V

- Values: (000)-(359) Code actual value
 (997) Noncollision
 (998) Impact with object
 (999) Unknown
- 27. Heading Angle For This Vehicle 2 7 0
 - 28. Heading Angle For Other Vehicle 1 8 0

Category	Configuration	ACCIDENT TYPES (Includes Intent)									
I Single Driver	A Right Roadside Departure	01 DRIVE OFF ROAD	02 CONTROL/ TRACTION LOSS	03 AVOID COLLISION WITH VEH., PED., ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN					
	B Left Roadside Departure	06 DRIVE OFF ROAD	07 CONTROL/ TRACTION LOSS	08 AVOID COLLISION WITH VEH., PED., ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN					
	C Forward Impact	11 PARKED VEH.	12 STA. OBJECT	13 PEDESTRIAN/ ANIMAL	14 END DEPARTURE	15 SPECIFICS OTHER	16 SPECIFICS UNKNOWN				
II Same Trafficway Same Direction	D Rear-End	20 STOPPED 21, 22, 23	22 SLOWER 24, 25, 27	24 DECEL. 26, 28, 31	25 AVOID COLLISION WITH VEH.	26 AVOID COLLISION WITH OBJECT	(EACH - 32) SPECIFICS OTHER	(EACH - 33) SPECIFICS UNKNOWN			
	E Forward Impact	34 CONTROL/ TRACTION LOSS	35 CONTROL/ TRACTION LOSS	36 AVOID COLLISION WITH VEH.	37 AVOID COLLISION WITH OBJECT	38 AVOID COLLISION WITH VEH.	39 AVOID COLLISION WITH OBJECT	40 CONTROL/ TRACTION LOSS	41 CONTROL/ TRACTION LOSS	(EACH - 42) SPECIFICS OTHER	(EACH - 43) SPECIFICS UNKNOWN
	F Sideswipe Angle	44 LATERAL MOVE	45 LATERAL MOVE	46 LATERAL MOVE	47 LATERAL MOVE	(EACH - 48) SPECIFICS OTHER	(EACH - 49) SPECIFICS UNKNOWN				
III Same Trafficway Opposite Direction	G Head-On	50 LATERAL MOVE	51 LATERAL MOVE	(EACH - 52) SPECIFICS OTHER	(EACH - 53) SPECIFICS UNKNOWN						
	H Forward Impact	54 CONTROL/ TRACTION LOSS	55 CONTROL/ TRACTION LOSS	56 AVOID COLLISION WITH VEH.	57 AVOID COLLISION WITH OBJECT	58 CONTROL/ TRACTION LOSS	59 CONTROL/ TRACTION LOSS	(EACH - 62) SPECIFICS OTHER	(EACH - 63) SPECIFICS UNKNOWN		
	I Sideswipe Angle	64 LATERAL MOVE	65 LATERAL MOVE	(EACH - 66) SPECIFICS OTHER	(EACH - 67) SPECIFICS UNKNOWN						
IV Change Trafficway Vehicle Turning	J Turn Across Path	68 INITIAL OPPOSITE DIRECTIONS	69 INITIAL OPPOSITE DIRECTIONS	70 INITIAL SAME DIRECTIONS	71 INITIAL SAME DIRECTIONS	72 INITIAL SAME DIRECTIONS	73 INITIAL SAME DIRECTIONS	(EACH - 74) SPECIFICS OTHER	(EACH - 75) SPECIFICS UNKNOWN		
	K Turn Into Path	76 TURN INTO SAME DIRECTION	77 TURN INTO SAME DIRECTION	78 TURN INTO OPPOSITE DIRECTIONS	79 TURN INTO OPPOSITE DIRECTIONS	80 TURN INTO OPPOSITE DIRECTIONS	81 TURN INTO OPPOSITE DIRECTIONS	82 TURN INTO OPPOSITE DIRECTIONS	(EACH - 84) SPECIFICS OTHER	(EACH - 85) SPECIFICS UNKNOWN	
V Intersecting Paths (Vehicle Damage)	L Straight Paths	86 OTHER VEH. OR OBJECT	87 OTHER VEH. OR OBJECT	88 OTHER VEH. OR OBJECT	89 OTHER VEH. OR OBJECT	(EACH - 90) SPECIFICS OTHER	(EACH - 91) SPECIFICS UNKNOWN				
VI Miscellaneous	M Backing Etc	92 BACKING VEH.	93 BACKING VEH.	98 Other Accident Type 99 Unknown Accident Type 00 No Impact							

OTHER DATA

56. Driver's Zip Code 91306

- (00000) Driver not present
- (00001) Driver not a resident of U.S. or territories
- 91306 Code actual 5-digit zip code
- (99999) Unknown

57. Driver's Race/Ethnic Origin 3

- (0) Driver not present
- (1) White (non-Hispanic)
- (2) Black (non-Hispanic)
- (3) White (Hispanic)
- (4) Black (Hispanic)
- (5) American Indian, Eskimo or Aleut
- (6) Asian or Pacific Islander
- (8) Other (specify): _____

(9) Unknown

58. Vehicle Special Use (This Trip) 0

- (0) No special use
- (1) Taxi
- (2) Vehicle used as school bus
- (3) Vehicle used as other bus
- (4) Military
- (5) Police
- (6) Ambulance
- (7) Fire truck or car
- (8) Other (specify): _____
- (9) Unknown

ROLLOVER DATA

If GV07 (Body Type) ≠ 1-49, leave GV59-GV63 blank.
 If GV24 (Rollover) = 0, then GV59-GV63 must equal 0.
 If GV24 = 9, then GV59-GV63 must equal 9.

59. Rollover Initiation Type 7

- (0) No rollover
- (1) Trip-over
- (2) Flip-over
- (3) Turn-over
- (4) Climb-over
- (5) Fall-over
- (6) Bounce-over
- (7) Collision with another vehicle
- (8) Other rollover initiation type specify): _____

(9) Unknown rollover initiation type

60. Location of Rollover Initiation 1

- (0) No rollover
- (1) On roadway
- (2) On shoulder—paved
- (3) On shoulder—unpaved
- (4) On roadside or divided trafficway median
- (9) Unknown

61. Rollover Initiation Object Contacted 0 2

62. Location on Vehicle Where Initial Principal Tripping Force Is Applied 2

- (0) No rollover
- (1) Wheels/tires
- (2) Side plane
- (3) End plane
- (4) Undercarriage
- (5) Other location on vehicle (specify): _____
- (8) Non-contact rollover forces (specify): _____
- (9) Unknown

63. Direction of Initial Roll 2

- (0) No rollover
- (1) Roll right - primarily about the longitudinal axis
- (2) Roll left - primarily about the longitudinal axis
- (5) End-over-end (i.e., primarily about the lateral axis)
- (9) Unknown roll direction

PRECRASH DATA

64. Pre-Event Movement (Prior to Recognition of Critical Event) 0 1

- (01) Going straight
- (02) Slowing or stopping in traffic lane
- (03) Starting in traffic lane
- (04) Stopped in traffic lane
- (05) Passing or overtaking another vehicle
- (06) Disabled or parked in travel lane
- (07) Leaving a parking position
- (08) Entering a parking position
- (09) Turning right
- (10) Turning left
- (11) Making a U-turn
- (12) Backing up (other than for parking position)
- (13) Negotiating a curve
- (14) Changing lanes
- (15) Merging
- (16) Successful avoidance maneuver to a previous critical event
- (97) Other (specify): _____
- (98) No driver present
- (99) Unknown

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
- (01-30) — Vehicle Number

Noncollision

- (31) Turn-over — fall-over
- (33) Jackknife

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail)
(specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify):

-
- (69) Unknown fixed object

Collision with Nonfixed Object

- (71) Motor vehicle not in-transport
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify):

-
- (89) Unknown nonfixed object

- (98) Other event (specify):

-
- (99) Unknown event or object



EXTERIOR VEHICLE FORM

1. Primary Sampling Unit Number	<u>79</u>	3. Vehicle Number	<u>01</u>
2. Case Number - Stratum	<u>044B</u>		

VEHICLE IDENTIFICATION

VIN J T 2 T E 7 2 D 9 B 0 0 9 8 0 1 3 Model Year 81
 Vehicle Make (specify): TOYOTA Vehicle Model (specify): COROLLA

LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	(R) SIDE FRONT BUMPER CORNER TO REAR BUMPER CORNER	ENTIRE (R) SIDE B/C TO B/C
2	Begins ^{29 cm off} LR axle rear to LR BUMPER CORNER	SAME FOR FIELD L
3	LEFT SIDE - ROLL OVER LF BUMPER CORNER TO LR B/C	SAME

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure and document on the vehicle diagram the location of maximum crush.

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

Specific Impact Number	Plane of Impact C-Measurements	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Width (CDC)	Max Crush								
1	MIDPLANE	280	80	283	6	35	64	74	43	24	
	FREESPACE		1		1	1	1	1	0	4	
	RESULT		79		5	34	63	73	43	20	(+10) 439
DROPPED	CONTOUR GAUGE STRAIGHT DOWN PER ZONE/TSI MEMO		16 cm REAR OF C4								
	Sill		55			20	50	55			
	FREESPACE		7			7	7	7			
	RESULT		48			13	43	48			
	AVERAGE				5	24	53	61	43	20	+10
4	NO MEASUREMENTS TAKEN DUE TO WHEEL IMPACT										
5	MIDPLANE	83	21	115	10	10	19	19	8	3	
	FREESPACE		1		0	0	1	1	2	3	
	RESULT		20		10	10	18	18	6	0	-191
2 & 3	NO MEAS. TAKEN DUE TO ROLL OVER / non HORIZONTAL FORCE										

ORIGINAL SPECIFICATIONS WORK SHEET


Wheelbase	— <u>94.5</u>	inches	x 2.54	=	— <u>240.</u> ⁰	cm
Overall Length	— <u>168.3</u>	inches	x 2.54	=	— <u>427.</u> ⁴	cm
Maximum Width	— <u>64.</u>	inches	x 2.54	=	— <u>162.</u> ⁵	cm
Curb Weight	— <u>2,185</u>	pounds	x .4536	=	—, <u>991.</u> ¹	kg
Average Track	— <u>52.4</u>	inches	x 2.54	=	— <u>133</u>	cm
Front Overhang	— — —.	inches	x 2.54	=	— — —	cm
Rear Overhang	— — —.	inches	x 2.54	=	— — —	cm
Undeformed End Width	— — —.	inches	x 2.54	=	— — —	cm
Engine Size: cyl./displ.	<u>4 cyl</u>	cc	x .001	=	—.	L
	<u>106</u>	CID	x .0164	=	<u>1.8</u>	L

50 2

50-6

VEHICLE DAMAGE SKETCH

TIRE—WHEEL DAMAGE a. Rotation physically restricted RF <u>2</u> LF <u>2</u> RR <u>2</u> LR <u>2</u> (1) Yes (2) No (8) NA (9) Unk.		b. Tire deflated RF <u>2</u> LF <u>2</u> RR <u>2</u> LR <u>1</u>		ORIGINAL SPECIFICATIONS Wheelbase <u>240</u> cm Overall Length <u>427</u> cm Maximum Width <u>143</u> cm Curb Weight <u>991</u> kg Average Track <u>133</u> cm Front Overhang <u>79</u> cm Rear Overhang <u>103</u> cm Undeformed End Width <u>150</u> cm Engine Size: cyl./displ. <u>4 cyl / 1.8</u> L		WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only) RF ± <u> </u> ° LF ± <u> </u> ° RR ± <u> </u> ° LR ± <u> </u> ° Within ± 5 degrees	
TYPE OF TRANSMISSION <input type="checkbox"/> Manual <input checked="" type="checkbox"/> Automatic				DRIVE WHEELS <input type="checkbox"/> FWD <input checked="" type="checkbox"/> RWD <input type="checkbox"/> 4WD		Approximate Cargo Weight <u> </u> kg	

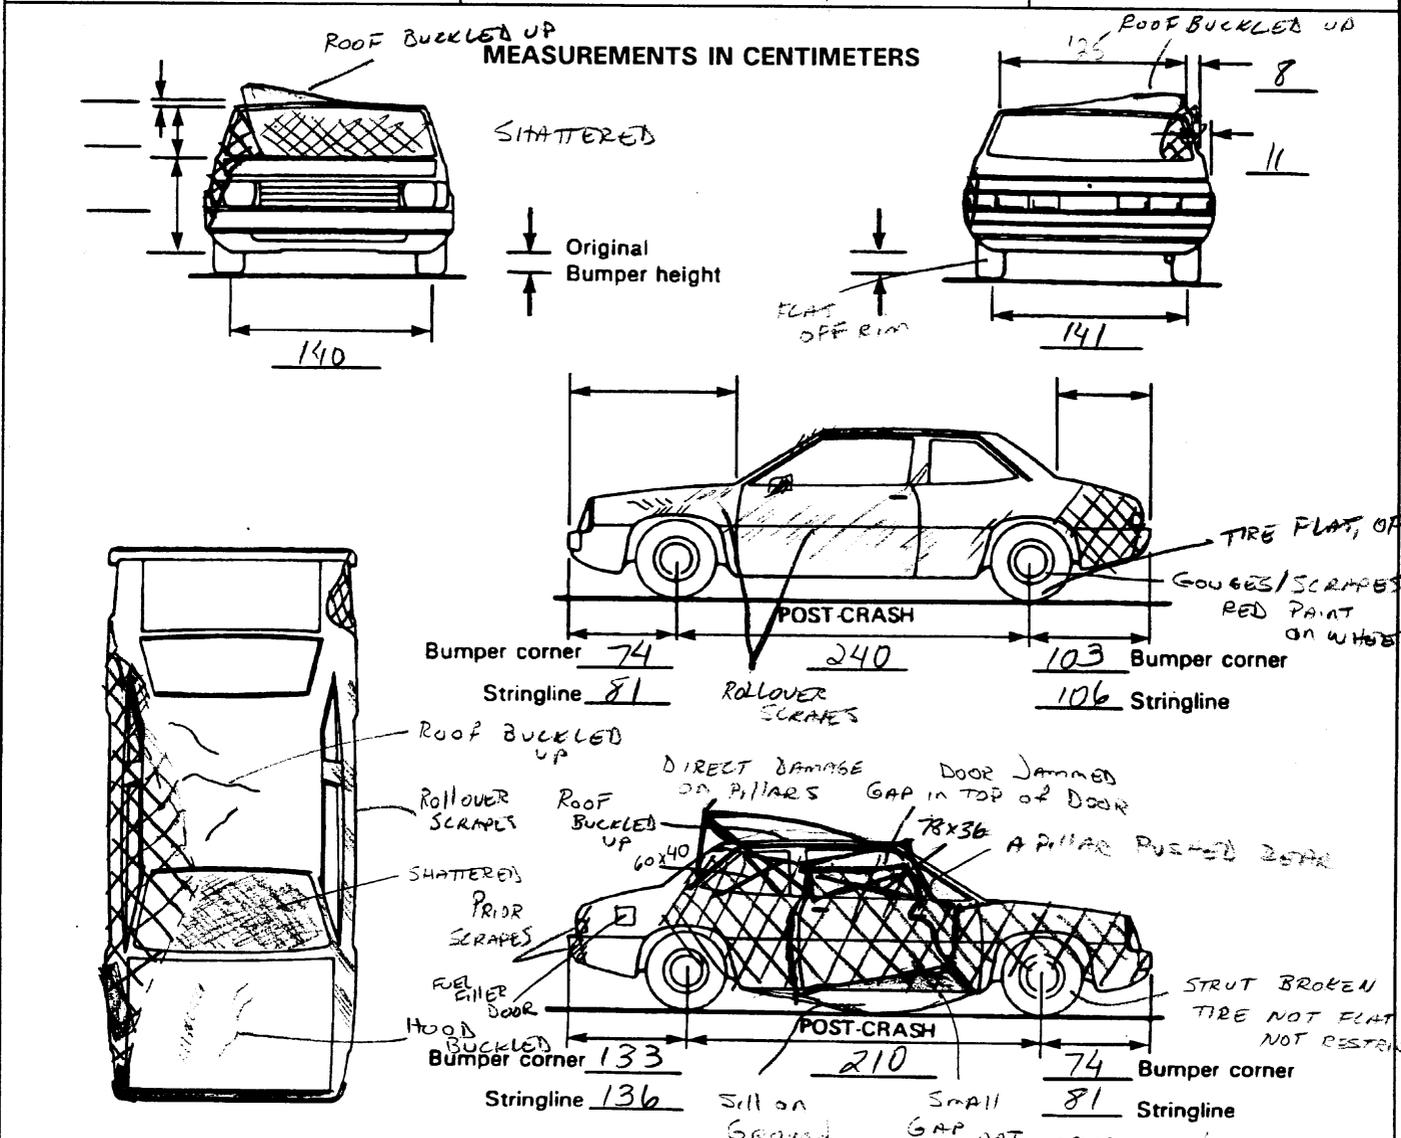

NOTES: Sketch new perimeter and cross hatch direct damage and single hatch induced damage on all views. Annotate observations which might be useful in reconstructing the accident (e.g., grass in tire bead, direction of striations, scuff on sidewalls, etc.). If pulling trailer, sketch type of trailer and damage received on the back of this page.

Annotate any damage caused by extrication such as component removal by torching, prying, or hydraulic shears.

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>02</u>	6. <u>02</u> ^{OK} 03 <u>ST</u>	7. <u>R</u>	8. <u>V</u>	9. <u>A</u>	10. <u>W</u>	11. <u>05</u>

Second Highest Delta "V"

12. <u>05</u>	13. <u>52</u>	14. <u>09</u>	15. <u>L</u>	16. <u>B</u>	17. <u>E</u>	18. <u>W</u>	19. <u>03</u>
---------------	---------------	---------------	--------------	--------------	--------------	--------------	---------------

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
<u>283</u>	<u>005</u>	<u>013</u>	<u>043</u>	<u>048</u>	<u>043</u>	<u>020</u>	<u>+039</u>

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
<u>115</u>	<u>010</u>	<u>010</u>	<u>018</u>	<u>018</u>	<u>006</u>	<u>000</u>	<u>+191</u>

26. Are CDCs Documented but Not Coded on The Automated File? 0
 (0) No
 (1) Yes

27. Researcher's Assessment of Vehicle Disposition 1
 (0) Not towed due to vehicle damage
 (1) Towed due to vehicle damage
 (9) Unknown

28. Original Wheelbase 240
240 Code to the nearest centimeter
 (999) Unknown

99.5 inches X 2.54 = 240 centimeters

<p>29. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? <u>0</u></p> <p>(0) No post manufacturer modifications (1) Yes - post manufacturer modifications (specify): _____ _____ _____ (Include photograph of CERTIFICATION PLACARD in case report) (9) Unknown if vehicle is modified</p>	<p>34. Fuel Tank-1 Location <u>1</u></p> <p>35. Fuel Tank-2 Location <u>0</u></p> <p>(0) No fuel tank (1) Aft of center of the rear wheels (rear axle) centered (2) Aft of center of the rear wheels (rear axle) left side (3) Aft of center of the rear wheels (rear axle) right side (4) Forward of center of the rear wheels (rear axle) centered (5) Forward of center of the rear wheels (rear axle) left side (6) Forward of center of the rear wheels (rear axle) right side (7) Over center of the rear wheels (rear axle) (8) Other (specify): _____ (9) Unknown</p>
<p>30. Fire Occurrence <u>0</u></p> <p>(0) No fire</p> <p>Yes, fire occurred (1) Minor (2) Major (9) Unknown</p>	<p>36. Fuel Tank-1 Filler Cap Location <u>3</u></p> <p>37. Fuel Tank-2 Filler Cap Location <u>0</u></p> <p>(0) No fuel tank (1) On back plane (2) Aft of center of the rear wheels (rear axle) on left side plane (3) Aft of center of the rear wheels (rear axle) on right side plane (4) Forward of center of the rear wheels (rear axle) on left side plane (5) Forward of center of the rear wheels (rear axle) on right side plane (6) Over the center of the rear wheels (rear axle) on left side plane (7) Over the center of the rear wheels (rear axle) on right side plane (8) Other (specify): _____ (9) Unknown</p>
<p>31. Origin of Fire <u>0</u></p> <p>(0) No fire (1) Vehicle exterior (front, side, back, top) (2) Exhaust system (3) Fuel tank (and other fuel retention system parts) (4) Engine compartment (5) Cargo/trunk compartment (6) Instrument panel (7) Passenger compartment area (8) Other location (specify): _____ (9) Unknown</p>	<p>38. Fuel Tank-1 Damage <u>1</u></p> <p>39. Fuel Tank-2 Damage <u>0</u></p> <p>(0) No fuel tank (1) No damage to fuel tank (2) Deformed, no seam failure (3) Deformed, with a seam failure (4) Punctured (5) Lacerated (ripped) (6) Abraded (scraped) (7) Filler neck separation from the fuel tank (8) Other damage (specify): _____ (9) Unknown</p>
<p>32. Type of Fuel Tank-1 <u>1</u></p> <p>33. Type of Fuel Tank-2 <u>0</u></p> <p>(0) No fuel tank (electrical vehicle) (1) Metallic (2) Non-metallic (9) Unknown</p>	

<p>40. Location of Fuel System-1 Leakage <u> 1 </u></p> <p>41. Location of Fuel System-2 Leakage <u> 0 </u></p> <p style="padding-left: 20px;">(0) No fuel tank (1) No fuel leakage</p> <p><i>Primary Area Of Leakage</i></p> <p style="padding-left: 20px;">(2) Tank (3) Filler neck (4) Cap (5) Lines/pump/filter (6) Vent/emission recovery (8) Other (specify): _____</p> <p style="padding-left: 20px;">(9) Unknown</p> <p>42. Fuel Type-1 <u> 0 </u> <u> 1 </u></p> <p>43. Fuel Type-2 <u> 0 </u> <u> 0 </u></p> <p><i>Single Fuel Type</i></p> <p style="padding-left: 20px;">(00) No fuel tank (01) Gasoline (02) Diesel (03) CNG (Compressed Natural Gas) (04) LPG (Liquid Petroleum Gas) also known as Propane (05) LNG (Liquid Natural Gas) (06) Methanol (M100 or M85) (07) Ethanol (E100 or E85) (08) Other (Hydrogen or others) (specify): _____</p> <p style="padding-left: 20px;">_____</p> <p><i>Electric Powered or Electric/Solar Powered Vehicles</i></p> <p style="padding-left: 20px;">(10) Lead Acid Battery (11) Nickel-Iron Battery (12) Nickel-Cadmium Battery (13) Sodium Metal Chloride Battery (14) Sodium Sulfur Battery (18) Other (Specify): _____</p> <p style="padding-left: 20px;">(98) Other Hybrid (specify): _____</p> <p style="padding-left: 20px;">_____</p> <p style="padding-left: 20px;">(99) Unknown fuel type</p>	<p>44. Is This Vehicle Equipped With More Than Two Fuel Tanks? <u> 0 </u></p> <p style="padding-left: 20px;">(0) No (one or two tanks only)</p> <p><i>Yes - More Than Two Tanks</i></p> <p style="padding-left: 20px;">(1) Yes -- <u>no damage</u> to any tank or filler cap and <u>no fuel system leakage</u></p> <p style="padding-left: 20px;">(2) Yes -- <u>no damage</u> to any tank or filler cap but <u>there is fuel system leakage</u> (specify leakage location): _____</p> <p style="padding-left: 20px;">(3) Yes -- <u>damage</u> to an additional tank or filler cap and <u>there is fuel system leakage</u> (specify the following): Type of tank _____ Tank location _____ Filler cap location _____ Tank damage _____ Location of leakage _____ Type of fuel _____</p> <p style="padding-left: 20px;">(9) Unknown if more than two tanks</p> <p style="text-align: center;">COMMENTS</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>
--	--

*** STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED AND WAS NOT AN AOPS ***
(I.E., GV09 = 0 OR 9 AND GV36 = 0), DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 79

2. Case Number - Stratum 044B

3. Vehicle Number 01

INTEGRITY

4. Passenger Compartment Integrity 06
(00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window RF/RR
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):

(99) Unknown

Door, Tailgate or Hatch Opening

5. LF 1 6. RF 3 7. LR 0 8. RR 0 9. TG/H 0

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify):
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

(0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify):

(9) Unknown

GLAZING

Glazing Damage from Impact Forces

15. WS 2 16. LF 0 17. RF 6 18. LR 0 19. RR 6
20. BL 0 21. Roof 8 22. Other 1

- (0) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (8) No glazing
- (9) Unknown if damaged

Glazing Damage from Occupant Contact

23. WS 0 24. LF 0 25. RF 0 26. LR 0 27. RR 0
28. BL 0 29. Roof 0 30. Other 0

- (0) No occupant contact to glazing or no glazing
- (1) Glazing contacted by occupant but no glazing damage
- (2) Glazing in place and cracked by occupant contact
- (3) Glazing in place and holed by occupant contact
- (4) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (5) Glazing out-of-place by occupant contact and holed by occupant contact
- (6) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

If No Glazing Damage **And** No Occupant Contact or No Glazing, Then Code IV31 Through IV46 As 0

Type of Window/Windshield Glazing

31. WS 1 32. LF 0 33. RF 2 34. LR 0 35. RR 2
36. BL 0 37. Roof 0 38. Other 0

- (0) No glazing contact and no damage, or no glazing
- (1) AS-1 - Laminated
- (2) AS-2 - Tempered
- (3) AS-3 - Tempered-tinted
- (4) AS-14 - Glass/Plastic
- (8) Other (specify):
- (9) Unknown


Window Precrash Glazing Status

39. WS 1 40. LF 0 41. RF 2 42. LR 0 43. RR 2
44. BL 0 45. Roof 0 46. Other 0

- (0) No glazing contact and no damage, or no glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (9) Unknown

INTRUSION WORKSHEET

Note: Sketch intruded areas

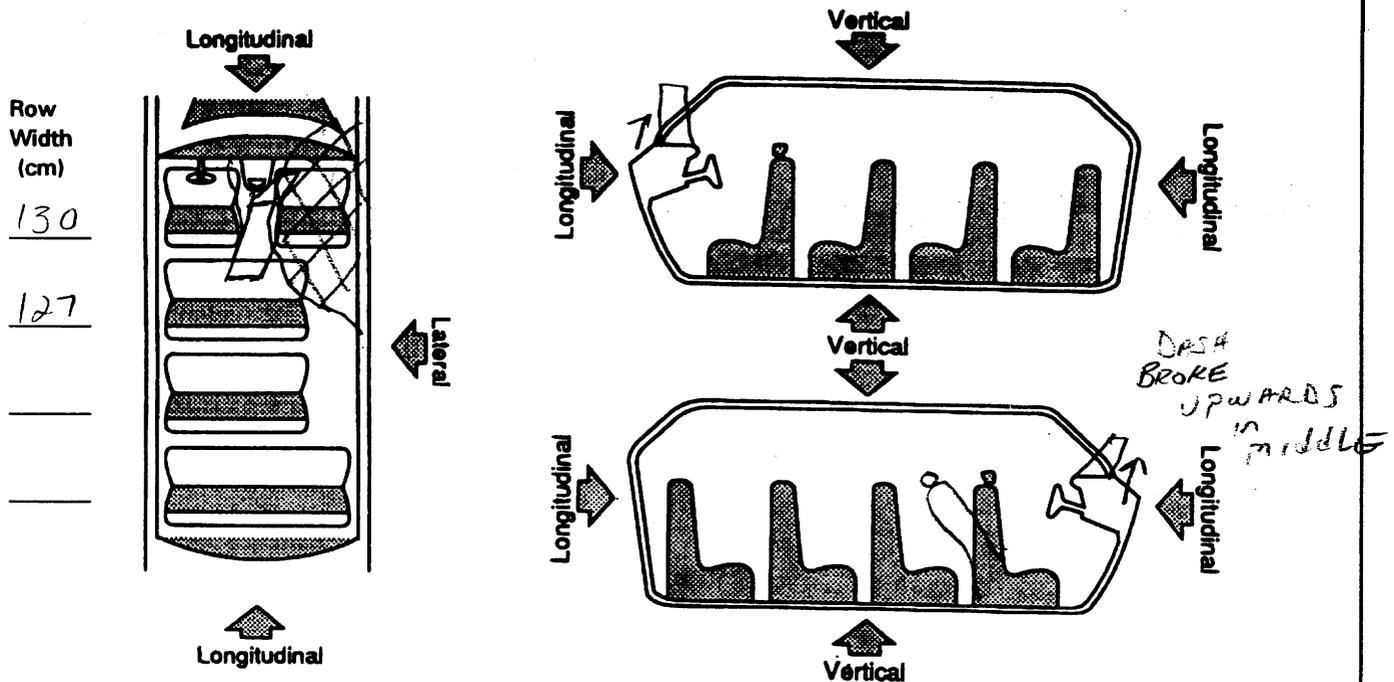

LOCATION OF INTRUSION	INTRUDED COMPONENT	(All Measurements Are in Centimeters)				DOMINANT CRUSH DIRECTION
		COMPARISON VALUE	INTRUDED VALUE	INTRUSION		
RF	DOOR	66	1	65	LAT	1 ⑨
	SIDE PANEL FWD OF A PILLAR	65	1	64	LAT	2 ⑩
	INST PANEL	63	13	50	LAT	4
	ROOF SIDE RAIL	56	46	10	LAT	12
CF	RF SEAT BACK/CUSHION	12	(-8)	+20	LAT	7
	INST PANEL	33	10	23	VERT	8
RR	SIDE PANEL ^{REAR} OF B PILLAR	66	42	24	LAT	7
	B-PILLAR	68	34	34	LAT	5
	RF SEAT BACK	57	33	24	LONG	6
	C-PILLAR	68	51	17	LAT	10
	ROOF SIDE RAIL	56	47	9	LAT	13
LF	INST PANEL	33	16	17	VERT	11
	CENTER CONSOLE	53	45	8	LAT	14
RF	SILL	66	5	61	LAT	3
		-	-	=		

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. <u>1 3</u>	48. <u>1 0</u>	49. <u>4</u>	50. <u>3</u>
2nd	51. <u>1 3</u>	52. <u>2 7</u>	53. <u>4</u>	54. <u>3</u>
3rd	55. <u>1 3</u>	56. <u>1 7</u>	57. <u>4</u>	58. <u>3</u>
4th	59. <u>1 3</u>	60. <u>0 4</u>	61. <u>4</u>	62. <u>3</u>
5th	63. <u>2 3</u>	64. <u>0 7</u>	65. <u>4</u>	66. <u>3</u>
6th	67. <u>2 3</u>	68. <u>1 9</u>	69. <u>3</u>	70. <u>2</u>
7th	71. <u>2 3</u>	72. <u>2 8</u>	73. <u>3</u>	74. <u>3</u>
8th	75. <u>1 2</u>	76. <u>0 3</u>	77. <u>3</u>	78. <u>1</u>
9th	79. <u>1 2</u>	80. <u>1 0</u>	81. <u>3</u>	82. <u>3</u>
10th	83. <u>1 2</u>	84. <u>2 7</u>	85. <u>3</u>	86. <u>3</u>

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Door panel (side)
- (12) Roof (or convertible top)
- (13) Roof side rail
- (14) Windshield
- (15) Windshield header
- (16) Window frame
- (17) Floor pan (includes sill)
- (18) Backlight header
- (19) Front seat back
- (20) Second seat back
- (21) Third seat back
- (22) Fourth seat back
- (23) Fifth seat back
- (24) Seat cushion
- (25) Back door/panel (e.g., tailgate)
- (26) Other interior component (specify):

- (27) Side panel - forward of the A (A2)-pillar
- (28) Side panel - rear of the A (A2)-pillar

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify):
- (32) Other exterior object in the environment (specify):
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify):
- (99) Unknown

LOCATION OF INTRUSION

- Front Seat**
- (11) Left
 - (12) Middle
 - (13) Right

- Fourth Seat**
- (41) Left
 - (42) Middle
 - (43) Right

- Second Seat**
- (21) Left
 - (22) Middle
 - (23) Right

- (97) Catastrophic
- (98) Other enclosed area (specify)

- Third Seat**
- (31) Left
 - (32) Middle
 - (33) Right

- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

STEERING COLUMN

87. Steering Column Type 1
 (1) Fixed column
 (2) Tilt column
 (3) Telescoping column
 (4) Tilt and telescoping column
 (8) Other column type (specify):
 (9) Unknown

88. Blank X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

89. Blank X X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

90. Blank X X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

91. Blank X X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

92. Steering Rim/Spoke Deformation 0 0
 Code actual measured deformation to the nearest centimeter
 (00) No steering rim deformation
 (01-14) Actual measured value in centimeters
 (15) 15 centimeters or more
 (98) Observed deformation cannot be measured
 (99) Unknown

93. Location of Steering Rim/Spoke Deformation 0 0
 (00) No steering rim deformation


Quarter Sections

- (01) Section A
- (02) Section B
- (03) Section C
- (04) Section D



Half Sections

- (05) Upper half of rim/spoke
- (06) Lower half of rim/spoke
- (07) Left half of rim/spoke
- (08) Right half of rim/spoke



- (09) Complete steering wheel collapse
- (10) Undetermined location
- (99) Unknown

INSTRUMENT PANEL

94. Odometer Reading 999,000
 kilometers—Code to the nearest 1,000 kilometers *UNK IF ORIG. MILES*
 (000) No odometer
 (001) Less than 1,500 kilometers
 (500) 499,500 kilometers or more
 (999) Unknown

57,609 miles X 1.6093 = _____ kilometers

Source: ODOMETER INSPECTION


95. Instrument Panel Damage from Occupant Contact? 0
 (0) No
 (1) Yes
 (9) Unknown

96. Knee Bolsters Deformed from Occupant Contact? 8
 (0) No
 (1) Yes
 (8) Not present
 (9) Unknown

97. Did Glove Compartment Door Open During Collision(s)? 1
 (0) No
 (1) Yes
 (8) Not present
 (9) Unknown

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

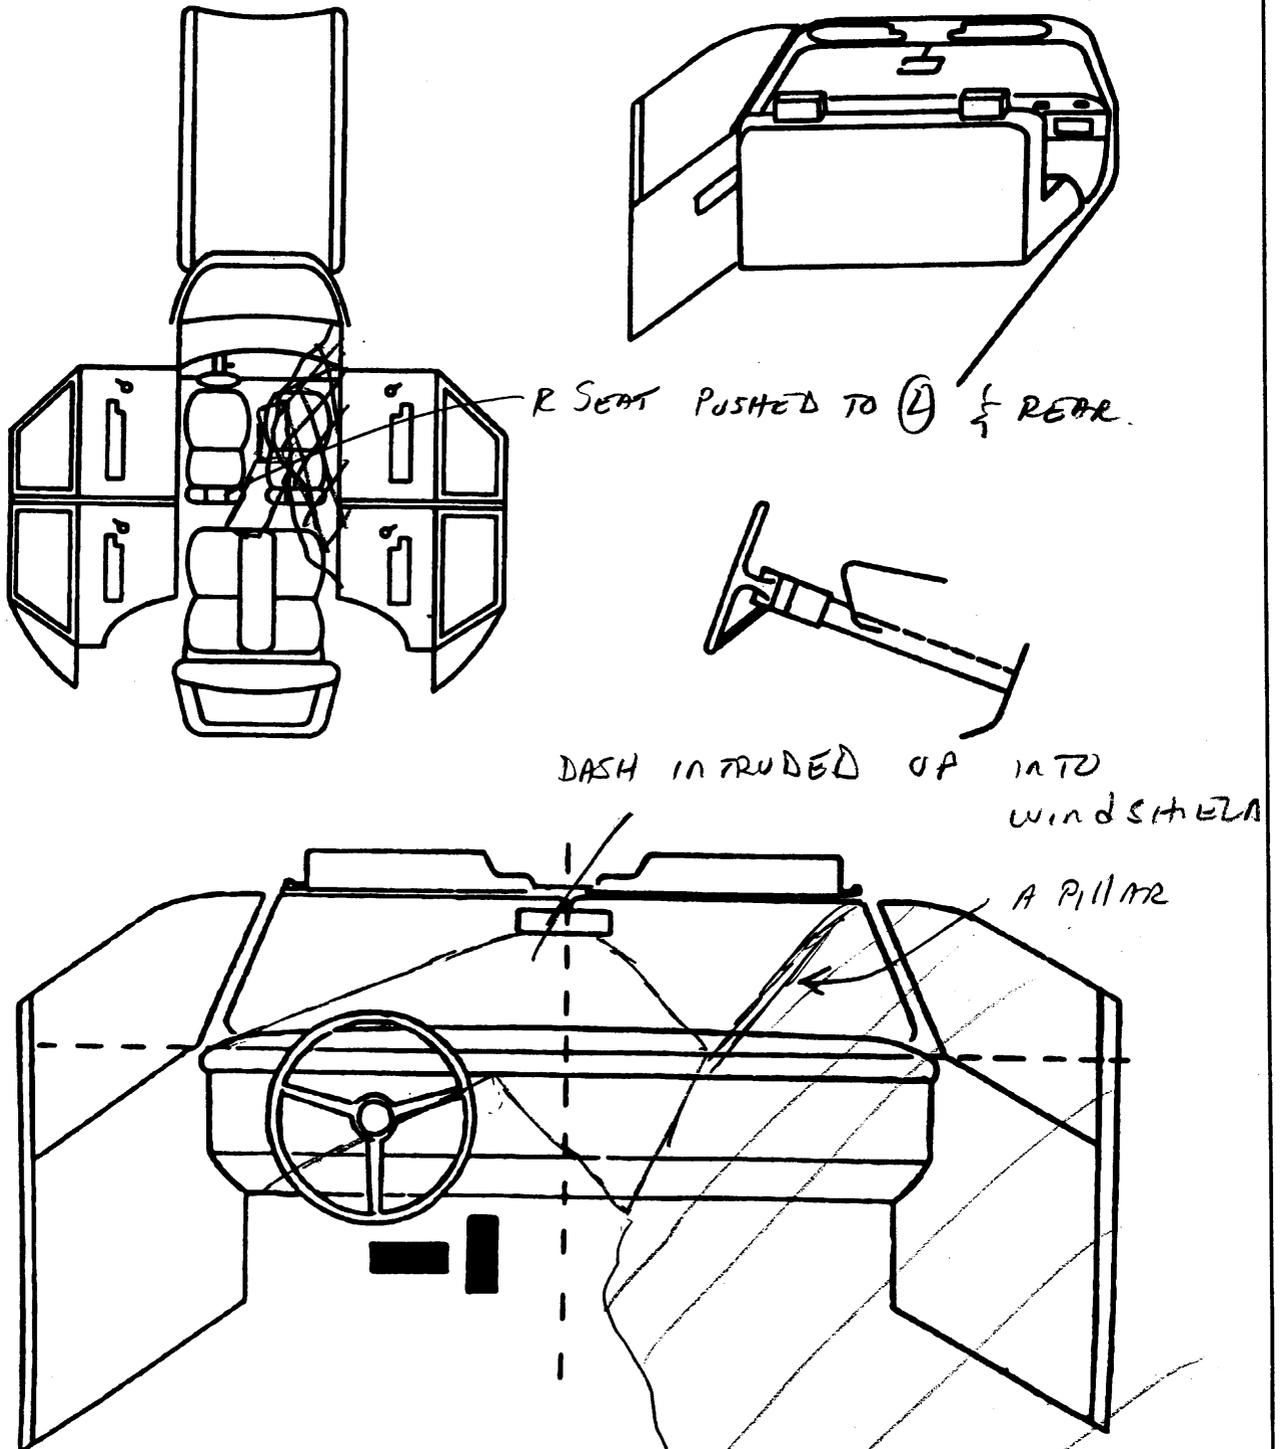

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).
Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A					
B				UNK. DUE TO SEVERITY OF INJURY.	
C					
D				DRIVER INJURY NOT SERIOUS & DRIVER UNABLE TO REMEMBER CONTACTING ANY COMPONENTS.	
E					
F					
G					
H					
I					
J					
K					
L					
M					
N					

CODES FOR INTERIOR COMPONENTS

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar

- (23) Left B-pillar
- (24) Other left pillar (specify): _____

- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____

- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____

- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B pillar, or roof side rail.
- (37) Other right side object (specify): _____

- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)

- (46) Other occupants (specify): _____

- (47) Interior loose objects

- (48) Child safety seat (specify): _____

- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)
- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Left	Right
F I R S T	Availability/Function	/	/
	Deployment	/	/
	Failure	/	/

Air Bag System Availability/Function

- (0) Not equipped/not available
- (1) Air bag

Non-functional

- (2) Air bag disconnected (specify): _____

- (3) Air bag not reinstalled

- (9) Unknown

Air Bag System Deployment

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

Are There Indications of Air Bag System Failure?

- (0) Not equipped/not available

- (1) No

- (2) Yes (specify): _____

- (9) Unknown

AUTOMATIC BELTS

		Left	Right
F I R S T	Availability/Function	/	/
	Use	/	/
	Type	/	/
	Proper Use	/	/
	Failure Modes	/	/

Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of automatic belt system (specify): _____
- (9) Unknown

Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

If a Child safety seat is present, encode the data on the back of this page.

If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
FIRST	Availability	4	0	4
	Evidence of usage <i>BELT REMOVED FROM USE</i>	04	0	04
	Used in this crash?	04	0	0
	Proper Use	1	0	0
	Failure Modes	1	0	0
SECOND	Availability <i>COVERED BY SEAT</i>	0	0	0
	Evidence of usage <i>SEAT COVER</i>	0	0	0
	Used in this crash?	0	0	0
	Proper Use	0	0	0
	Failure Modes	0	0	0
OTHER	Availability	/	/	/
	Evidence of usage	/	/	/
	Used in this crash?	/	/	/
	Proper Use	/	/	/
	Failure Modes	/	/	/

Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown

Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown

Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

- (6) Broken retractor
- (7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

1. Type of Child Safety Seat
- (0) No child safety seat
 - (1) Infant seat
 - (2) Toddler seat
 - (3) Convertible seat
 - (4) Booster seat
 - (7) Other type child safety seat (specify):

 - (8) Unknown child safety seat type
 - (9) Unknown if child safety seat used
2. Child Safety Seat Orientation
- (00) No child safety seat
 - Designed for Rear Facing for This Age/Weight
 - (01) Rear facing
 - (02) Forward facing
 - (08) Other orientation (specify):

 - (09) Unknown orientation
 - Designed for Forward Facing for This Age/Weight
 - (11) Rear facing
 - (12) Forward facing
 - (18) Other orientation (specify):

 - (19) Unknown orientation
 - Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 - (21) Rear facing
 - (22) Forward facing
 - (28) Other orientation (specify):

 - (29) Unknown orientation
 - (99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage
4. Child Safety Seat Shield Usage
5. Child Safety Seat Tether Usage
- Note: Options Below Are Used for Variables 3-5.
- (00) No child safety seat
 - Not Designed with Harness/Shield/Tether
 - (01) After market harness/shield/tether added, not used
 - (02) After market harness/shield/tether used
 - (03) Child safety seat used, but no after market harness/shield/tether added
 - (09) Unknown if harness/shield/tether added or used
 - Designed With Harness/Shield/Tether
 - (11) Harness/shield/tether not used
 - (12) Harness/shield/tether used
 - (19) Unknown if harness/shield/tether used
 - Unknown If Designed With Harness/Shield/Tether
 - (21) Harness/shield/tether not used
 - (22) Harness/shield/tether used
 - (29) Unknown if harness/shield/tether used
 - (99) Unknown if child safety seat used
6. Child Safety Seat Make/Model
(Specify make/model and occupant number)
- _____
- _____
- _____
- _____

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
FIRST	Head Restraint Type/Damage	3	0	3
	Seat Type	02	0	02
	Seat Performance	1	0	6
	Seat Orientation	1	0	1
SECOND	Head Restraint Type/Damage	0	0	0
	Seat Type	03	03	03
	Seat Performance	1	1	6
	Seat Orientation	1	1	1
THIRD	Head Restraint Type/Damage	/		
	Seat Type			
	Seat Performance			
	Seat Orientation			
OTHER	Head Restraint Type/Damage	/		
	Seat Type			
	Seat Performance			
	Seat Orientation			

Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral — no damage
- (2) Integral — damaged during accident
- (3) Adjustable — no damage
- (4) Adjustable — damaged during accident
- (5) Add-on — no damage
- (6) Add-on — damaged during accident
- (8) Other Specify): _____
- (9) Unknown

Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed specify: _____
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify):
 (R) SIDE INTRUDED INTO SEAT BACK CUSHION
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)

NO ABNORMAL POSTURE NOTED

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No [] Yes []

Describe indications of ejection and body parts involved in partial ejection(s):

Occupant Number						
Ejection						
(Note on Vehicle Interior Sketch) Ejection Area						
Ejection Medium						
Medium Status						

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

- (8) Other area (e.g., back of pickup, etc.) (specify): _____

(9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____

(5) Integral structure

- (8) Other medium (specify): _____

(9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No [] Yes []

Describe entrapment mechanism: _____

Component(s): _____

(Note in vehicle interior diagram)



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 79
 2. Case Number - Stratum 0443
 3. Vehicle Number 01
 4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 32
 Code actual age at time of accident.
 (00) Less than one year old (specify by month):
 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 1
 (1) Male
 (2) Female
 (9) Unknown

7. Occupant's Height (INTERVIEW) 165
 Code actual height to the nearest centimeter.
 (999) Unknown
65 inches X 2.54 = 165 centimeters

8. Occupant's Weight (INTERVIEW) 082
 Code actual weight to the nearest kilogram.
 (999) Unknown
170 pounds X .4536 = 81.6 kilograms

9. Occupant's Role 1
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify):
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify):
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify):
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify):
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify):
 (99) Unknown

11. Occupant's Posture 0
 (0) Normal posture (INTERVIEW)

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify):
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection 0
 (0) No ejection
 (1) Complete ejection
 (2) Partial ejection
 (3) Ejection, unknown degree
 (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0
 (0) No ejection
 (1) Open
 (2) Closed
 (3) Integral structure
 (9) Unknown

13. Ejection Area 0
 (0) No ejection
 (1) Windshield
 (2) Left front
 (3) Right front
 (4) Left rear
 (5) Right rear
 (6) Rear
 (7) Roof
 (8) Other area (e.g., back of pickup, etc.)
 (specify): _____
 (9) Unknown

16. Entrapment 0
 (NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)
 (0) Not entrapped
 (1) Entrapped
 (9) Unknown

14. Ejection Medium 0
 (0) No ejection
 (1) Door/hatch/tailgate
 (2) Nonfixed roof structure
 (3) Fixed glazing
 (4) Nonfixed glazing (specify): _____
 (5) Integral structure
 (8) Other medium (specify): _____
 (9) Unknown

RESTRAINT SYSTEM EVALUATION

17. Manual (Active) Belt System Availability 4

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown _____

18. Manual (Active) Belt System Use 0 1

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

19. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

20. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

21. Air Bag System Availability/Function 0

- (0) Not equipped/not available
- (1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled _____

(9) Unknown _____

22. Air Bag System Deployment 0

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

23. Are There Indications of Air Bag System Failure? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____

(9) Unknown _____

Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts

24. Police Reported Restraint Use 4

- (0) None used
- (1) Police did not indicate restraint use
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt used, type not specified
- (6) Child safety seat
- (7) Other or automatic restraint (specify): _____

(8) Restrained, type unknown _____

(9) Police indicated "unknown"

HEAD RESTRAINT AND SEAT EVALUATION

25. Head Restraint Type/Damage by Occupant at This Occupant Position

5

- (0) No head restraints
- (1) Integral—no damage
- (2) Integral—damaged during accident
- (3) Adjustable—no damage
- (4) Adjustable—damaged during accident
- (5) Add-on—no damage
- (6) Add-on—damaged during accident
- (8) Other (specify): _____
- (9) Unknown

26. Seat Type (this Occupant Position)

0 2

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

27. Seat Performance (this Occupant Position)

7

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

28. Child Safety Seat Make/Model 000
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

29. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

30. Child Safety Seat Orientation 01
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight
 (01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight
 (11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

*Unknown Design or Orientation For This
 Age/Weight, or Unknown Age/Weight*
 (21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

 (99) Unknown if child safety seat used

31. Child Safety Seat Harness Usage 00

 32. Child Safety Seat Shield Usage 00

 33. Child Safety Seat Tether Usage 00

Note: Options below applicable to
 Variables OA31-OA33.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

34. Injury Severity (Police Rating) 2

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

35. Treatment - Mortality 4

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify):

- (9) Unknown

36. Type Of Medical Facility (for Initial Treatment) 2

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

37. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

38. Working Days Lost 99

- 99 Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP - GO TO VARIABLE 44 ON PAGE 7

VARIABLES 39 THROUGH 43 ARE COMPLETED BY THE ZONE CENTER

39. Time to Death 00

- 00 Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
- (00) Not fatal
- (96) Fatal - ruled disease
- (99) Unknown

40. 1st Medically Reported Cause of Death 00

41. 2nd Medically Reported Cause of Death 00

42. 3rd Medically Reported Cause of Death 00

- _____ Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
- (00) Not fatal or no additional causes
- (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

- (97) Other result (includes fatal ruled disease) (specify):

- (99) Unknown

43. Number of Recorded Injuries for This Occupant 03

- 3 Code the actual number of injuries recorded for this occupant.
- (00) No recorded injuries
- (97) Injured, details unknown
- (99) Unknown if injured

AUTOMATIC BELT SYSTEM

44. Automatic (Passive) Belt System Availability/Function 0

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

45. Automatic (Passive) Belt System Use 0

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):

- (3) Automatic belt use unknown
- (9) Unknown

46. Automatic (Passive) Belt System Type 0

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

47. Proper Use of Automatic (Passive) Belt System 0

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):

- (8) Other improper use of automatic belt system (specify):
- (9) Unknown

48. Automatic (Passive) Belt Failure Modes During Accident 0

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):

- (6) Broken retractor
- (7) Combination of above (specify):
- (8) Other automatic belt failure (specify):

- (9) Unknown

49. Seat Orientation (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify):

- (9) Unknown

Check the Primary Source Used In Determining Belt Use.

- Not equipped/not available/destroyed or rendered inoperative
- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify):

- Unknown if belt used

ARE ALL APPLICABLE MEDICAL RECORDS INCLUDED WITH INITIAL SUBMISSION?

NO YES

UPDATE CANDIDATE?

NO YES

STOP - VARIABLES 50 THROUGH 53 ARE COMPLETED BY THE ZONE CENTER

BELT USE DETERMINATION

TRAUMA DATA

50. Glasgow Coma Scale (GCS) Score 02
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

51. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

52. Arterial Blood Gases (ABG) - HCO_3 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO_3
 (96) ABGs reported, HCO_3 unknown
 (97) Injured, details unknown
 (99) Unknown if injured

53. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>79</u>	3. Vehicle Number <u>01</u>
2. Case Number - Stratum <u>044B</u>	4. Occupant Number <u>01</u>



INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	A.I.S. - 90							Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
	Source of Injury Data	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				
1st	5. <u>7</u>	6. <u>1</u>	7. <u>9</u>	8. <u>04</u>	9. <u>02</u>	10. <u>1</u>	11. <u>1</u>	12. <u>97</u>	13. <u>9</u>	14. <u>7</u>	15. <u>99</u>
2nd	16. <u>7</u>	17. <u>7</u>	18. <u>9</u>	19. <u>06</u>	20. <u>00</u>	21. <u>1</u>	22. <u>1</u>	23. <u>91</u>	24. <u>3</u>	25. <u>3</u>	26. <u>00</u>
3rd	27. <u>7</u>	28. <u>9</u>	29. <u>9</u>	30. <u>04</u>	31. <u>00</u>	32. <u>1</u>	33. <u>0</u>	34. <u>97</u>	35. <u>9</u>	36. <u>7</u>	37. <u>99</u>
4th	38. ___	39. ___	40. ___	41. ___	42. ___	43. ___	44. ___	45. ___	46. ___	47. ___	48. ___
5th	49. ___	50. ___	51. ___	52. ___	53. ___	54. ___	55. ___	56. ___	57. ___	58. ___	59. ___
6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OFFICIAL INJURY DATA – SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

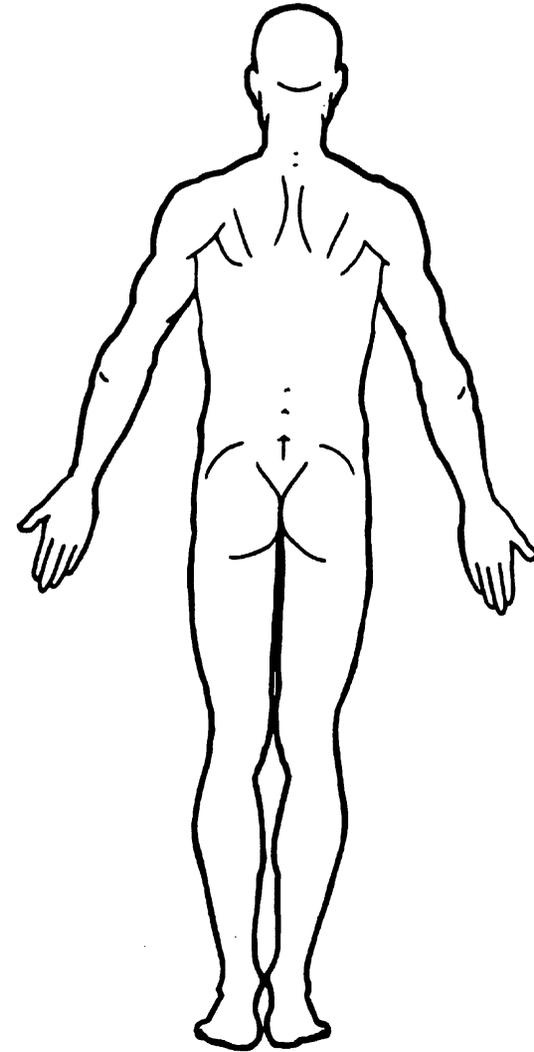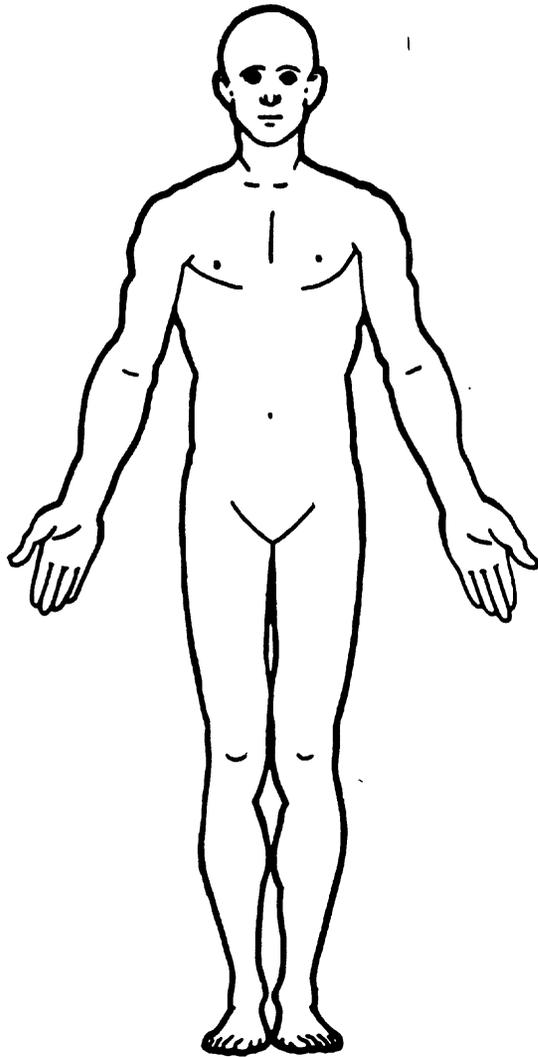

SOURCE OF INJURY DATA

OFFICIAL

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): _____
- (9) Police

INJURY SOURCE

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar
- (23) Left B-pillar
- (24) Other left pillar (specify): _____

- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____

- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____

- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (37) Other right side object (specify): _____

- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar or door frame attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)
- (46) Other occupants (specify): _____
- (47) Interior loose objects
- (48) Child safety seat (specify): _____
- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)

- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (65) Hood
- (66) Outside hardware (e.g., outside mirror, antenna)
- (67) Other exterior surface or tires (specify): _____
- (68) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (70) Front bumper
- (71) Hood edge
- (72) Other front of vehicle (specify): _____
- (73) Hood
- (74) Hood ornament
- (75) Windshield, roof rail, A-pillar
- (76) Side surface
- (77) Side mirrors
- (78) Other side protrusions (specify) _____

- (79) Rear surface
- (80) Undercarriage
- (81) Tires and wheels
- (82) Other exterior of other motor vehicle (specify): _____

- (83) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (84) Ground
- (85) Other vehicle or object (specify) _____
- (86) Unknown vehicle or object

NONCONTACT INJURY

- (90) Fire in vehicle
- (91) Flying glass
- (92) Other noncontact injury source (specify): _____
- (93) Air bag exhaust gases
- (97) Injured, unknown source

INJURY SOURCE CONFIDENCE LEVEL

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

DIRECT/INDIRECT INJURY

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

OCCUPANT INJURY CLASSIFICATION

Body Region

- (1) Head
- (2) Face
- (3) Neck
- (4) Thorax
- (5) Abdomen
- (6) Spine
- (7) Upper Extremity
- (8) Lower Extremity
- (9) Unspecified

Type of Anatomic Structure

- (1) Whole Area
- (2) Vessels
- (3) Nerves
- (4) Organs (includes muscles/ligaments)
- (5) Skeletal (includes joints)
- (6) Head - LOC
- (9) Skin

Specific Anatomic Structure

Whole Area

- (02) Skin - Abrasion
- (04) Skin - Contusion
- (06) Skin - Laceration
- (08) Skin - Avulsion
- (10) Amputation
- (20) Burn
- (30) Crush
- (40) Degloving
- (50) Injury - NFS
- (90) Trauma, other than mechanical

Head - LOC

- (02) Length of LOC
- (04, 06, 08) Level of Consciousness
- (10) Concussion

Spine

- (02) Cervical
- (04) Thoracic
- (06) Lumbar

Vessels, Nerves, Organs, Bones, Joints are assigned consecutive two digit numbers beginning with 02

Level of Injury

Specific injuries are assigned consecutive two-digit numbers beginning with 02.

To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.

Abbreviated Injury Scale

- (1) Minor injury
- (2) Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity

Aspect

- (1) Right
- (2) Left
- (3) Bilateral
- (4) Central
- (5) Anterior
- (6) Posterior
- (7) Superior
- (8) Inferior
- (9) Unknown
- (0) Whole region

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No

Yes

Blood Alcohol Level (mg/dl)

BAL = _____

Glasgow Coma Scale Score

GCSS = _____

Units of Blood Given

Units = _____

Arterial Blood Gases



pH = _____

PO₂ = _____

PCO₂ _____



HCO₃ _____

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

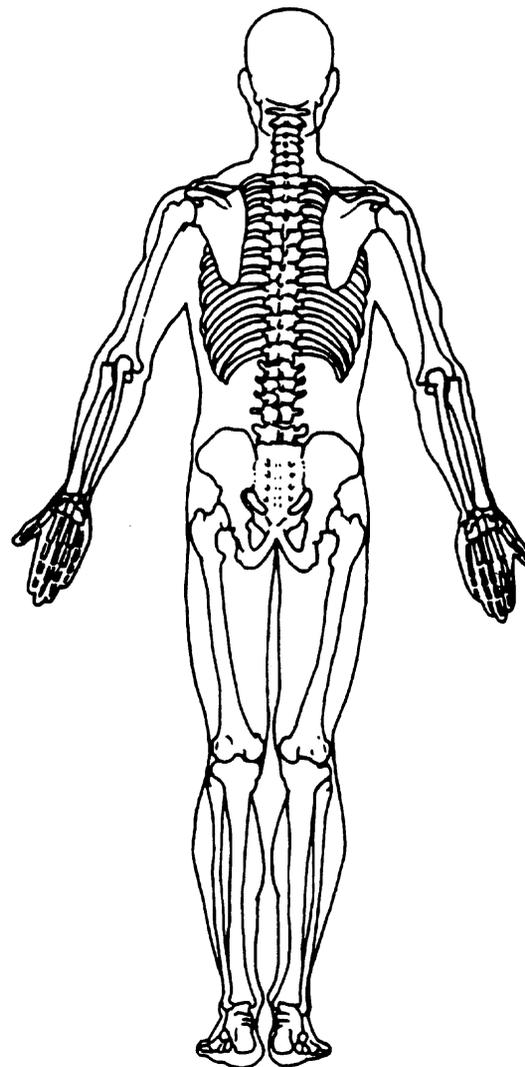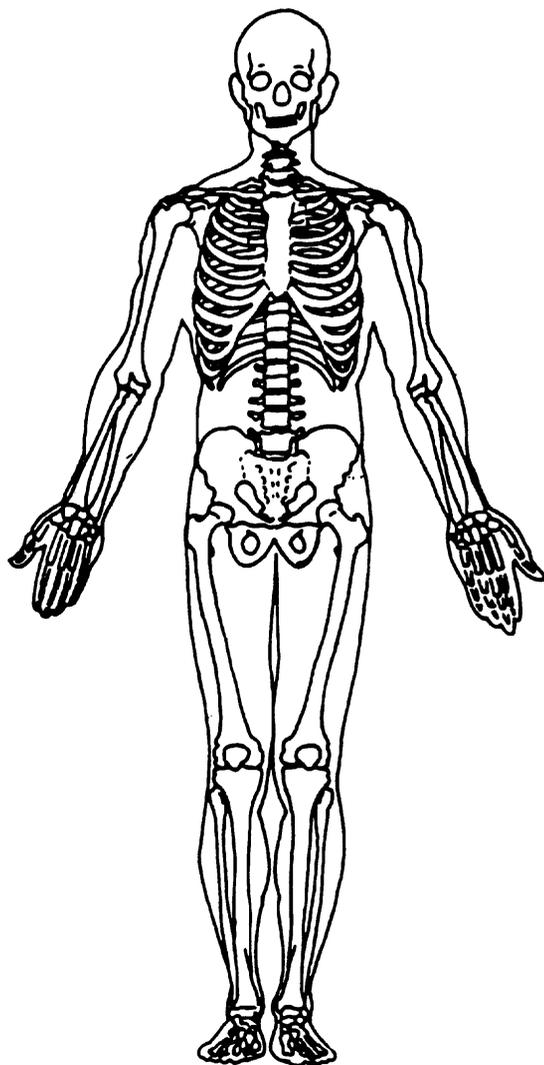

OFFICIAL INJURY DATA — INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

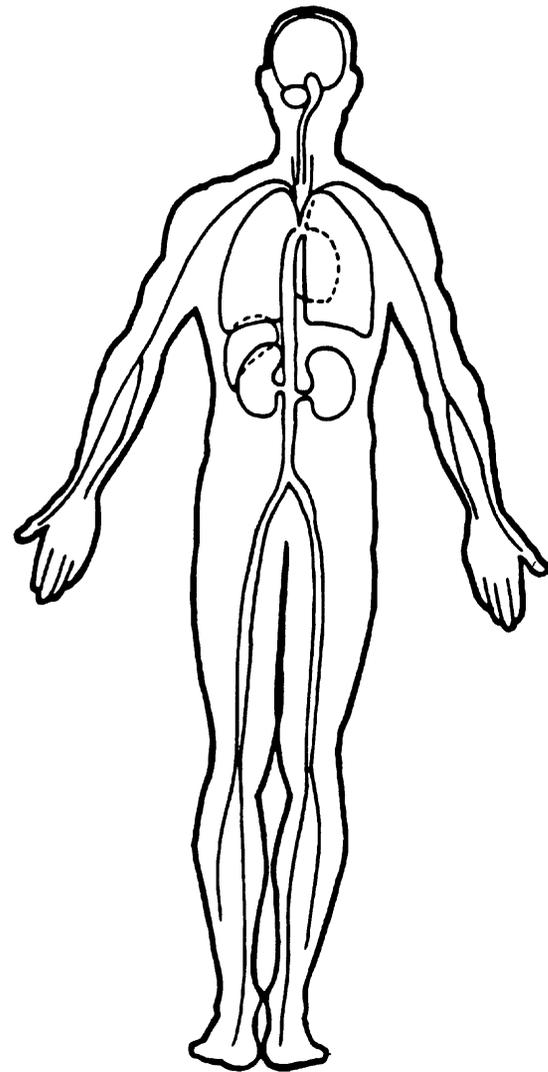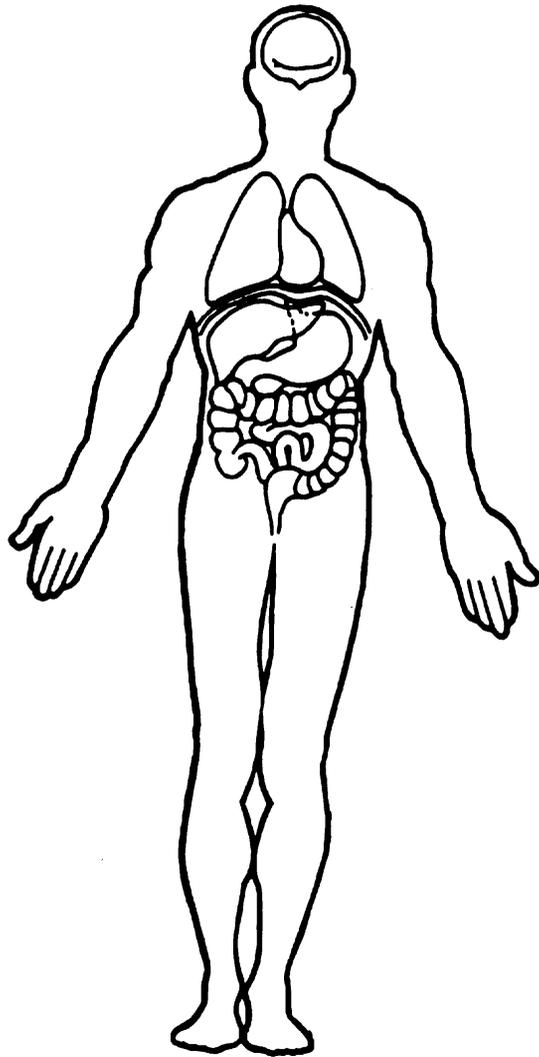

OCCUPANT RELATED

- 16. Driver Presence in Vehicle 1
 (0) Driver not present
 (1) Driver present
 (9) Unknown
- 17. Number of Occupants This Vehicle 03
 (00-96) Code actual number of occupants for this vehicle
 (97) 97 or more
 (99) Unknown
- 18. Number of Occupant Forms Submitted 03

- 24. Rollover 0
 (0) No rollover (no overturning)

Rollover (primarily about the longitudinal axis)
 (1) Rollover, 1 quarter turn only
 (2) Rollover, 2 quarter turns
 (3) Rollover, 3 quarter turns
 (4) Rollover, 4 or more quarter turns (specify):

 (5) Rollover--end-over-end (i.e., primarily about the lateral axis)
 (9) Rollover (overturn), details unknown

VEHICLE WEIGHT ITEMS

- 19. Vehicle Curb Weight 1,050
 1048 Code weight to nearest 10 kilograms.
 (045) Less than 450 kilograms
 (610) 6,100 kilograms or more
 (999) Unknown

2,310 lbs X .4536 = 1,047.8 kgs

 Source: '90 AUTO NEWS
- 20. Vehicle Cargo Weight 0,010
 Code weight to nearest 10 kilograms.
 (000) Less than 5 kilograms
 (450) 4,500 kilograms or more
 (999) Unknown

25 lbs X .4536 = 11 kgs
Book Bag Per Interview

OVERRIDE/UNDERRIDE (THIS VEHICLE)

- 25. Front Override/Underride (this Vehicle) 0
- 26. Rear Override/Underride (this Vehicle) 0

 (0) No override/underride, or not an end-to-end impact

Override (see specific CDC)
 (1) 1st CDC
 (2) 2nd CDC
 (3) Other not automated CDC (specify):

Underride (see specific CDC)
 (4) 1st CDC
 (5) 2nd CDC
 (6) Other not automated CDC (specify):

 (7) Medium/heavy truck or bus override
 (9) Unknown

RECONSTRUCTION DATA

- 21. Towed Trailing Unit 0
 (0) No towed unit
 (1) Yes--towed trailing unit
 (9) Unknown
- 22. Documentation of Trajectory Data for This Vehicle 0
 (0) No
 (1) Yes
- 23. Post Collision Condition of Tree or Pole (For Highest Delta V) 0
 (0) Not collision (for highest delta V) with tree or pole
 (1) Not damaged
 (2) Cracked/sheared
 (3) Tilted < 45 degrees
 (4) Tilted ≥ 45 degrees
 (5) Uprooted tree
 (6) Separated pole from base
 (7) Pole replaced
 (8) Other (specify):

 (9) Unknown

HEADING ANGLE AT IMPACT FOR HIGHEST DELTA V

- Values: (000)-(359) Code actual value
 (997) Noncollision
 (998) Impact with object
 (999) Unknown
- 27. Heading Angle For This Vehicle 180
 - 28. Heading Angle For Other Vehicle 270

Category	Configuration	ACCIDENT TYPES (Includes Intent)							
I Single Driver	A Right Roadside Departure	01 DRIVE OFF ROAD	02 CONTROL/ TRACTION LOSS	03 AVOID COLLISION WITH VEH.. PED.. ANIM.	04 SPECIFICS OTHER	05 SPECIFICS UNKNOWN			
	B Left Roadside Departure	06 DRIVE OFF ROAD	07 CONTROL/ TRACTION LOSS	08 AVOID COLLISION WITH VEH.. PED.. ANIM.	09 SPECIFICS OTHER	10 SPECIFICS UNKNOWN			
	C Forward Impact	11 PARKED VEH.	12 STA. OBJECT	13 PEDESTRIAN/ ANIMAL	14 END DEPARTURE	15 SPECIFICS OTHER	16 SPECIFICS UNKNOWN		
II Same Trafficway Same Direction	D Rear-End	20 STOPPED 21, 22, 23	22 SLOWER 25, 26, 27	24 DECEL. 28, 29, 31	26 AVOID COLLISION WITH VEH.	28 AVOID COLLISION WITH OBJECT	(EACH - 32) SPECIFICS OTHER	(EACH - 33) SPECIFICS UNKNOWN	
	E Forward Impact	34 CONTROL/ TRACTION LOSS	35 CONTROL/ TRACTION LOSS	36 AVOID COLLISION WITH VEH.	38 AVOID COLLISION WITH OBJECT	40 AVOID COLLISION WITH VEH.	41 AVOID COLLISION WITH OBJECT	(EACH - 42) SPECIFICS OTHER	(EACH - 43) SPECIFICS UNKNOWN
	F Sideswipe Angle	44	45	46	47	(EACH - 48) SPECIFICS OTHER	(EACH - 49) SPECIFICS UNKNOWN		
III Same Trafficway Opposite Direction	G Head-On	50 LATERAL MOVE	51 LATERAL MOVE	(EACH - 52) SPECIFICS OTHER	(EACH - 53) SPECIFICS UNKNOWN				
	H Forward Impact	54 CONTROL/ TRACTION LOSS	55 CONTROL/ TRACTION LOSS	56 AVOID COLLISION WITH VEH.	58 AVOID COLLISION WITH OBJECT	60 AVOID COLLISION WITH VEH.	61 AVOID COLLISION WITH OBJECT	(EACH - 62) SPECIFICS OTHER	(EACH - 63) SPECIFICS UNKNOWN
	I Sideswipe Angle	64 LATERAL MOVE	65 LATERAL MOVE	(EACH - 66) SPECIFICS OTHER	(EACH - 67) SPECIFICS UNKNOWN				
IV Change Trafficway Vehicle Turning	J Turn Across Path	68 INITIAL OPPOSITE DIRECTIONS	70 INITIAL SAME DIRECTIONS	71 INITIAL SAME DIRECTIONS	72 INITIAL SAME DIRECTIONS	73 INITIAL SAME DIRECTIONS	(EACH - 74) SPECIFICS OTHER	(EACH - 75) SPECIFICS UNKNOWN	
	K Turn Into Path	77 TURN INTO SAME DIRECTION	78 TURN INTO SAME DIRECTION	80 TURN INTO OPPOSITE DIRECTIONS	81 TURN INTO OPPOSITE DIRECTIONS	82 TURN INTO OPPOSITE DIRECTIONS	(EACH - 84) SPECIFICS OTHER	(EACH - 85) SPECIFICS UNKNOWN	
V Intersecting Paths (Vehicle Damage)	L Straight Paths	87	88	(EACH - 89) SPECIFICS OTHER	(EACH - 90) SPECIFICS UNKNOWN	(EACH - 91) SPECIFICS UNKNOWN			
VI Miscellaneous	M Backing Etc.	92 BACKING VEH.	93 OTHER VEH. OR OBJECT	98 Other Accident Type	99 Unknown Accident Type	00 No Impact			

OTHER DATA

56. Driver's Zip Code 91406
 (00000) Driver not present
 (00001) Driver not a resident of U.S. or territories
91406 Code actual 5-digit zip code
 (99999) Unknown
57. Driver's Race/Ethnic Origin 1
 (0) Driver not present
 (1) White (non-Hispanic)
 (2) Black (non-Hispanic)
 (3) White (Hispanic)
 (4) Black (Hispanic)
 (5) American Indian, Eskimo or Aleut
 (6) Asian or Pacific Islander
 (8) Other (specify): _____
 (9) Unknown
58. Vehicle Special Use (This Trip) 0
 (0) No special use
 (1) Taxi
 (2) Vehicle used as school bus
 (3) Vehicle used as other bus
 (4) Military
 (5) Police
 (6) Ambulance
 (7) Fire truck or car
 (8) Other (specify): _____
 (9) Unknown

ROLLOVER DATA

If GV07 (Body Type) ≠ 1-49, leave GV59-GV63 blank.
 If GV24 (Rollover) = 0, then GV59-GV63 must equal 0.
 If GV24 = 9, then GV59-GV63 must equal 9.

59. Rollover Initiation Type 0
 (0) No rollover
 (1) Trip-over
 (2) Flip-over
 (3) Turn-over
 (4) Climb-over
 (5) Fall-over
 (6) Bounce-over
 (7) Collision with another vehicle
 (8) Other rollover initiation type specify): _____
 (9) Unknown rollover initiation type
60. Location of Rollover Initiation 0
 (0) No rollover
 (1) On roadway
 (2) On shoulder—paved
 (3) On shoulder—unpaved
 (4) On roadside or divided trafficway median
 (9) Unknown

61. Rollover Initiation Object Contacted 0 0
62. Location on Vehicle Where Initial Principal Tripping Force Is Applied 0
 (0) No rollover
 (1) Wheels/tires
 (2) Side plane
 (3) End plane
 (4) Undercarriage
 (5) Other location on vehicle (specify): _____
 (8) Non-contact rollover forces (specify): _____
 (9) Unknown
63. Direction of Initial Roll 0
 (0) No rollover
 (1) Roll right - primarily about the longitudinal axis
 (2) Roll left - primarily about the longitudinal axis
 (5) End-over-end (i.e., primarily about the lateral axis)
 (9) Unknown roll direction

PRECRASH DATA

64. Pre-Event Movement (Prior to Recognition of Critical Event) 0 1
 (01) Going straight
 (02) Slowing or stopping in traffic lane
 (03) Starting in traffic lane
 (04) Stopped in traffic lane
 (05) Passing or overtaking another vehicle
 (06) Disabled or parked in travel lane
 (07) Leaving a parking position
 (08) Entering a parking position
 (09) Turning right
 (10) Turning left
 (11) Making a U-turn
 (12) Backing up (other than for parking position)
 (13) Negotiating a curve
 (14) Changing lanes
 (15) Merging
 (16) Successful avoidance maneuver to a previous critical event
 (97) Other (specify): _____
 (98) No driver present
 (99) Unknown

CODES FOR ROLLOVER INITIATION OBJECT CONTACTED

- (00) No rollover
- (01-30) — Vehicle Number

Noncollision

- (31) Turn-over — fall-over
- (33) Jackknife

Collision With Fixed Object

- (41) Tree (\leq 10 cm in diameter)
- (42) Tree ($>$ 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

- (45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (\leq 10 cm in diameter)
- (51) Pole or post ($>$ 10 cm but \leq 30 cm in diameter)
- (52) Pole or post ($>$ 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail)
(specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify): _____

- (69) Unknown fixed object

Collision with Nonfixed Object

- (71) Motor vehicle not in-transport
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify): _____

- (89) Unknown nonfixed object

- (98) Other event (specify): _____

- (99) Unknown event or object



U.S. Department of Transportation
National Highway Traffic Safety
Administration

EXTERIOR VEHICLE FORM

NATIONAL ACCIDENT SAMPLING SYSTEM
CRASHWORTHINESS DATA SYSTEM

1. Primary Sampling Unit Number	<u>79</u>	3. Vehicle Number	<u>02</u>
2. Case Number - Stratum	<u>044B</u>		

VEHICLE IDENTIFICATION

VIN 1FAPP9599LW134177 Model Year 90

Vehicle Make (specify): FORD Vehicle Model (specify): ESCORT

LOCATOR

Locate the end of the damage with respect to the vehicle longitudinal center line or bumper corner for end impacts or an undamaged axle for side impacts.

Specific Impact No.	Location of Direct Damage	Location of Field L
1	FRONT BUMPER CORNER TO BUMPER CORNER	FRONT BUMPER CORNER TO BUMPER CORNER
2	begin LF corner rear along (D) side to TRAILING EDGE LF DOOR.	(D) SIDE FRONT CORNER REAR TO REAR OF LF DOOR.
3	begins Leading Edge LR door rear (71) cm	(D) side LEADING EDGE LR DOOR TO LR BUMPER CORNER.

CRUSH PROFILE IN CENTIMETERS

NOTES: Identify the plane at which the C-measurements are taken (e.g., at bumper, above bumper, at sill, above sill, etc.) and label adjustments (e.g., free space).

Measure and document on the vehicle diagram the location of maximum crush.

Measure C1 to C6 from driver to passenger side in front or rear impacts and rear to front in side impacts.

Free space value is defined as the distance between the baseline and the original body contour taken at the individual C locations. This may include the following: bumper lead, bumper taper, side protrusion, side taper, etc. Record the value for each C-measurement and maximum crush.

Use as many lines/columns as necessary to describe each damage profile.

Specific Impact Number	Plane of Impact C-Measurements	Direct Damage		Field L	C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	±D
		Width (CDC)	Max Crush								
1	BUMPER	137	44	137	28	24	25	27	33	44	
	FREESPACE		6		6	3	0	0	3	6	
	RESULT		38@C6		22	21	25	27	30	38	0
2	HOOD/GRILL	137	41	137	39	38	37	34	32	41	
	FREESPACE		12		12	11	10	10	11	12	
	RESULT		29@C6		27	27	27	24	21	29	
	AVERAGE		38		22	21	25	27	30	38	0
3	MIDPLANE	208	40	208	4	9	4	10	11	40	
	FREESPACE		4		4	4	4	3	2	4	
	RESULT		36@C6		0	5	0	7	9	36	+66
3	NO MEAS. TAKEN	CDC ONLY ASSIGNED (NO CRUSH DUE TO IMPACT)									

SUSTAINED CONTACT
ROTATION
RESULTS
SIDE SLAP

UNK IF "C" IS ACCURATE DUE TO FRONT SHIPT

(NON HORIZONTAL FORCE) ← AND ←

ORIGINAL SPECIFICATIONS WORK SHEET


Wheelbase	<u> 94.2 </u> inches	x 2.54	=	<u> 239.2 </u> cm
Overall Length	<u> 169.4 </u> inches	x 2.54	=	<u> 430.2 </u> cm
Maximum Width	<u> 65.9 </u> inches	x 2.54	=	<u> 167.3 </u> cm
Curb Weight	<u> 2,310 </u> pounds	x .4536	=	<u> 1,047.8 </u> kg
Average Track	<u> 55.4 </u> inches	x 2.54	=	<u> 140.7 </u> cm
Front Overhang	<u> — — — </u> inches	x 2.54	=	<u> — — — </u> cm
Rear Overhang	<u> — — — </u> inches	x 2.54	=	<u> — — — </u> cm
Undeformed End Width	<u> — — — </u> inches	x 2.54	=	<u> — — — </u> cm
Engine Size: cyl./displ.	<u> I-4 — — </u> cc	x .001	=	<u> 1.9 </u> L
	<u> — — — </u> CID	x .0164	=	<u> — — </u> L

54.7

56.0

VEHICLE DAMAGE SKETCH

<p>TIRE—WHEEL DAMAGE</p> <p>a. Rotation physically restricted</p> <p>RF <u>2</u> LF <u>2</u> RR <u>2</u> LR <u>2</u></p> <p>b. Tire deflated</p> <p>RF <u>0</u> LF <u>0</u> RR <u>0</u> LR <u>0</u></p> <p>(1) Yes (2) No (8) NA (9) Unk.</p>	<p>ORIGINAL SPECIFICATIONS</p> <p>Wheelbase <u>239</u> cm</p> <p>Overall Length <u>430</u> cm</p> <p>Maximum Width <u>167</u> cm</p> <p>Curb Weight <u>1048</u> kg</p> <p>Average Track <u>141</u> cm</p> <p>Front Overhang <u>90</u> cm</p> <p>Rear Overhang <u>98</u> cm</p> <p>Undeformed End Width <u>154</u> cm</p> <p>Engine Size: cyl./displ. <u>4 cyl / 1.9</u> L</p>	<p>WHEEL STEER ANGLES (For locked front wheels or displaced rear axles only)</p> <p>RF ± <u> </u> ° LF ± <u> </u> ° RR ± <u> </u> ° LR ± <u> </u> °</p> <p>Within ± 5 degrees</p>
<p>TYPE OF TRANSMISSION</p> <p><input checked="" type="checkbox"/> Manual <input type="checkbox"/> Automatic</p>		<p>DRIVE WHEELS</p> <p><input checked="" type="checkbox"/> FWD <input type="checkbox"/> RWD <input type="checkbox"/> 4WD</p>
		<p>Approximate Cargo Weight <u> </u> kg</p>

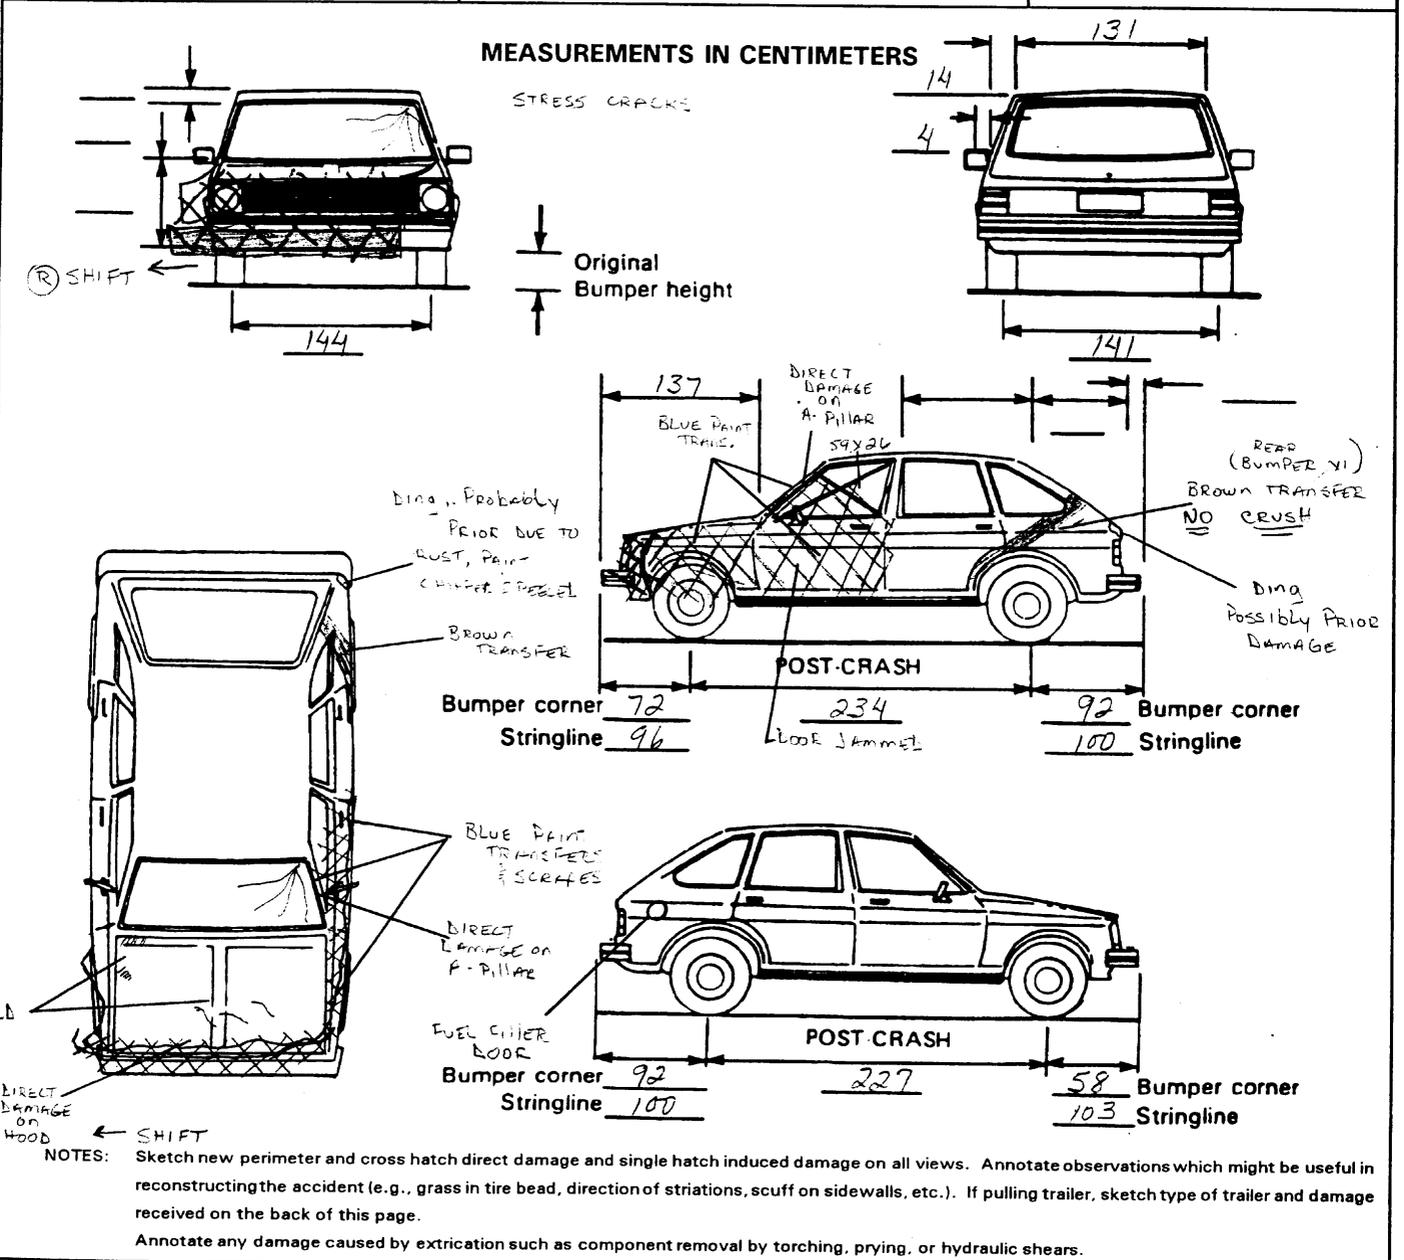

CDC WORKSHEET

CODES FOR OBJECT CONTACTED

(01-30) – Vehicle Number

Noncollision

- (31) Overturn – rollover
- (32) Fire or explosion
- (33) Jackknife
- (34) Other intraunit damage (specify): _____

- (35) Noncollision injury
- (38) Other noncollision (specify): _____

(39) Noncollision – details unknown

Collision With Fixed Object

- (41) Tree (≤ 10 cm in diameter)
- (42) Tree (> 10 cm in diameter)
- (43) Shrubbery or bush
- (44) Embankment

(45) Breakaway pole or post (any diameter)

Nonbreakaway Pole or Post

- (50) Pole or post (≤ 10 cm in diameter)
- (51) Pole or post (> 10 cm but ≤ 30 cm in diameter)
- (52) Pole or post (> 30 cm in diameter)
- (53) Pole or post (diameter unknown)

- (54) Concrete traffic barrier
- (55) Impact attenuator
- (56) Other traffic barrier (includes guardrail) (specify): _____

- (57) Fence
- (58) Wall
- (59) Building
- (60) Ditch or culvert
- (61) Ground
- (62) Fire hydrant
- (63) Curb
- (64) Bridge
- (68) Other fixed object (specify): _____
- (69) Unknown fixed object

Collision with Nonfixed Object

- (71) Motor vehicle not in-transport
- (72) Pedestrian
- (73) Cyclist or cycle
- (74) Other nonmotorist or conveyance

- (75) Vehicle occupant
- (76) Animal
- (77) Train
- (78) Trailer, disconnected in transport
- (79) Object fell from vehicle in-transport
- (88) Other nonfixed object (specify): _____

(89) Unknown nonfixed object

(98) Other event (specify): _____

(99) Unknown event or object

DEFORMATION CLASSIFICATION BY EVENT NUMBER

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force (degrees)	Incremental Value of Shift	(3) Deformation Location	(4) Specific Longitudinal or Lateral Location	(5) Specific Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
01	01	320 340	60	F	Δ	E	W	02
0	01	350	ROTATION & SIDE SLAP WITH V1 →	L	Y	A	W	03
02	01	000	NON HORIZONTAL FORCE	L	Z	A	W	01
---	---	---	---	---	---	---	---	---
---	---	---	---	---	---	---	---	---
---	---	---	---	---	---	---	---	---
---	F	01	27	2	55	3 82	---	---
---	---	0	27.4	---	54.8	82.2	---	---
---	L	0	4	18	44.2	---	---	---

COLLISION DEFORMATION CLASSIFICATION

HIGHEST DELTA "V"

Accident Event Sequence Number	Object Contacted	(1) (2) Direction of Force	(3) Deformation Location	(4) Longitudinal or Lateral Location	(5) Vertical or Lateral Location	(6) Type of Damage Distribution	(7) Deformation Extent
4. <u>01</u>	5. <u>01</u>	6. <u>FF</u> <u>71</u>	7. <u>F</u>	8. <u>D</u>	9. <u>E</u>	10. <u>W</u>	11. <u>02</u>

Second Highest Delta "V"

12. <u>02</u>	13. <u>01</u>	14. <u>00</u>	15. <u>L</u>	16. <u>Z</u> <u>X</u>	17. <u>A</u>	18. <u>W</u>	19. <u>03</u> <u>01</u>
---------------	---------------	---------------	--------------	--------------------------	--------------	--------------	----------------------------

nor HORIZONTAL FORCE

CRUSH PROFILE IN CENTIMETERS

The crush profile for the damage described in the CDC(s) above should be documented in the appropriate space below. (ALL MEASUREMENTS ARE IN CENTIMETERS.)

HIGHEST DELTA "V"

20. L	21. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	22. ±D
<u>154</u>	<u>022</u>	<u>021</u>	<u>025</u>	<u>027</u>	<u>030</u>	<u>038</u>	<u>+ 000</u>

Second Highest Delta "V"

23. L	24. C ₁	C ₂	C ₃	C ₄	C ₅	C ₆	25. ±D
<u>---</u>	<u>---</u>	<u>---</u>	<u>---</u>	<u>---</u>	<u>---</u>	<u>---</u>	<u>+ 000</u>

non HORIZONTAL FORCE
no C MEAS TAKEN

26. Are CDCs Documented but Not Coded on The Automated File? 1
(0) No
(1) Yes

27. Researcher's Assessment of Vehicle Disposition 1
(0) Not towed due to vehicle damage
(1) Towed due to vehicle damage
(9) Unknown

28. Original Wheelbase 239 Code to the nearest centimeter
239 (999) Unknown

94.2 inches X 2.54 = 239.2 centimeters

<p>29. Is This A Multi-Stage Manufactured Vehicle And/Or A Certified Altered Vehicle? <u>0</u></p> <p>(0) No post manufacturer modifications (1) Yes - post manufacturer modifications (specify): _____</p> <p>_____ _____ (Include photograph of CERTIFICATION PLACARD in case report)</p> <p>(9) Unknown if vehicle is modified</p>	<p>34. Fuel Tank-1 Location <u>4</u></p> <p>35. Fuel Tank-2 Location <u>0</u></p> <p>(0) No fuel tank (1) Aft of center of the rear wheels (rear axle) centered (2) Aft of center of the rear wheels (rear axle) left side (3) Aft of center of the rear wheels (rear axle) right side (4) Forward of center of the rear wheels (rear axle) centered (5) Forward of center of the rear wheels (rear axle) left side (6) Forward of center of the rear wheels (rear axle) right side (7) Over center of the rear wheels (rear axle) (8) Other (specify): _____ (9) Unknown</p>
<p>30. Fire Occurrence <u>0</u></p> <p>(0) No fire</p> <p>Yes, fire occurred (1) Minor (2) Major (9) Unknown</p>	<p>36. Fuel Tank-1 Filler Cap Location <u>3</u></p> <p>37. Fuel Tank-2 Filler Cap Location <u>0</u></p> <p>(0) No fuel tank (1) On back plane (2) Aft of center of the rear wheels (rear axle) on left side plane (3) Aft of center of the rear wheels (rear axle) on right side plane (4) Forward of center of the rear wheels (rear axle) on left side plane (5) Forward of center of the rear wheels (rear axle) on right side plane (6) Over the center of the rear wheels (rear axle) on left side plane (7) Over the center of the rear wheels (rear axle) on right side plane (8) Other (specify): _____ (9) Unknown</p>
<p>31. Origin of Fire <u>0</u></p> <p>(0) No fire (1) Vehicle exterior (front, side, back, top) (2) Exhaust system (3) Fuel tank (and other fuel retention system parts) (4) Engine compartment (5) Cargo/trunk compartment (6) Instrument panel (7) Passenger compartment area (8) Other location (specify): _____ (9) Unknown</p>	<p>38. Fuel Tank-1 Damage <u>1</u></p> <p>39. Fuel Tank-2 Damage <u>0</u></p> <p>(0) No fuel tank (1) No damage to fuel tank (2) Deformed, no seam failure (3) Deformed, with a seam failure (4) Punctured (5) Lacerated (ripped) (6) Abraded (scraped) (7) Filler neck separation from the fuel tank (8) Other damage (specify): _____ (9) Unknown</p>
<p>32. Type of Fuel Tank-1 <u>1</u></p> <p>33. Type of Fuel Tank-2 <u>0</u></p> <p>(0) No fuel tank (electrical vehicle) (1) Metallic (2) Non-metallic (9) Unknown</p>	

40. Location of Fuel System-1 Leakage 1
 41. Location of Fuel System-2 Leakage 0
 (0) No fuel tank
 (1) No fuel leakage
Primary Area Of Leakage
 (2) Tank
 (3) Filler neck
 (4) Cap
 (5) Lines/pump/filter
 (6) Vent/emission recovery
 (8) Other (specify): _____
 (9) Unknown _____

42. Fuel Type-1 0 1
 43. Fuel Type-2 0 0

Single Fuel Type
 (00) No fuel tank
 (01) Gasoline
 (02) Diesel
 (03) CNG (Compressed Natural Gas)
 (04) LPG (Liquid Petroleum Gas) also known as Propane
 (05) LNG (Liquid Natural Gas)
 (06) Methanol (M100 or M85)
 (07) Ethanol (E100 or E85)
 (08) Other (Hydrogen or others) (specify): _____

Electric Powered or Electric/Solar Powered Vehicles
 (10) Lead Acid Battery
 (11) Nickel-Iron Battery
 (12) Nickel-Cadmium Battery
 (13) Sodium Metal Chloride Battery
 (14) Sodium Sulfur Battery
 (18) Other (Specify): _____
 (98) Other Hybrid (specify): _____
 (99) Unknown fuel type

44. Is This Vehicle Equipped With More Than Two Fuel Tanks? 0
 (0) No (one or two tanks only)
Yes - More Than Two Tanks
 (1) Yes -- no damage to any tank or filler cap and no fuel system leakage
 (2) Yes -- no damage to any tank or filler cap but there is fuel system leakage (specify leakage location): _____
 (3) Yes -- damage to an additional tank or filler cap and there is fuel system leakage (specify the following):
 Type of tank _____
 Tank location _____
 Filler cap location _____
 Tank damage _____
 Location of leakage _____
 Type of fuel _____
 (9) Unknown if more than two tanks

COMMENTS

*** STOP: IF THE CDS APPLICABLE VEHICLE WAS NOT TOWED AND WAS NOT AN AOPS ***
 (I.E., GV09=0 OR 9 AND GV36=0), DO NOT COMPLETE THE INTERIOR VEHICLE FORM.



INTERIOR VEHICLE FORM

1. Primary Sampling Unit Number 79
 2. Case Number - Stratum 044B
 3. Vehicle Number 02

INTEGRITY

4. Passenger Compartment Integrity 06
 (00) No integrity loss

Yes, Integrity Was Lost Through

- (01) Windshield
- (02) Door (side)
- (03) Door/hatch (back door)
- (04) Roof
- (05) Roof glass
- (06) Side window (LF)
- (07) Rear window (backlight)
- (08) Roof and roof glass
- (09) Windshield and door (side)
- (10) Windshield and roof
- (11) Side and rear window (side window and backlight)
- (12) Windshield and side window
- (13) Door and side window
- (98) Other combination of above (specify):
HATCH/SIDE WINDOW
- (99) Unknown

Door, Tailgate or Hatch Opening

5. LF 3 6. RF 1 7. LR 1 8. RR 1 9. TG/H 2

- (0) No door/gate/hatch
- (1) Door/gate/hatch remained closed and operational
- (2) Door/gate/hatch came open during collision
- (3) Door/gate/hatch jammed shut
- (8) Other (specify): _____
- (9) Unknown

Damage/Failure Associated with Door, Tailgate or Hatch Opening in Collision. If IV05-IV09 ≠ 2, Then code 0 9

10. LF 0 11. RF 0 12. LR 0 13. RR 0 14. TG/H 0

- (0) No door/gate/hatch or door not opened

Door, Tailgate or Hatch Came Open During Collision

- (1) Door operational (no damage)
- (2) Latch/striker failure due to damage
- (3) Hinge failure due to damage
- (4) Door structure failure due to damage
- (5) Door support (i.e., pillar, sill, roof side rail, etc.) failure due to damage
- (6) Latch/striker and hinge failure due to damage
- (8) Other failure (specify): _____
- (9) Unknown

GLAZING

Glazing Damage from Impact Forces

15. WS 2 16. LF 6 17. RF 0 18. LR 0 19. RR 0
 20. BL 0 21. Roof 8 22. Other 0

- (0) No glazing damage from impact forces
- (2) Glazing in place and cracked from impact forces
- (3) Glazing in place and holed from impact forces
- (4) Glazing out-of-place (cracked or not) and not holed from impact forces
- (5) Glazing out-of-place and holed from impact forces
- (6) Glazing disintegrated from impact forces
- (7) Glazing removed prior to accident
- (8) No glazing
- (9) Unknown if damaged

Glazing Damage from Occupant Contact

23. WS 0 24. LF 2 25. RF 0 26. LR 0 27. RR 0
 28. BL 0 29. Roof 0 30. Other 0

- (0) No occupant contact to glazing or no glazing
- (1) Glazing contacted by occupant but no glazing damage
- (2) Glazing in place and cracked by occupant contact
- (3) Glazing in place and holed by occupant contact
- (4) Glazing out-of-place (cracked or not) by occupant contact and not holed by occupant contact
- (5) Glazing out-of-place by occupant contact and holed by occupant contact
- (6) Glazing disintegrated by occupant contact
- (9) Unknown if contacted by occupant

If No Glazing Damage *And* No Occupant Contact or No Glazing, Then Code IV31 Through IV46 As 0

Type of Window/Windshield Glazing

31. WS 1 32. LF 2 33. RF 0 34. LR 0 35. RR 0
 36. BL 0 37. Roof 0 38. Other 0

- (0) No glazing contact and no damage, or no glazing
- (1) AS-1 - Laminated
- (2) AS-2 - Tempered
- (3) AS-3 - Tempered-tinted
- (4) AS-14 - Glass/Plastic
- (8) Other (specify): _____
- (9) Unknown

Window Precrash Glazing Status

39. WS 1 40. LF 2 41. RF 0 42. LR 0 43. RR 0
 44. BL 0 45. Roof 0 46. Other 0

- (0) No glazing contact and no damage, or no glazing
- (1) Fixed
- (2) Closed
- (3) Partially opened
- (4) Fully opened
- (9) Unknown

OCCUPANT AREA INTRUSION

Note: If no intrusions, leave variables IV47-IV86 blank.

	Location of Intrusion	Intruding Component	Magnitude of Intrusion	Dominant Crush Direction
1st	47. _____	48. _____	49. _____	50. _____
2nd	51. _____	52. _____	53. _____	54. _____
3rd	55. _____	56. _____	57. _____	58. _____
4th	59. _____	60. _____	61. _____	62. _____
5th	63. _____	64. _____	65. _____	66. _____
6th	67. _____	68. _____	69. _____	70. _____
7th	71. _____	72. _____	73. _____	74. _____
8th	75. _____	76. _____	77. _____	78. _____
9th	79. _____	80. _____	81. _____	82. _____
10th	83. _____	84. _____	85. _____	86. _____

INTRUDING COMPONENT

Interior Components

- (01) Steering assembly
- (02) Instrument panel left
- (03) Instrument panel center
- (04) Instrument panel right
- (05) Toe pan
- (06) A (A1/A2)-pillar
- (07) B-pillar
- (08) C-pillar
- (09) D-pillar
- (10) Door panel (side)
- (12) Roof (or convertible top)
- (13) Roof side rail
- (14) Windshield
- (15) Windshield header
- (16) Window frame
- (17) Floor pan (includes sill)
- (18) Backlight header
- (19) Front seat back
- (20) Second seat back
- (21) Third seat back
- (22) Fourth seat back
- (23) Fifth seat back
- (24) Seat cushion
- (25) Back door/panel (e.g., tailgate)
- (26) Other interior component (specify): _____

- (27) Side panel - forward of the A (A2)-pillar
- (28) Side panel - rear of the A (A2)-pillar

Exterior Components

- (30) Hood
- (31) Outside surface of this vehicle (specify): _____
- (32) Other exterior object in the environment (specify): _____
- (33) Unknown exterior object
- (97) Catastrophic
- (98) Intrusion of unlisted component(s) (specify): _____
- (99) Unknown

LOCATION OF INTRUSION

- Front Seat**
- (11) Left
 - (12) Middle
 - (13) Right

- Second Seat**
- (21) Left
 - (22) Middle
 - (23) Right

- Third Seat**
- (31) Left
 - (32) Middle
 - (33) Right

- Fourth Seat**
- (41) Left
 - (42) Middle
 - (43) Right

- (97) Catastrophic
- (98) Other enclosed area (specify) _____

- (99) Unknown

MAGNITUDE OF INTRUSION

- (1) ≥ 3 centimeters but < 8 centimeters
- (2) ≥ 8 centimeters but < 15 centimeters
- (3) ≥ 15 centimeters but < 30 centimeters
- (4) ≥ 30 centimeters but < 46 centimeters
- (5) ≥ 46 centimeters but < 61 centimeters
- (6) ≥ 61 centimeters
- (7) Catastrophic
- (9) Unknown

DOMINANT CRUSH DIRECTION

- (1) Vertical
- (2) Longitudinal
- (3) Lateral
- (7) Catastrophic
- (9) Unknown

STEERING RIM/SPOKE DEFORMATION

(All Measurements Are in Centimeters)

COMPARISON VALUE - DAMAGE VALUE = DEFORMATION

-

=

-

=

-

=

-

=

STEERING COLUMN

87. Steering Column Type 2
 (1) Fixed column
 (2) Tilt column
 (3) Telescoping column
 (4) Tilt and telescoping column
 (8) Other column type (specify): _____
 (9) Unknown

88. Blank X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

89. Blank X X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

90. Blank X X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

91. Blank X X X
 (This variable is left blank so that numbering consistency can be maintained with the 1988-94 CDS.)

92. Steering Rim/Spoke Deformation 0 0
 _____ Code actual measured deformation to the nearest centimeter
 (00) No steering rim deformation
 (01-14) Actual measured value in centimeters
 (15) 15 centimeters or more
 (98) Observed deformation cannot be measured
 (99) Unknown

93. Location of Steering Rim/Spoke Deformation 0 0
 (00) No steering rim deformation

Quarter Sections
 (01) Section A
 (02) Section B
 (03) Section C
 (04) Section D



Half Sections
 (05) Upper half of rim/spoke
 (06) Lower half of rim/spoke
 (07) Left half of rim/spoke
 (08) Right half of rim/spoke




(09) Complete steering wheel collapse
 (10) Undetermined location
 (99) Unknown

INSTRUMENT PANEL

94. Odometer Reading 0 9 6,000
96460 kilometers—Code to the nearest 1,000 kilometers
 (000) No odometer
 (001) Less than 1,500 kilometers
 (500) 499,500 kilometers or more
 (999) Unknown

59,939 miles X 1.6093 = 96,459.8 kilometers

Source: ODOMETER INSPECTION

95. Instrument Panel Damage from Occupant Contact? 0
 (0) No
 (1) Yes
 (9) Unknown


*CLOTH TRANS. SW
 NO DAMAGE
 CRACKS/BOOTS
 ETC.*

96. Knee Bolsters Deformed from Occupant Contact? 8
 (0) No
 (1) Yes
 (8) Not present
 (9) Unknown

97. Did Glove Compartment Door Open During Collision(s)? 0
 (0) No
 (1) Yes
 (8) Not present
 (9) Unknown

VEHICLE INTERIOR SKETCHES

Note area of ejection/entrapment

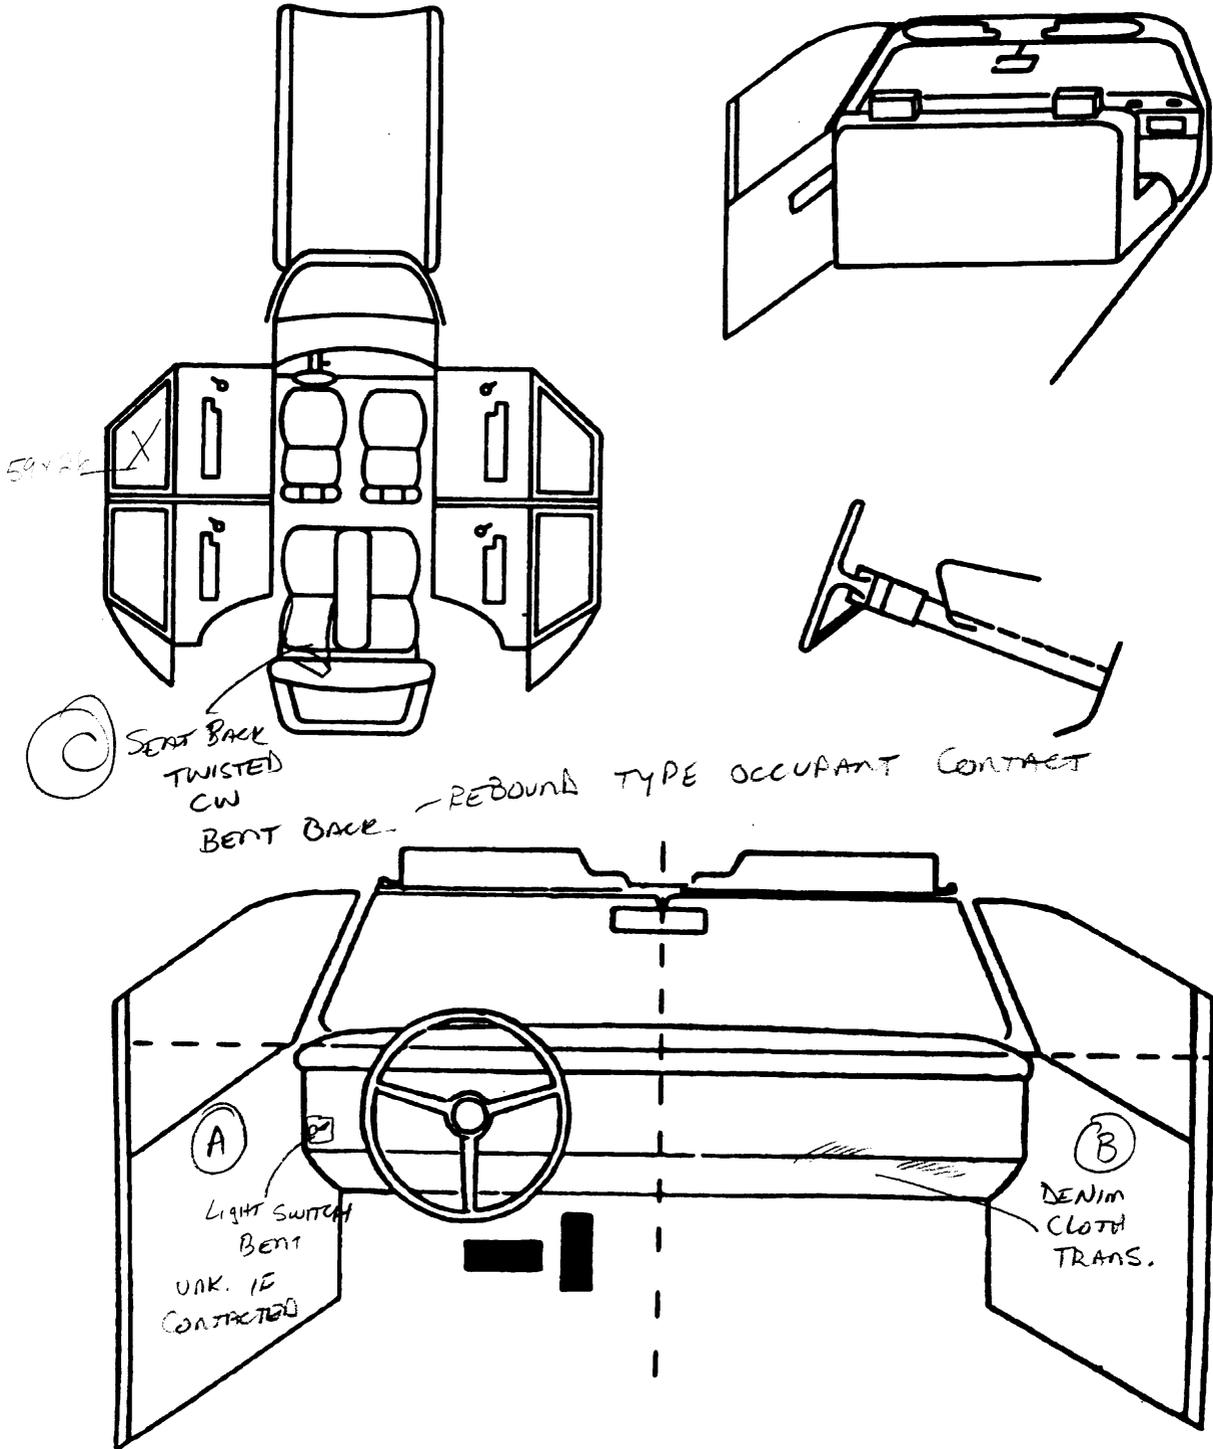

Sketch windshield contact(s) and the damaged area(s) on the instrument panel outline (e.g., radio, glove compartment, damage to instrument panel structure).
 Cross hatch contact points, draw spider webs or use other annotation as may be appropriate.
 Annotate the contacted area with a letter (begin with A) and list on the Points of Occupant Contact page.

POINTS OF OCCUPANT CONTACT

Contact	Interior Component Contacted	Occupant No. If Known	Body Region If Known	Supporting Physical Evidence	Confidence Level of Contact Point
A	09	1	L KNEE	BELT LIGHT SWITCH	2
B	11	2	KNEES	DENIM CLOTH TRASPERS	1
C	40	3	BACK	TWISTED SEAT BACK	1
D					
E					
F					
G					
H					
I					
J					
K					
L					
M					
N					

CODES FOR INTERIOR COMPONENTS

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar

- (23) Left B-pillar
- (24) Other left pillar (specify): _____
- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____
- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____
- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B pillar, or roof side rail.
- (37) Other right side object (specify): _____
- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)

- (46) Other occupants (specify): _____
- (47) Interior loose objects
- (48) Child safety seat (specify): _____
- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)
- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

CONFIDENCE LEVEL OF CONTACT POINT

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

AUTOMATIC RESTRAINTS

NOTES: Encode the data for each applicable front seat position. The attribute for the variables may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

AIR BAGS

		Left	Right
F I R S T	Availability/Function	/	/
	Deployment	/	/
	Failure	/	/

Air Bag System Availability/Function

- (0) Not equipped/not available
- (1) Air bag

Non-functional

- (2) Air bag disconnected (specify): _____
- (3) Air bag not reinstalled
- (9) Unknown

Air Bag System Deployment

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

Are There Indications of Air Bag System Failure?

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____
- (9) Unknown

AUTOMATIC BELTS

		Left	Right
F I R S T	Availability/Function	1	1
	Use	1	1
	Type	2	2
	Proper Use	1	1
	Failure Modes	1	1

Automatic (Passive) Belt System Availability/Function

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

Automatic (Passive) Belt System Use

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative)
- (3) Automatic belt use unknown
- (9) Unknown

Automatic (Passive) Belt System Type

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

Proper Use of Automatic (Passive) Belt System

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of automatic belt system (specify): _____
- (9) Unknown

Automatic (Passive) Belt Failure Modes During Accident

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

MANUAL RESTRAINTS

NOTES: Encode the applicable data for each seat position in the vehicle. The attribute for the variable may be found below. Restraint systems should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

If a Child safety seat is present, encode the data on the back of this page.

If the vehicle has automatic restraints available, encode the appropriate data on the back of the previous page.

		Left	Center	Right
FIRST	Availability	3	0	3
	Evidence of usage	00	0	03
	Used in this crash?	0	0	03
	Proper Use	0	0	1
	Failure Modes	0	*	1
SECOND	Availability	4 ←	2 PIECE SYSTEM	→ 4
	Evidence of usage	LAP=03 / SHOULDER=00	? SEPARATE BELTS	LAP=03 / SHOULDER=00
	Used in this crash?	0	EACH BELT HAS	0
	Proper Use	0	(I.E. LAP & SHOULDER)	0
	Failure Modes	0	HS OWN BUCKLE	0
OTHER	Availability			
	Evidence of usage			
	Used in this crash?			
	Proper Use			
	Failure Modes			

* NO MID REAR (SECOND SEAT) RESTRAINT

Manual (Active) Belt System Availability

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available - type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)
- (8) Other belt (specify): _____
- (9) Unknown

Manual (Active) Belt System Use

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperable (specify): _____
- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used - type unknown
- (08) Other belt used (specify): _____
- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat - type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

Proper Use of Manual (Active) Belts

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____
- (8) Other improper use of manual belt system (specify): _____
- (9) Unknown

Manual (Active) Belt Failure Modes During Accident

- (0) No manual belt used or not available
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other manual belt failure (specify): _____
- (9) Unknown

CHILD SAFETY SEAT FIELD ASSESSMENT

When a child safety seat is present enter the occupant's number in the first row and complete the column below the occupant's number using the codes listed below. Complete a column for each child safety seat present.

Occupant Number						
1. Type of Child Safety Seat						
2. Child Safety Seat Orientation						
3. Child Safety Seat Harness Usage						
4. Child Safety Seat Shield Usage						
5. Child Safety Seat Tether Usage						
6. Child Safety Seat Make/Model	Specify Below for Each Child Safety Seat					

1. Type of Child Safety Seat
 - (0) No child safety seat
 - (1) Infant seat
 - (2) Toddler seat
 - (3) Convertible seat
 - (4) Booster seat
 - (7) Other type child safety seat (specify): _____
 - (8) Unknown child safety seat type
 - (9) Unknown if child safety seat used

2. Child Safety Seat Orientation
 - (00) No child safety seat
 - Designed for Rear Facing for This Age/Weight
 - (01) Rear facing
 - (02) Forward facing
 - (08) Other orientation (specify): _____
 - (09) Unknown orientation
 - Designed for Forward Facing for This Age/Weight
 - (11) Rear facing
 - (12) Forward facing
 - (18) Other orientation (specify): _____
 - (19) Unknown orientation
 - Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight
 - (21) Rear facing
 - (22) Forward facing
 - (28) Other orientation (specify): _____
 - (29) Unknown orientation
 - (99) Unknown if child safety seat used

3. Child Safety Seat Harness Usage
4. Child Safety Seat Shield Usage
5. Child Safety Seat Tether Usage
 - Note: Options Below Are Used for Variables 3-5.
 - (00) No child safety seat
 - Not Designed with Harness/Shield/Tether
 - (01) After market harness/shield/tether added, not used
 - (02) After market harness/shield/tether used
 - (03) Child safety seat used, but no after market harness/shield/tether added
 - (09) Unknown if harness/shield/tether added or used
 - Designed With Harness/Shield/Tether
 - (11) Harness/shield/tether not used
 - (12) Harness/shield/tether used
 - (19) Unknown if harness/shield/tether used
 - Unknown If Designed With Harness/Shield/Tether
 - (21) Harness/shield/tether not used
 - (22) Harness/shield/tether used
 - (29) Unknown if harness/shield/tether used
 - (99) Unknown if child safety seat used
6. Child Safety Seat Make/Model (Specify make/model and occupant number)

HEAD RESTRAINTS/SEAT EVALUATION

NOTES: Encode the applicable data for **each seat position** in the vehicle. The attribute for these variables may be found at the bottom of the page. Head restraint type/damage and seat type/performance should be assessed during the vehicle inspection then coded on the Occupant Assessment Form.

		Left	Center	Right
F I R S T	Head Restraint Type/Damage	3	0	3
	Seat Type	01	0	01
	Seat Performance	1	0	1
	Seat Orientation	1	0	1
S E C O N D	Head Restraint Type/Damage	0	0	0
	Seat Type	07	07	07
	Seat Performance	5	1	1
	Seat Orientation	1	1	1
T H I R D	Head Restraint Type/Damage	/	/	/
	Seat Type	/	/	/
	Seat Performance	/	/	/
	Seat Orientation	/	/	/
O T H E R	Head Restraint Type/Damage	/	/	/
	Seat Type	/	/	/
	Seat Performance	/	/	/
	Seat Orientation	/	/	/

Head Restraint Type/Damage by Occupant at This Occupant Position

- (0) No head restraints
- (1) Integral – no damage
- (2) Integral – damaged during accident
- (3) Adjustable – no damage
- (4) Adjustable – damaged during accident
- (5) Add-on – no damage
- (6) Add-on – damaged during accident
- (8) Other Specify: _____
- (9) Unknown

Seat Type (this Occupant Position)

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

Seat Performance (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed specify: _____
- (4) Seat tracks/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

Seat Orientation (this Occupant Position)

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

DESCRIBE ANY INDICATION OF ABNORMAL OCCUPANT POSTURE (I.E., UNUSUAL OCCUPANT CONTACT PATTERN)

EJECTION/ENTRAPMENT DATA

Complete the following if the researcher has any indication that an occupant was either ejected from or entrapped in the vehicle. Code the appropriate data on the Occupant Assessment Form.

EJECTION No [] Yes [X]

Describe indications of ejection and body parts involved in partial ejection(s):

① REAR OCCUPANT EJECTED DURING VEH POST IMPACT ROTATION.
 UNK EJECTION AREA / MEDIUM - POSSIBLY THRU BACK
 HATCH. DRIVER REPORTED PASSENGER WAS WEARING
 LAP/SHOULDER BELT... BUT INSPECTION SHOWED
 NO RESTRAINT USE. PASSENGER WAS FATAL @ SCENE.

Occupant Number	3					
Ejection	1					
(Note on Vehicle Interior Sketch) Ejection Area	unknown 9					
Ejection Medium	9					
Medium Status	9					

Ejection

- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, Unknown degree
- (9) Unknown

Ejection Area

- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear

(7) Roof

(8) Other area (e.g., back of pickup, etc.) (specify):

(9) Unknown

Ejection Medium

- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify):

(5) Integral structure

(8) Other medium (specify):

(9) Unknown

Medium Status (Immediately Prior to Impact)

- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

ENTRAPMENT No [X] Yes []

Describe entrapment mechanism: _____

Component(s): _____

(Note in vehicle interior diagram)



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 79
 2. Case Number - Stratum 044B
 3. Vehicle Number 02
 4. Occupant Number 01

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 19
 Code actual age at time of accident.
 (00) Less than one year old (specify by month):
 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 1
 (1) Male
 (2) Female
 (9) Unknown

7. Occupant's Height (INTERVIEW) 178
 Code actual height to the nearest centimeter.
 (999) Unknown
70 inches X 2.54 = 177.8 centimeters

8. Occupant's Weight (INTERVIEW) 079
 Code actual weight to the nearest kilogram.
 (999) Unknown
175 pounds X .4536 = 79.3 kilograms

9. Occupant's Role 1
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 11
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 0
 (0) Normal posture (INTERVIEW)

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection 0
 (0) No ejection
 (1) Complete ejection
 (2) Partial ejection
 (3) Ejection, unknown degree
 (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0
 (0) No ejection
 (1) Open
 (2) Closed
 (3) Integral structure
 (9) Unknown

13. Ejection Area 0
 (0) No ejection
 (1) Windshield
 (2) Left front
 (3) Right front
 (4) Left rear
 (5) Right rear
 (6) Rear
 (7) Roof
 (8) Other area (e.g., back of pickup, etc.)
 (specify): _____
 (9) Unknown

16. Entrapment 0
 (NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)
 (0) Not entrapped
 (1) Entrapped
 (9) Unknown

14. Ejection Medium 0
 (0) No ejection
 (1) Door/hatch/tailgate
 (2) Nonfixed roof structure
 (3) Fixed glazing
 (4) Nonfixed glazing (specify): _____
 (5) Integral structure
 (8) Other medium (specify): _____
 (9) Unknown

RESTRAINT SYSTEM EVALUATION

17. Manual (Active) Belt System Availability 3

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown _____

18. Manual (Active) Belt System Use 03

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

(02) Shoulder belt _____

(03) Lap belt _____

(04) Lap and shoulder belt _____

(05) Belt used—type unknown _____

(08) Other belt used (specify): _____

(12) Shoulder belt used with child safety seat _____

(13) Lap belt used with child safety seat _____

(14) Lap and shoulder belt used with child safety seat _____

(15) Belt used with child safety seat—type unknown _____

(18) Other belt used with child safety seat (specify): _____

(99) Unknown if belt used _____

19. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

20. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

21. Air Bag System Availability/Function 0

- (0) Not equipped/not available
- (1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled _____

(9) Unknown _____

22. Air Bag System Deployment 0

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

23. Are There Indications of Air Bag System Failure? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____

(9) Unknown _____

Note: See Variables 44 through 48 (Page 5) for information on Automatic Belts

24. Police Reported Restraint Use 4

- (0) None used
- (1) Police did not indicate restraint use
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt used, type not specified
- (6) Child safety seat
- (7) Other or automatic restraint (specify): _____

(8) Restrained, type unknown _____

(9) Police indicated "unknown" _____

HEAD RESTRAINT AND SEAT EVALUATION

25. Head Restraint Type/Damage by Occupant at This Occupant Position 3

- (0) No head restraints
- (1) Integral—no damage
- (2) Integral—damaged during accident
- (3) Adjustable—no damage
- (4) Adjustable—damaged during accident
- (5) Add-on—no damage
- (6) Add-on—damaged during accident
- (8) Other (specify): _____
- (9) Unknown

26. Seat Type (this Occupant Position) 0 1

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

27. Seat Performance (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

28. Child Safety Seat Make/Model 0 0 0
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

29. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

30. Child Safety Seat Orientation 0 0
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight
 (01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight
 (11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

*Unknown Design or Orientation For This
 Age/Weight, or Unknown Age/Weight*
 (21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

(99) Unknown if child safety seat used

31. Child Safety Seat Harness Usage 0 0

32. Child Safety Seat Shield Usage 0 0

33. Child Safety Seat Tether Usage 0 0

Note: Options below applicable to
 Variables OA31-OA33.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

34. Injury Severity (Police Rating) 1

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

35. Treatment - Mortality 4

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify):

- (9) Unknown

36. Type Of Medical Facility (for Initial Treatment) 8

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

37. Hospital Stay 00

- (00) Not Hospitalized
Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

38. Working Days Lost 06

- 6 Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP - GO TO VARIABLE 44 ON PAGE 7

VARIABLES 39 THROUGH 43 ARE COMPLETED BY THE ZONE CENTER

39. Time to Death 00

- Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
- (00) Not fatal
- (96) Fatal - ruled disease
- (99) Unknown

40. 1st Medically Reported Cause of Death 00

41. 2nd Medically Reported Cause of Death 00

42. 3rd Medically Reported Cause of Death 00

- Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
- (00) Not fatal or no additional causes
- (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown

43. Number of Recorded Injuries for This Occupant 02

- 2 Code the actual number of injuries recorded for this occupant.
- (00) No recorded injuries
- (97) Injured, details unknown
- (99) Unknown if injured

AUTOMATIC BELT SYSTEM

44. Automatic (Passive) Belt System Availability/ Function 1

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

45. Automatic (Passive) Belt System Use 1

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____
- (3) Automatic belt use unknown
- (9) Unknown

46. Automatic (Passive) Belt System Type 2

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

47. Proper Use of Automatic (Passive) Belt System 1

- (0) Not equipped/not available/not used
 - (1) Automatic belt used properly
 - (2) Automatic belt used properly with child safety seat
- Automatic Belt Used Improperly*
- (3) Automatic shoulder belt worn under arm
 - (4) Automatic shoulder belt worn behind back
 - (5) Automatic belt worn around more than one person
 - (6) Lap portion of automatic belt worn on abdomen
 - (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____
 - (8) Other improper use of automatic belt system (specify): _____
 - (9) Unknown

48. Automatic (Passive) Belt Failure Modes During Accident 1

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____
- (6) Broken retractor
- (7) Combination of above (specify): _____
- (8) Other automatic belt failure (specify): _____
- (9) Unknown

49. Seat Orientation (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify): _____
- (9) Unknown

Check the Primary Source Used In Determining Belt Use.

- Not equipped/not available/destroyed or rendered inoperative
- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify): _____

- Unknown if belt used
- _____
- _____
- _____
- _____

ARE ALL APPLICABLE MEDICAL RECORDS INCLUDED WITH INITIAL SUBMISSION? NO [] YES []

UPDATE CANDIDATE? NO [] YES []

STOP - VARIABLES 50 THROUGH 53 ARE COMPLETED BY THE ZONE CENTER

TRAUMA DATA

50. Glasgow Coma Scale (GCS) Score 02
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

51. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

52. Arterial Blood Gases (ABG) - HCO_3 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO_3
 (96) ABGs reported, HCO_3 unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

53. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>79</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>044B</u>	4. Occupant Number <u>01</u>


INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	A.I.S. - 90							Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
	Source of Injury Data	Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				
1st	5. <u>3</u>	6. <u>8</u>	7. <u>9</u>	8. <u>04</u>	9. <u>02</u>	10. <u>1</u>	11. <u>2</u>	12. <u>41</u>	13. <u>3</u>	14. <u>1</u>	15. <u>00</u>
2nd	16. <u>7</u>	17. <u>1</u>	18. <u>9</u>	19. <u>06</u>	20. <u>00</u>	21. <u>1</u>	22. <u>6</u>	23. <u>26</u>	24. <u>2</u>	25. <u>1</u>	26. <u>00</u>
3rd	27. ___	28. ___	29. ___	30. ___	31. ___	32. ___	33. ___	34. ___	35. ___	36. ___	37. ___
4th	38. ___	39. ___	40. ___	41. ___	42. ___	43. ___	44. ___	45. ___	46. ___	47. ___	48. ___
5th	49. ___	50. ___	51. ___	52. ___	53. ___	54. ___	55. ___	56. ___	57. ___	58. ___	59. ___
6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

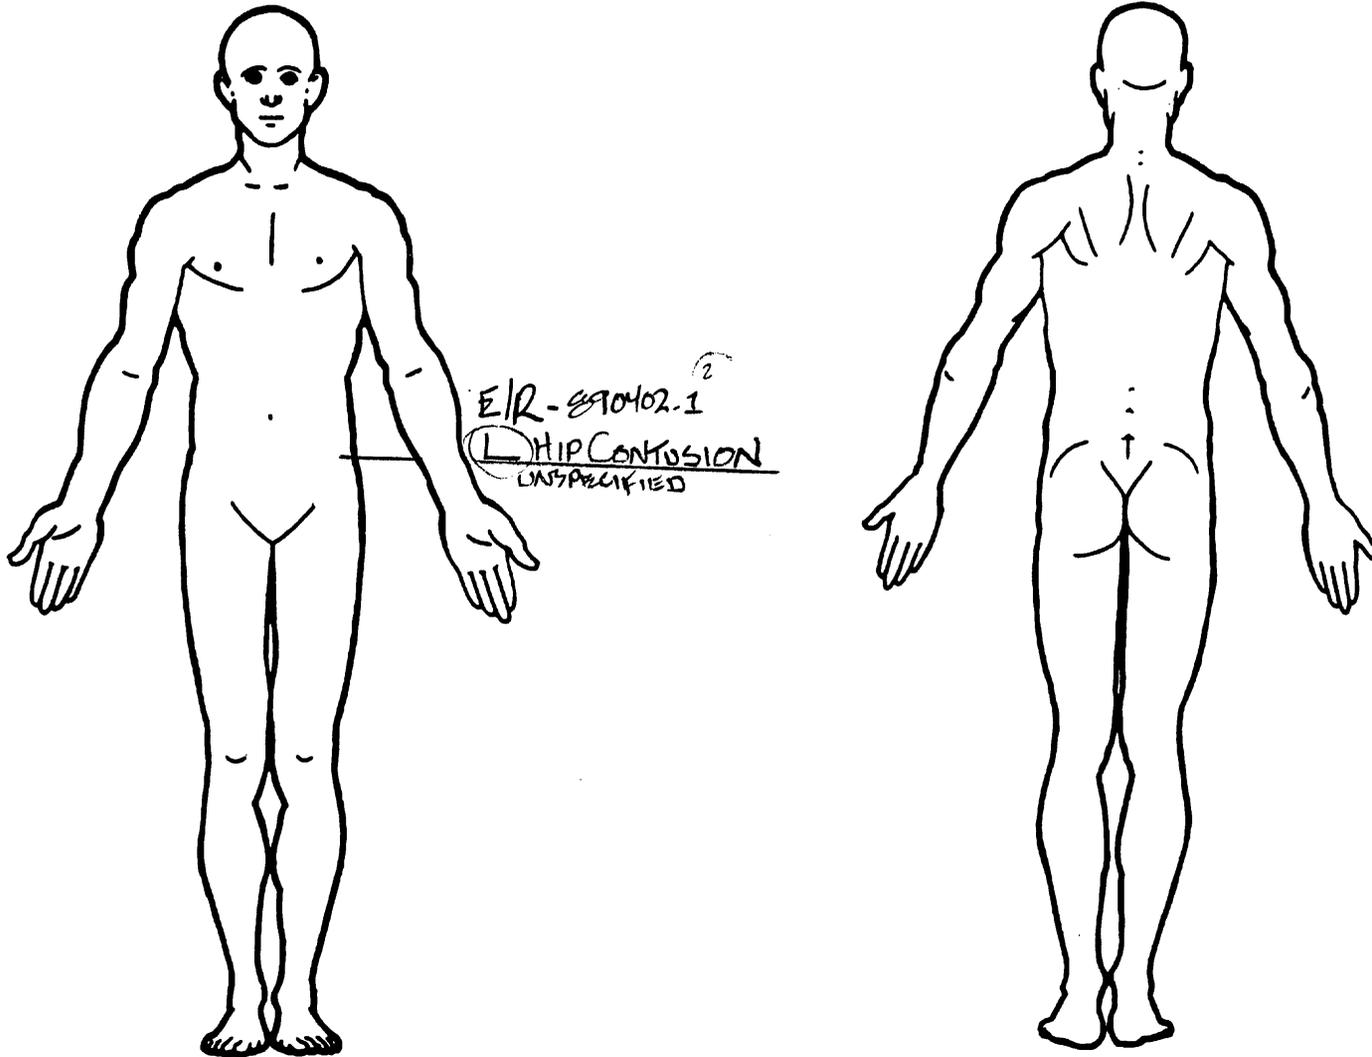

SOURCE OF INJURY DATA

OFFICIAL

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): _____
- (9) Police

- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____

- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____

- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (37) Other right side object (specify): _____

- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar or door frame attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)
- (46) Other occupants (specify): _____
- (47) Interior loose objects
- (48) Child safety seat (specify): _____
- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)

- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (65) Hood
- (66) Outside hardware (e.g., outside mirror, antenna)
- (67) Other exterior surface or tires (specify): _____
- (68) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (70) Front bumper
- (71) Hood edge
- (72) Other front of vehicle (specify): _____

- (73) Hood
- (74) Hood ornament
- (75) Windshield, roof rail, A-pillar
- (76) Side surface
- (77) Side mirrors
- (78) Other side protrusions (specify): _____

- (79) Rear surface
- (80) Undercarriage
- (81) Tires and wheels
- (82) Other exterior of other motor vehicle (specify): _____

- (83) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (84) Ground
- (85) Other vehicle or object (specify): _____
- (86) Unknown vehicle or object

NONCONTACT INJURY

- (90) Fire in vehicle
- (91) Flying glass
- (92) Other noncontact injury source (specify): _____
- (93) Air bag exhaust gases
- (97) Injured, unknown source

INJURY SOURCE CONFIDENCE LEVEL

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

DIRECT/INDIRECT INJURY

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

INJURY SOURCE

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar
- (23) Left B-pillar
- (24) Other left pillar (specify): _____

OCCUPANT INJURY CLASSIFICATION

Body Region

- (1) Head
- (2) Face
- (3) Neck
- (4) Thorax
- (5) Abdomen
- (6) Spine
- (7) Upper Extremity
- (8) Lower Extremity
- (9) Unspecified

Type of Anatomic Structure

- (1) Whole Area
- (2) Vessels
- (3) Nerves
- (4) Organs (includes muscles/ligaments)
- (5) Skeletal (includes joints)
- (6) Head - LOC
- (9) Skin

Specific Anatomic Structure

- Whole Area
- (02) Skin - Abrasion
- (04) Skin - Contusion
- (06) Skin - Laceration
- (08) Skin - Avulsion
- (10) Amputation
- (20) Burn
- (30) Crush
- (40) Degloving
- (50) Injury - NFS
- (90) Trauma, other than mechanical

- Head - LOC
- (02) Length of LOC
- (04, 06, 08) Level of Consciousness
- (10) Concussion

Spine

- (02) Cervical
- (04) Thoracic
- (06) Lumbar

Vessels, Nerves, Organs, Bones, Joints are assigned consecutive two digit numbers beginning with 02

Level of Injury

Specific injuries are assigned consecutive two-digit numbers beginning with 02.

To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.

Abbreviated Injury Scale

- (1) Minor injury
- (2) Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity

Aspect

- (1) Right
- (2) Left
- (3) Bilateral
- (4) Central
- (5) Anterior
- (6) Posterior
- (7) Superior
- (8) Inferior
- (9) Unknown
- (0) Whole region

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No
 Yes

Blood Alcohol Level (mg/dl)

BAL = ?

Glasgow Coma Scale Score

GCSS = ?

Units of Blood Given

Units = 0

Arterial Blood Gases



pH = 7.35

PO₂ = 7

PCO₂ = 40



HCO₃ = 24

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

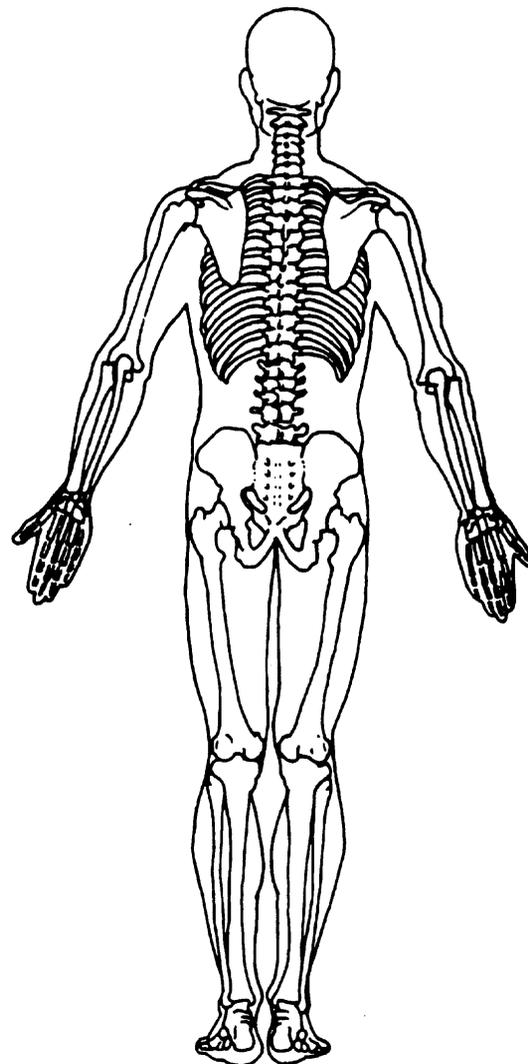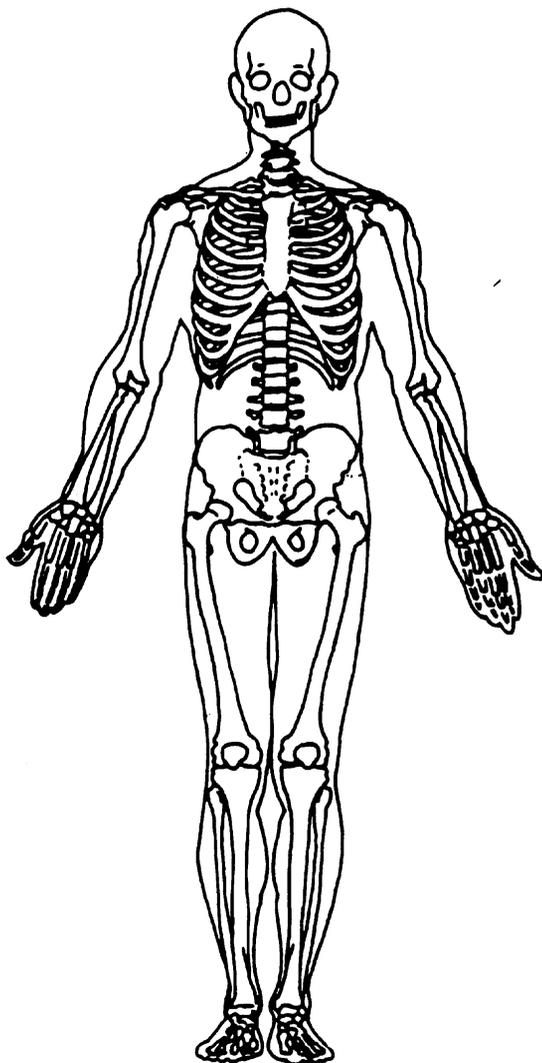

OFFICIAL INJURY DATA – INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

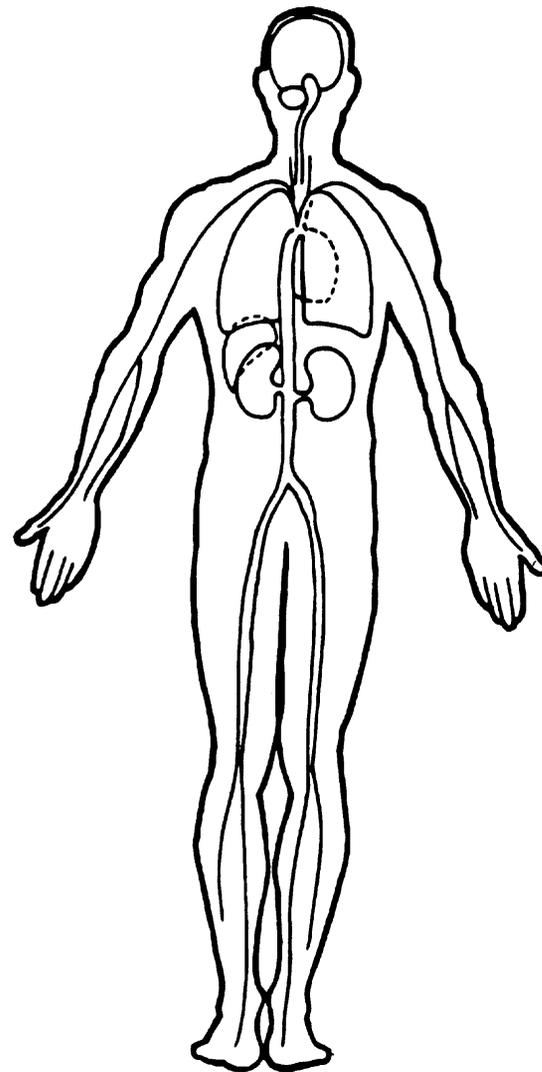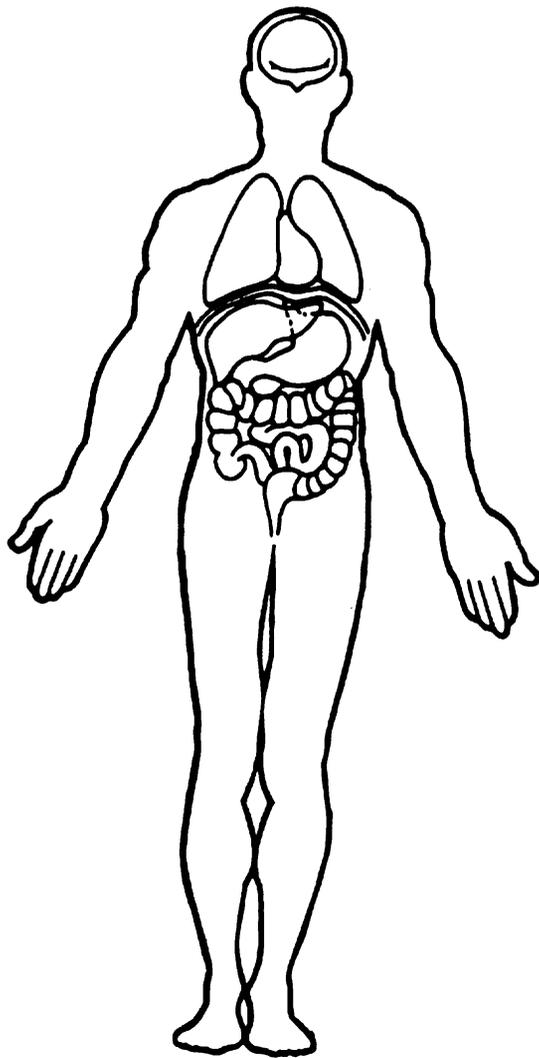



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 79
 2. Case Number - Stratum 022E
 3. Vehicle Number 02
 4. Occupant Number 02

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 27
 Code actual age at time of accident.
 (00) Less than one year old (specify by month):
 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 2
 (1) Male
 (2) Female
 (9) Unknown

7. Occupant's Height 78
 Code actual height to the nearest centimeter.
 (999) Unknown
70 inches X 2.54 = 177.8 centimeters

8. Occupant's Weight 154
 Code actual weight to the nearest kilogram.
 (999) Unknown
120 pounds X .4536 = 54.4 kilograms

9. Occupant's Role 2
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 13
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify):
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify):
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify):
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify):
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify):
 (99) Unknown

11. Occupant's Posture 0
 (0) Normal posture

Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify):
 (9) Unknown

EJECTION ENTRAPMENT

12. Ejection 0
 (0) No ejection
 (1) Complete ejection
 (2) Partial ejection
 (3) Ejection, unknown degree
 (9) Unknown

15. Medium Status (Immediately Prior To Impact) 0
 (0) No ejection
 (1) Open
 (2) Closed
 (3) Integral structure
 (9) Unknown

13. Ejection Area 0
 (0) No ejection
 (1) Windshield
 (2) Left front
 (3) Right front
 (4) Left rear
 (5) Right rear
 (6) Rear
 (7) Roof
 (8) Other area (e.g., back of pickup, etc.)
 (specify): _____
 (9) Unknown

16. Entrapment 0
 (NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)
 (0) Not entrapped
 (1) Entrapped
 (9) Unknown

14. Ejection Medium 0
 (0) No ejection
 (1) Door/hatch/tailgate
 (2) Nonfixed roof structure
 (3) Fixed glazing
 (4) Nonfixed glazing (specify): _____
 (5) Integral structure
 (8) Other medium (specify): _____
 (9) Unknown

RESTRAINT SYSTEM EVALUATION

17. Manual (Active) Belt System Availability 3

- (0) None available
- (1) Belt removed/destroyed
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt available—type unknown

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
- (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown _____

18. Manual (Active) Belt System Use 0 3

- (00) None used, not available, or belt removed/destroyed
- (01) Inoperative (specify): _____

- (02) Shoulder belt
- (03) Lap belt
- (04) Lap and shoulder belt
- (05) Belt used—type unknown
- (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
- (13) Lap belt used with child safety seat
- (14) Lap and shoulder belt used with child safety seat
- (15) Belt used with child safety seat—type unknown
- (18) Other belt used with child safety seat (specify): _____
- (99) Unknown if belt used

19. Proper Use of Manual (Active) Belts 1

- (0) None used or not available
- (1) Belt used properly
- (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
- (4) Shoulder belt worn behind back or seat
- (5) Belt worn around more than one person
- (6) Lap belt worn on abdomen
- (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

20. Manual (Active) Belt Failure Modes During Accident 1

- (0) No manual belt used
- (1) No manual belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify): _____

(6) Broken retractor _____

(7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

21. Air Bag System Availability/Function 0

- (0) Not equipped/not available
- (1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled _____

(9) Unknown _____

22. Air Bag System Deployment 0

- (0) Not equipped/not available
- (1) Air bag deployed during accident (as a result of impact)
- (2) Air bag deployed inadvertently just prior to accident
- (3) Air bag deployed, accident sequence undetermined
- (4) Nondeployed
- (5) Unknown if deployed
- (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
- (9) Unknown

23. Are There Indications of Air Bag System Failure? 0

- (0) Not equipped/not available
- (1) No
- (2) Yes (specify): _____

(9) Unknown _____

Note: See Variables 44 through 48 (Page 5) for information on Automatic Belts

24. Police Reported Restraint Use 4

- (0) None used
- (1) Police did not indicate restraint use
- (2) Shoulder belt
- (3) Lap belt
- (4) Lap and shoulder belt
- (5) Belt used, type not specified
- (6) Child safety seat
- (7) Other or automatic restraint (specify): _____

(8) Restrained, type unknown _____

(9) Police indicated "unknown"

HEAD RESTRAINT AND SEAT EVALUATION

25. Head Restraint Type/Damage by Occupant at This Occupant Position

3

- (0) No head restraints
- (1) Integral—no damage
- (2) Integral—damaged during accident
- (3) Adjustable—no damage
- (4) Adjustable—damaged during accident
- (5) Add-on—no damage
- (6) Add-on—damaged during accident
- (8) Other (specify): _____
- (9) Unknown

26. Seat Type (this Occupant Position)

01

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

27. Seat Performance (this Occupant Position)

1

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

28. Child Safety Seat Make/Model 0 0 0
 (000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

29. Type of Child Safety Seat 0
 (0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

30. Child Safety Seat Orientation 0 0
 (00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight

(21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

(99) Unknown if child safety seat used

31. Child Safety Seat Harness Usage 0 0

32. Child Safety Seat Shield Usage 0 0

33. Child Safety Seat Tether Usage 0 0

Note: Options below applicable to
 Variables OA31-OA33.

(00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

34. Injury Severity (Police Rating) _____

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

35. Treatment - Mortality _____

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify):

- (9) Unknown

36. Type Of Medical Facility (for Initial Treatment) 0

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

37. Hospital Stay 00

- (00) Not Hospitalized
- _____ Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

38. Working Days Lost 05

- _____ Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP - GO TO VARIABLE 44 ON PAGE 7

VARIABLES 39 THROUGH 43 ARE COMPLETED BY THE ZONE CENTER

39. Time to Death 00

- _____ Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
- (00) Not fatal
- (96) Fatal - ruled disease
- (99) Unknown

40. 1st Medically Reported Cause of Death 00

41. 2nd Medically Reported Cause of Death 00

42. 3rd Medically Reported Cause of Death 00
 _____ Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death

- (00) Not fatal or no additional causes
- (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

(97) Other result (includes fatal ruled disease) (specify):

(99) Unknown

43. Number of Recorded Injuries for This Occupant 03

- 3 Code the actual number of injuries recorded for this occupant.
- (00) No recorded injuries
- (97) Injured, details unknown
- (99) Unknown if injured

AUTOMATIC BELT SYSTEM

44. Automatic (Passive) Belt System Availability/Function 1

- (0) Not equipped/not available
- (1) 2 point automatic belts
- (2) 3 point automatic belts
- (3) Automatic belts - type unknown

Non-functional

- (4) Automatic belts destroyed or rendered inoperative
- (9) Unknown

45. Automatic (Passive) Belt System Use 1

- (0) Not equipped/not available/destroyed or rendered inoperative
- (1) Automatic belt in use
- (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify):
- (3) Automatic belt use unknown
- (9) Unknown

46. Automatic (Passive) Belt System Type 2

- (0) Not equipped/not available
- (1) Non-motorized system
- (2) Motorized system
- (9) Unknown

47. Proper Use of Automatic (Passive) Belt System 1

- (0) Not equipped/not available/not used
- (1) Automatic belt used properly
- (2) Automatic belt used properly with child safety seat

Automatic Belt Used Improperly

- (3) Automatic shoulder belt worn under arm
- (4) Automatic shoulder belt worn behind back
- (5) Automatic belt worn around more than one person
- (6) Lap portion of automatic belt worn on abdomen
- (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify):

- (8) Other improper use of automatic belt system (specify):
- (9) Unknown

48. Automatic (Passive) Belt Failure Modes During Accident 1

- (0) Not equipped/not available/not in use
- (1) No automatic belt failure(s)
- (2) Torn webbing (stretched webbing not included)
- (3) Broken buckle or latchplate
- (4) Upper anchorage separated
- (5) Other anchorage separated (specify):
- (6) Broken retractor
- (7) Combination of above (specify):
- (8) Other automatic belt failure (specify):
- (9) Unknown

49. Seat Orientation (this Occupant Position) 1

- (0) Occupant not seated or no seat
- (1) Forward facing seat
- (2) Rear facing seat
- (3) Side facing seat (inward)
- (4) Side facing seat (outward)
- (8) Other (specify):
- (9) Unknown

Check the Primary Source Used In Determining Belt Use.

- Not equipped/not available/destroyed or rendered inoperative
- Vehicle inspection
- Official injury data
- Driver/occupant interview
- Other (specify):

Unknown if belt used

ARE ALL APPLICABLE MEDICAL RECORDS INCLUDED WITH INITIAL SUBMISSION?

NO YES

PAC

UPDATE CANDIDATE?

NO YES

STOP - VARIABLES 50 THROUGH 53 ARE COMPLETED BY THE ZONE CENTER

BELT USE DETERMINATION

TRAUMA DATA

50. Glasgow Coma Scale (GCS) Score 01
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

51. Was the Occupant Given Blood? 1
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

52. Arterial Blood Gases (ABG) - HCO₃ 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO₃
 (96) ABGs reported, HCO₃ unknown
 (97) Injured, details unknown
 (99) Unknown if injured

53. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>79</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>044B</u>	4. Occupant Number <u>02</u>



INJURY DATA

Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	Source of Injury Data	A.I.S. - 90						Injury Source	Injury Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
		Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				
1st	5. <u>7</u>	6. <u>4</u>	7. <u>9</u>	8. <u>04</u>	9. <u>02</u>	10. <u>1</u>	11. <u>4</u>	12. <u>41</u>	13. <u>2</u>	14. <u>1</u>	15. <u>00</u>
2nd	16. <u>7</u>	17. <u>8</u>	18. <u>9</u>	19. <u>04</u>	20. <u>02</u>	21. <u>1</u>	22. <u>1</u>	23. <u>41</u>	24. <u>2</u>	25. <u>1</u>	26. <u>00</u>
3rd	27. <u>7</u>	28. <u>8</u>	29. <u>9</u>	30. <u>04</u>	31. <u>02</u>	32. <u>1</u>	33. <u>2</u>	34. <u>41</u>	35. <u>2</u>	36. <u>1</u>	37. <u>00</u>
4th	38. ___	39. ___	40. ___	41. ___	42. ___	43. ___	44. ___	45. ___	46. ___	47. ___	48. ___
5th	49. ___	50. ___	51. ___	52. ___	53. ___	54. ___	55. ___	56. ___	57. ___	58. ___	59. ___
6th	60. ___	61. ___	62. ___	63. ___	64. ___	65. ___	66. ___	67. ___	68. ___	69. ___	70. ___
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

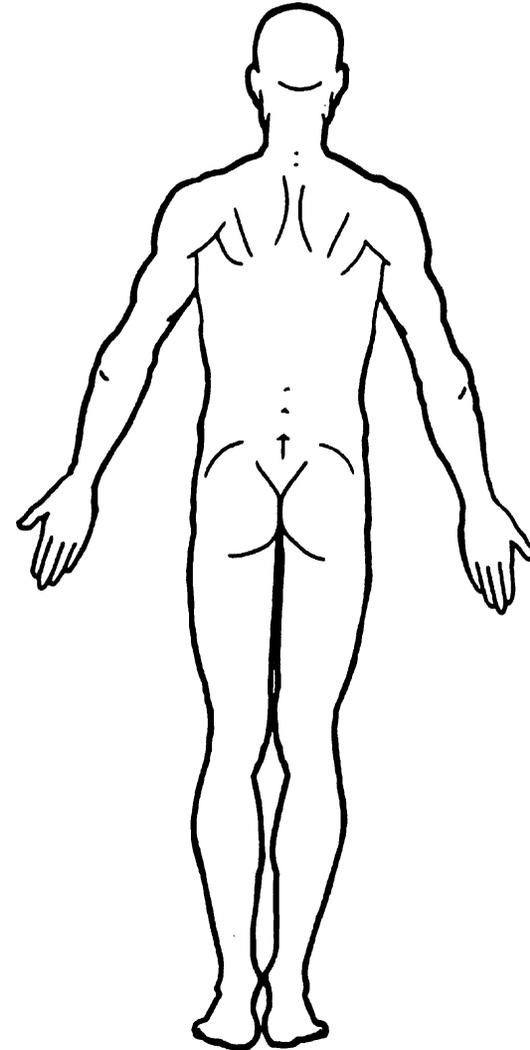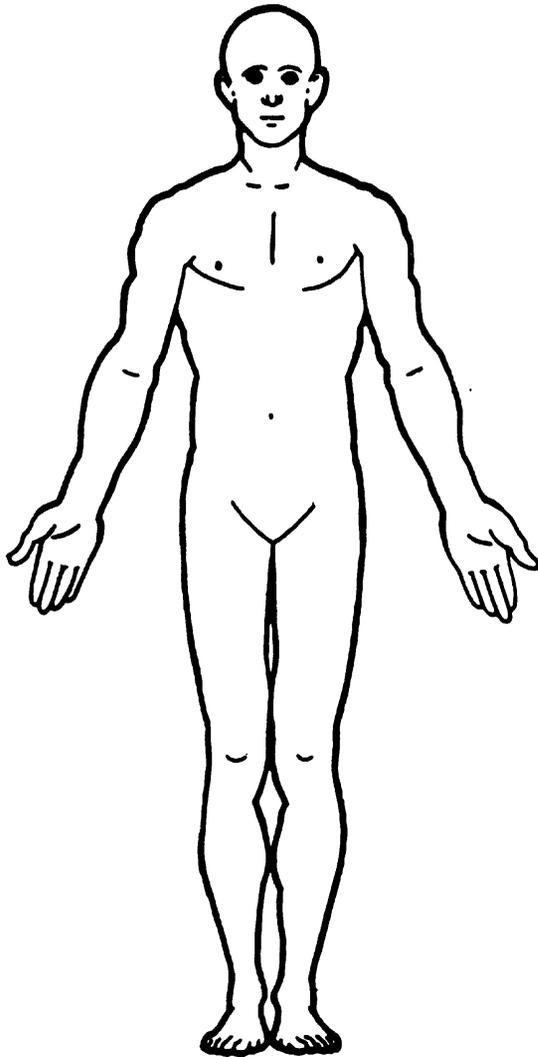

SOURCE OF INJURY DATA

OFFICIAL

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): _____
- (9) Police

INJURY SOURCE

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar
- (23) Left B-pillar
- (24) Other left pillar (specify): _____

- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____

- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____

- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (37) Other right side object (specify): _____

- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar or door frame attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)
- (46) Other occupants (specify): _____
- (47) Interior loose objects
- (48) Child safety seat (specify): _____
- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)

- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

EXTERIOR of OCCUPANT'S VEHICLE

- (65) Hood
- (66) Outside hardware (e.g., outside mirror, antenna)
- (67) Other exterior surface or tires (specify): _____
- (68) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (70) Front bumper
- (71) Hood edge
- (72) Other front of vehicle (specify): _____
- (73) Hood
- (74) Hood ornament
- (75) Windshield, roof rail, A-pillar
- (76) Side surface
- (77) Side mirrors
- (78) Other side protrusions (specify) _____

- (79) Rear surface
- (80) Undercarriage
- (81) Tires and wheels
- (82) Other exterior of other motor vehicle (specify): _____

- (83) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (84) Ground
- (85) Other vehicle or object (specify) _____
- (86) Unknown vehicle or object

NONCONTACT INJURY

- (90) Fire in vehicle
- (91) Flying glass
- (92) Other noncontact injury source (specify): _____
- (93) Air bag exhaust gases
- (97) Injured, unknown source

INJURY SOURCE CONFIDENCE LEVEL

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

DIRECT/INDIRECT INJURY

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

OCCUPANT INJURY CLASSIFICATION

Body Region

- (1) Head
- (2) Face
- (3) Neck
- (4) Thorax
- (5) Abdomen
- (6) Spine
- (7) Upper Extremity
- (8) Lower Extremity
- (9) Unspecified

Type of Anatomic Structure

- (1) Whole Area
- (2) Vessels
- (3) Nerves
- (4) Organs (includes muscles/ligaments)
- (5) Skeletal (includes joints)
- (6) Head - LOC
- (9) Skin

Specific Anatomic Structure

- Whole Area
- (02) Skin - Abrasion
- (04) Skin - Contusion
- (06) Skin - Laceration
- (08) Skin - Avulsion
- (10) Amputation
- (20) Burn
- (30) Crush
- (40) Degloving
- (50) Injury - NFS
- (90) Trauma, other than mechanical

- Head - LOC
- (02) Length of LOC
- (04, 06, 08) Level of Consciousness
- (10) Concussion

Spine

- (02) Cervical
- (04) Thoracic
- (06) Lumbar

Vessels, Nerves, Organs, Bones, Joints are assigned consecutive two digit numbers beginning with 02

Level of Injury

Specific injuries are assigned consecutive two-digit numbers beginning with 02.

To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.

Abbreviated Injury Scale

- (1) Minor injury
- (2) Moderate injury
- (3) Serious injury
- (4) Severe injury
- (5) Critical injury
- (6) Maximum (untreatable)
- (7) Injured, unknown severity

Aspect

- (1) Right
- (2) Left
- (3) Bilateral
- (4) Central
- (5) Anterior
- (6) Posterior
- (7) Superior
- (8) Inferior
- (9) Unknown
- (0) Whole region

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No

Yes

Blood Alcohol Level (mg/dl)

BAL = _____

Glasgow Coma Scale Score

GCSS = _____

Units of Blood Given

Units = _____

Arterial Blood Gases



pH = _____

PO₂ = _____

PCO₂ _____



HCO₃ _____

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

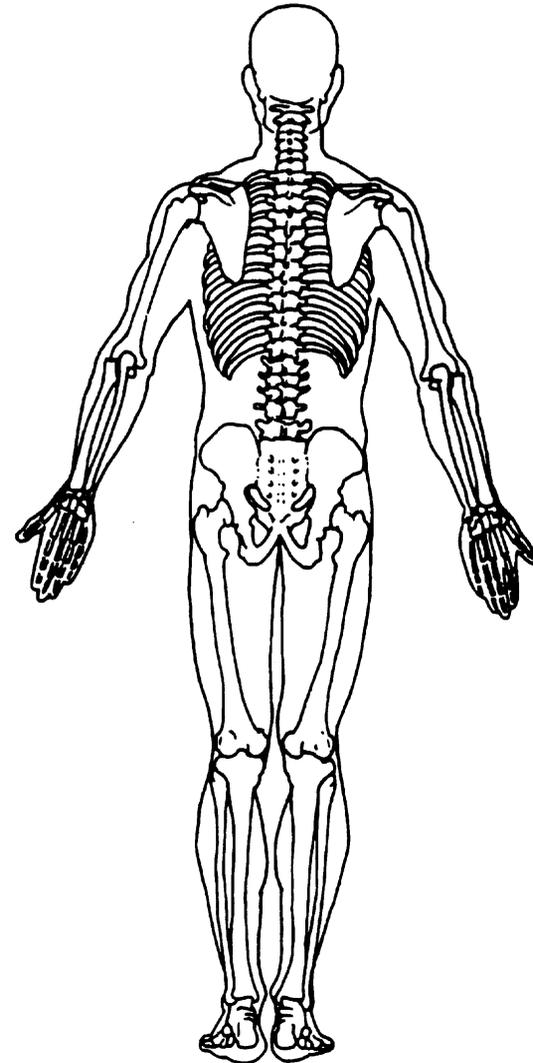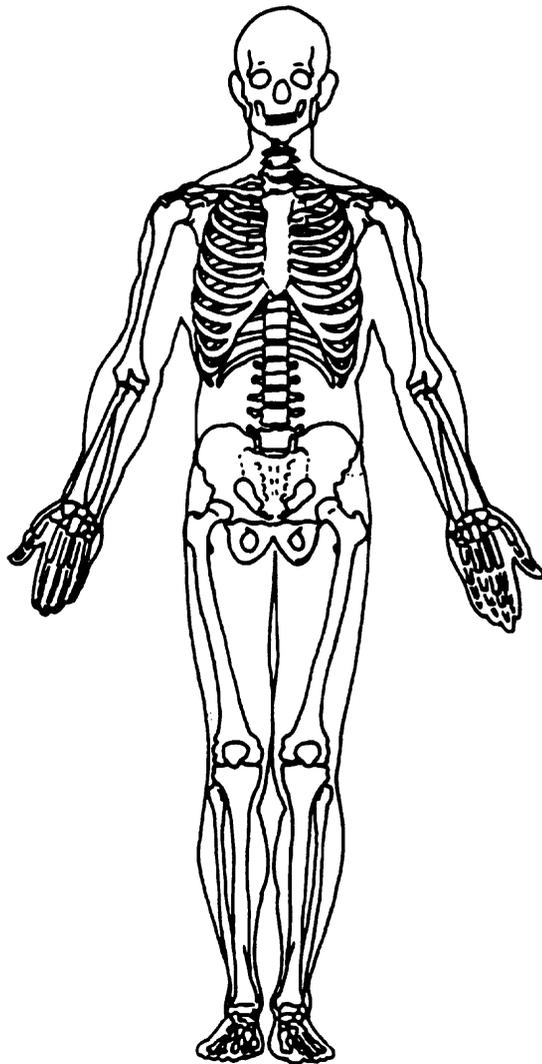

OFFICIAL INJURY DATA – INTERNAL INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

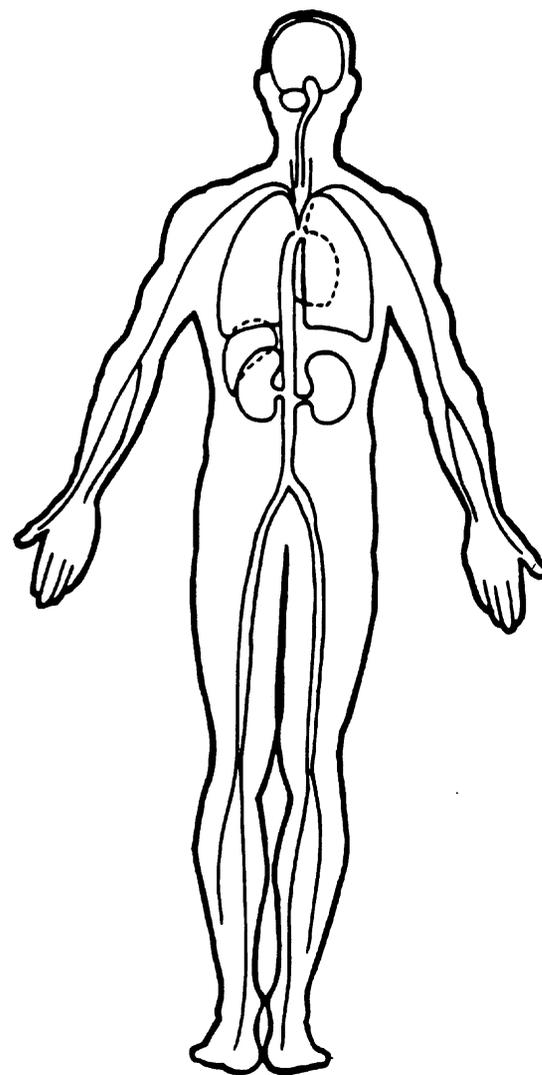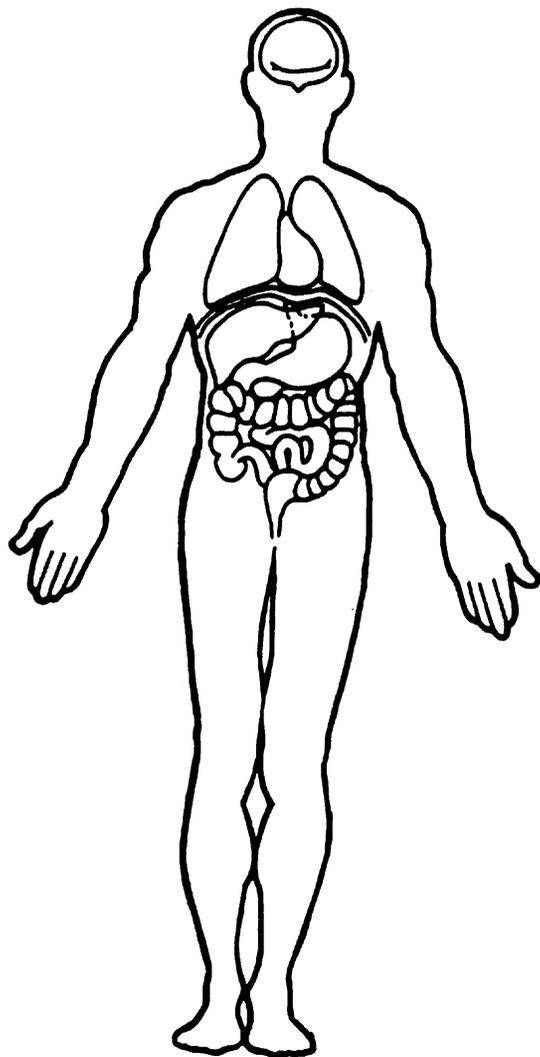



OCCUPANT ASSESSMENT FORM

1. Primary Sampling Unit Number 70
 2. Case Number - Stratum 0005
 3. Vehicle Number 02
 4. Occupant Number 03

OCCUPANT'S CHARACTERISTICS

5. Occupant's Age 18
 Code actual age at time of accident.
 (00) Less than one year old (specify by month):

 (97) 97 years and older
 (99) Unknown

6. Occupant's Sex 1
 (1) Male
 (2) Female
 (9) Unknown

7. Occupant's Height CORONET 175
 Code actual height to the nearest centimeter.
 (999) Unknown
69 inches X 2.54 = 175.26 centimeters

8. Occupant's Weight CORONET 063
 Code actual weight to the nearest kilogram.
 (999) Unknown
138 pounds X .4536 = 62.5 kilograms

9. Occupant's Role 2
 (1) Driver
 (2) Passenger
 (9) Unknown

OCCUPANT'S SEATING

10. Occupant's Seat Position 21
Front Seat
 (11) Left side
 (12) Middle
 (13) Right side
 (14) Other (specify): _____
 (15) On or in the lap of another occupant

Second Seat
 (21) Left side
 (22) Middle
 (23) Right side
 (24) Other (specify): _____
 (25) On or in the lap of another occupant

Third Seat
 (31) Left side
 (32) Middle
 (33) Right side
 (34) Other (specify): _____
 (35) On or in the lap of another occupant

Fourth Seat
 (41) Left side
 (42) Middle
 (43) Right side
 (44) Other (specify): _____
 (45) On or in the lap of another occupant

(97) In or on unenclosed area
 (98) Other seat (specify): _____
 (99) Unknown

11. Occupant's Posture 0
 (0) Normal posture (INTERVIEW)
Abnormal posture
 (1) Kneeling or standing on seat
 (2) Lying on or across seat
 (3) Kneeling, standing or sitting in front of seat
 (4) Sitting sideways or turned to talk with another occupant or to look out a rear window
 (5) Sitting on a console
 (6) Lying back in a reclined seat position
 (7) Bracing with feet or hands on a surface in front of seat
 (8) Other abnormal posture (specify): _____
 (9) Unknown

EJECTION/ENTRAPMENT

12. Ejection

- (0) No ejection
- (1) Complete ejection
- (2) Partial ejection
- (3) Ejection, unknown degree
- (9) Unknown

(INTERVIEWE) PAI

1

13. Ejection Area

- (0) No ejection
- (1) Windshield
- (2) Left front
- (3) Right front
- (4) Left rear
- (5) Right rear
- (6) Rear
- (7) Roof
- (8) Other area (e.g., back of pickup, etc.) (specify): _____
- (9) Unknown

UNK LOCATION

6 9

14. Ejection Medium

- (0) No ejection
- (1) Door/hatch/tailgate
- (2) Nonfixed roof structure
- (3) Fixed glazing
- (4) Nonfixed glazing (specify): _____
- (5) Integral structure
- (8) Other medium (specify): _____
- (9) Unknown

1 2

15. Medium Status (Immediately Prior To Impact)

- (0) No ejection
- (1) Open
- (2) Closed
- (3) Integral structure
- (9) Unknown

2

16. Entrapment

- (NOTE: Entrapped means that part of the person was in the vehicle and mechanically restrained; jammed doors and immobilizing injuries by themselves are not sufficient to constitute entrapment.)
- (0) Not entrapped
 - (1) Entrapped
 - (9) Unknown

0

RESTRAINT SYSTEM EVALUATION

17. Manual (Active) Belt System Availability 4

- (0) None available
 (1) Belt removed/destroyed *LAP & SHOULDER BELT*
 (2) Shoulder belt *TWO SEPARATE*
 (3) Lap belt *PIECES, EACH WITH*
 (4) Lap and shoulder belt *ITS OWN*
 (5) Belt available—type unknown *BUCKLE*

Integral Belt Partially Destroyed

- (6) Shoulder belt (lap belt destroyed/removed)
 (7) Lap belt (shoulder belt destroyed/removed)

(8) Other belt (specify): _____

(9) Unknown _____

18. Manual (Active) Belt System Use 00

- (00) None used, not available, or belt removed/destroyed
 (01) Inoperative (specify): _____

- (02) Shoulder belt
 (03) Lap belt
 (04) Lap and shoulder belt
 (05) Belt used—type unknown
 (08) Other belt used (specify): _____

- (12) Shoulder belt used with child safety seat
 (13) Lap belt used with child safety seat
 (14) Lap and shoulder belt used with child safety seat
 (15) Belt used with child safety seat—type unknown
 (18) Other belt used with child safety seat (specify): _____
 (99) Unknown if belt used _____

19. Proper Use of Manual (Active) Belts 0

- (0) None used or not available
 (1) Belt used properly
 (2) Belt used properly with child safety seat

Belt Used Improperly

- (3) Shoulder belt worn under arm
 (4) Shoulder belt worn behind back or seat
 (5) Belt worn around more than one person
 (6) Lap belt worn on abdomen
 (7) Lap belt or lap and shoulder belt used improperly with child safety seat (specify): _____

(8) Other improper use of manual belt system (specify): _____

(9) Unknown _____

20. Manual (Active) Belt Failure Modes During Accident 0

- (0) No manual belt used
 (1) No manual belt failure(s)
 (2) Torn webbing (stretched webbing not included)
 (3) Broken buckle or latchplate
 (4) Upper anchorage separated
 (5) Other anchorage separated (specify): _____

(6) Broken retractor
 (7) Combination of above (specify): _____

(8) Other manual belt failure (specify): _____

(9) Unknown _____

21. Air Bag System Availability/Function 0

- (0) Not equipped/not available
 (1) Air bag

Non-functional

(2) Air bag disconnected (specify): _____

(3) Air bag not reinstalled _____

(9) Unknown _____

22. Air Bag System Deployment 0

- (0) Not equipped/not available
 (1) Air bag deployed during accident (as a result of impact)
 (2) Air bag deployed inadvertently just prior to accident
 (3) Air bag deployed, accident sequence undetermined
 (4) Nondeployed
 (5) Unknown if deployed
 (6) Air bag deployed as a result of a noncollision event during accident sequence (e.g., fire, explosion, electrical)
 (9) Unknown

23. Are There Indications of Air Bag System Failure? 0

- (0) Not equipped/not available
 (1) No
 (2) Yes (specify): _____

(9) Unknown _____

Note: See Variables 44 through 48 (Page 5) for Information on Automatic Belts

24. Police Reported Restraint Use 9

- (0) None used
 (1) Police did not indicate restraint use
 (2) Shoulder belt
 (3) Lap belt
 (4) Lap and shoulder belt
 (5) Belt used, type not specified
 (6) Child safety seat
 (7) Other or automatic restraint (specify): _____

(8) Restrained, type unknown _____

(9) Police indicated "unknown"

HEAD RESTRAINT AND SEAT EVALUATION

25. Head Restraint Type/Damage by Occupant
at This Occupant Position

0

- (0) No head restraints
- (1) Integral—no damage
- (2) Integral—damaged during accident
- (3) Adjustable—no damage
- (4) Adjustable—damaged during accident
- (5) Add-on—no damage
- (6) Add-on—damaged during accident
- (8) Other (specify): _____
- (9) Unknown

26. Seat Type (this Occupant Position)

07

- (00) Occupant not seated or no seat
- (01) Bucket
- (02) Bucket with folding back
- (03) Bench
- (04) Bench with separate back cushions
- (05) Bench with folding back(s)
- (06) Split bench with separate back cushions
- (07) Split bench with folding back(s)
- (08) Pedestal (i.e., column supported)
- (09) Other seat type (specify): _____
- (10) Box mounted seat (i.e., van type)
- (99) Unknown

27. Seat Performance (this Occupant Position)

5

- (0) Occupant not seated or no seat
- (1) No seat performance failure(s)
- (2) Seat adjusters failed
- (3) Seat back folding locks or "seat back" failed (specify): _____
- (4) Seat track/anchors failed
- (5) Deformed by impact of occupant
- (6) Deformed by passenger compartment intrusion (specify): _____
- (7) Combination of above (specify): _____
- (8) Other (specify): _____
- (9) Unknown

CHILD SAFETY SEAT

28. Child Safety Seat Make/Model 0 0 0

(000) No child safety seat
 Applicable codes are found in your NASS CDS
 Data Collection, Coding and Editing
 (950) Built-in child safety seat
 (997) Other make/model (specify):

 (998) Unknown make/model
 (999) Unknown if child safety seat used

29. Type of Child Safety Seat 0

(0) No child safety seat
 (1) Infant seat
 (2) Toddler seat
 (3) Convertible seat
 (4) Booster seat
 (7) Other type child safety seat (specify):

 (8) Unknown child safety seat type
 (9) Unknown if child safety seat used

30. Child Safety Seat Orientation 0 0

(00) No child safety seat

Designed for Rear Facing for This Age/Weight

(01) Rear facing
 (02) Forward facing
 (08) Other orientation (specify):

 (09) Unknown orientation

Designed For Forward Facing for This Age/Weight

(11) Rear facing
 (12) Forward facing
 (18) Other orientation (specify):

 (19) Unknown orientation

Unknown Design or Orientation For This Age/Weight, or Unknown Age/Weight

(21) Rear facing
 (22) Forward facing
 (28) Other orientation (specify):

 (29) Unknown orientation

(99) Unknown if child safety seat used

31. Child Safety Seat Harness Usage 0 0

32. Child Safety Seat Shield Usage 0 0

33. Child Safety Seat Tether Usage 0 0

Note: Options below applicable to
 Variables OA31-OA33.
 (00) No child safety seat

Not Designed With Harness/Shield/Tether

(01) After market harness/shield/tether
 added, not used
 (02) After market harness/shield/tether used
 (03) Child safety seat used, but no after market
 harness/shield/tether added
 (09) Unknown if harness/shield/tether
 added or used

Designed With Harness/Shield/Tether

(11) Harness/shield/tether not used
 (12) Harness/shield/tether used
 (19) Unknown if harness/shield/tether used

Unknown If Designed With Harness/Shield/Tether

(21) Harness/shield/tether not used
 (22) Harness/shield/tether used
 (29) Unknown if harness/shield/tether used

(99) Unknown if child safety seat used

INJURY CONSEQUENCES

34. Injury Severity (Police Rating)

- (0) O - No injury
- (1) C - Possible injury
- (2) B - Nonincapacitating injury
- (3) A - Incapacitating injury
- (4) K - Killed
- (5) U - Injury, severity unknown
- (6) Died prior to accident
- (9) Unknown

35. Treatment - Mortality

- (0) No treatment
- (1) Fatal
- (2) Fatal - ruled disease (specify):

Nonfatal

- (3) Hospitalization
- (4) Transported and released
- (5) Treatment at scene - nontransported
- (6) Treatment later
- (8) Treatment - other (specify):

- (9) Unknown

36. Type Of Medical Facility (for Initial Treatment)

- (0) Not treated at a medical facility
- (1) Trauma center
- (2) Hospital
- (3) Medical clinic
- (4) Physician's office
- (5) Treatment later at medical facility
- (8) Other (specify):

- (9) Unknown

37. Hospital Stay

- (00) Not Hospitalized
- Code the number of days (up through 60) that the occupant stayed in hospital.
- (61) 61 days or more
- (99) Unknown

38. Working Days Lost

- Code the number of days (up through 60) that the occupant lost from work due to the accident
- (00) No working days lost
- (61) 61 days or more
- (62) Fatally injured
- (97) Not working prior to accident
- (99) Unknown

STOP - GO TO VARIABLE 44 ON PAGE 7

VARIABLES 39 THROUGH 43 ARE COMPLETED BY THE ZONE CENTER

39. Time to Death

- Code number of hours from time of accident to time of death up through 24 hours. If time of death is greater than 24 hours, code number of days. (Note: 1 day = 31, 2 days = 32, ... n days = 30 + n up through 30 days = 60)
- (00) Not fatal
- (96) Fatal - ruled disease
- (99) Unknown

40. 1st Medically Reported Cause of Death

41. 2nd Medically Reported Cause of Death

42. 3rd Medically Reported Cause of Death

- Code the Occupant Injury from line number(s) for the medically reported injury(s) which reportedly contributed to this occupant's death
- (00) Not fatal or no additional causes
- (96) Mode of death given but specific injuries are not linked to cause of death. (specify):

- (97) Other result (includes fatal ruled disease) (specify):

- (99) Unknown

43. Number of Recorded Injuries for This Occupant

- Code the actual number of injuries recorded for this occupant.
- (00) No recorded injuries
- (97) Injured, details unknown
- (99) Unknown if injured

62

32

99

00

00

02

06

AUTOMATIC BELT SYSTEM	
<p>44. Automatic (Passive) Belt System Availability/ Function <u>0</u> (0) Not equipped/not available (1) 2 point automatic belts (2) 3 point automatic belts (3) Automatic belts - type unknown</p> <p><i>Non-functional</i> (4) Automatic belts destroyed or rendered inoperative (9) Unknown</p>	<p>48. Automatic (Passive) Belt Failure Modes During Accident <u>0</u> (0) Not equipped/not available/not in use (1) No automatic belt failure(s) (2) Torn webbing (stretched webbing not included) (3) Broken buckle or latchplate (4) Upper anchorage separated (5) Other anchorage separated (specify): _____ (6) Broken retractor (7) Combination of above (specify): _____ (8) Other automatic belt failure (specify): _____ (9) Unknown</p>
<p>45. Automatic (Passive) Belt System Use <u>0</u> (0) Not equipped/not available/destroyed or rendered inoperative (1) Automatic belt in use (2) Automatic belt not in use (manually disconnected, motorized track inoperative) (specify): _____ (3) Automatic belt use unknown (9) Unknown</p>	<p>49. Seat Orientation (this Occupant Position) <u>1</u> (0) Occupant not seated or no seat (1) Forward facing seat (2) Rear facing seat (3) Side facing seat (inward) (4) Side facing seat (outward) (8) Other (specify): _____ (9) Unknown</p>
<p>46. Automatic (Passive) Belt System Type <u>0</u> (0) Not equipped/not available (1) Non-motorized system (2) Motorized system (9) Unknown</p>	<p>47. Proper Use of Automatic (Passive) Belt System <u>0</u> (0) Not equipped/not available/not used (1) Automatic belt used properly (2) Automatic belt used properly with child safety seat</p> <p><i>Automatic Belt Used Improperly</i> (3) Automatic shoulder belt worn under arm (4) Automatic shoulder belt worn behind back (5) Automatic belt worn around more than one person (6) Lap portion of automatic belt worn on abdomen (7) Automatic lap and shoulder belt or automatic shoulder belt used improperly with child safety seat (specify): _____ (8) Other improper use of automatic belt system (specify): _____ (9) Unknown</p>
<p style="text-align: center;">Check the Primary Source Used In Determining Belt Use.</p> <p>[] Not equipped/not available/destroyed or rendered inoperative [X] Vehicle inspection [] Official injury data [] Driver/occupant interview [] Other (specify): _____</p> <p>[] Unknown if belt used</p> <p>_____</p> <p>_____</p> <p>_____</p> <p>_____</p>	

<p>ARE ALL APPLICABLE MEDICAL RECORDS INCLUDED WITH INITIAL SUBMISSION?</p>	<p>NO [] YES [X]</p>
<p>UPDATE CANDIDATE?</p>	<p>NO [X] YES []</p>

STOP - VARIABLES 50 THROUGH 53 ARE COMPLETED BY THE ZONE CENTER

TRAUMA DATA

50. Glasgow Coma Scale (GCS) Score 02
 (at Medical Facility)
 (00) Not injured
 (01) Injured - not treated at medical facility
 (02) No GCS Score at medical facility
 (03-15) Code the actual value of the initial GCS Score recorded at medical facility.
 (97) Injured, details unknown
 (99) Unknown if injured

51. Was the Occupant Given Blood? 9
 (1) No - blood not given
 (2) Yes - blood given
 (specify units): _____
 (9) Unknown if blood given

52. Arterial Blood Gases (ABG) - HCO_3 01
 (00) Not injured
 (01) Injured, ABGs not measured or reported
 (02-50) Code the actual value of the HCO_3
 (96) ABGs reported, HCO_3 unknown
 (97) Injured, details unknown
 (99) Unknown if injured

BELT USE DETERMINATION

53. Primary Source of Belt Use Determination 1
 (0) Not equipped/not available/destroyed or rendered inoperative
 (1) Vehicle inspection
 (2) Official injury data
 (3) Driver/occupant interview
 (8) Other (specify): _____
 (9) Unknown if belt used



OCCUPANT INJURY FORM

1. Primary Sampling Unit Number <u>79</u>	3. Vehicle Number <u>02</u>
2. Case Number - Stratum <u>044B</u>	4. Occupant Number <u>03</u>

INJURY DATA



Record below the actual injuries sustained by this occupant that were identified from the official and unofficial data sources. Remember not to double count an injury just because it was identified from two different sources. If greater than ten injuries have been documented, encode the balance on the Occupant Injury Supplement.

	Source of Injury Data	A.I.S. - 90						Injury Source	Injury Source Confidence Level	Direct/Indirect Injury	Occupant Area Intrusion Number
		Body Region	Type of Anatomic Structure	Specific Anatomic Structure	Level of Injury	A.I.S. Severity	Aspect				
1st	5. <u>2</u>	6. <u>1</u>	7. <u>4</u>	8. <u>06</u>	9. <u>68</u>	10. <u>3</u>	11. <u>9</u>	12. <u>84</u>	13. <u>2</u>	14. <u>1</u>	15. <u>00</u>
2nd	16. <u>2</u>	17. <u>1</u>	18. <u>4</u>	19. <u>04</u>	20. <u>66</u>	21. <u>3</u>	22. <u>6</u>	23. <u>84</u>	24. <u>2</u>	25. <u>1</u>	26. <u>00</u>
3rd	27. <u>2</u>	28. <u>1</u>	29. <u>4</u>	30. <u>06</u>	31. <u>02</u>	32. <u>3</u>	33. <u>9</u>	34. <u>84</u>	35. <u>2</u>	36. <u>1</u>	37. <u>00</u>
4th	38. <u>2</u>	39. <u>1</u>	40. <u>5</u>	41. <u>04</u>	42. <u>00</u>	43. <u>2</u>	44. <u>9</u>	45. <u>84</u>	46. <u>2</u>	47. <u>1</u>	48. <u>00</u>
5th	49. <u>2</u>	50. <u>1</u>	51. <u>5</u>	52. <u>02</u>	53. <u>00</u>	54. <u>3</u>	55. <u>8</u>	56. <u>84</u>	57. <u>2</u>	58. <u>1</u>	59. <u>00</u>
6th	60. <u>3</u>	61. <u>2</u>	62. <u>9</u>	63. <u>04</u>	64. <u>02</u>	65. <u>1</u>	66. <u>1</u>	67. <u>84</u>	68. <u>2</u>	69. <u>1</u>	70. <u>00</u>
7th	71. ___	72. ___	73. ___	74. ___	75. ___	76. ___	77. ___	78. ___	79. ___	80. ___	81. ___
8th	82. ___	83. ___	84. ___	85. ___	86. ___	87. ___	88. ___	89. ___	90. ___	91. ___	92. ___
9th	93. ___	94. ___	95. ___	96. ___	97. ___	98. ___	99. ___	100. ___	101. ___	102. ___	103. ___
10th	104. ___	105. ___	106. ___	107. ___	108. ___	109. ___	110. ___	111. ___	112. ___	113. ___	114. ___

OFFICIAL INJURY DATA — SOFT TISSUE INJURIES

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

EIR-290402.2⁽²⁾
CONTUSION RT EAR
UNSPIC.

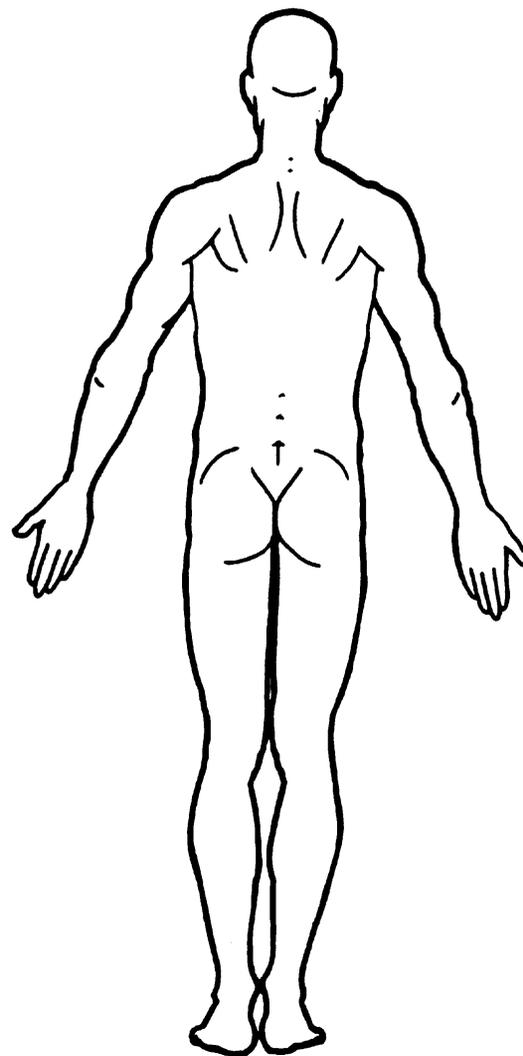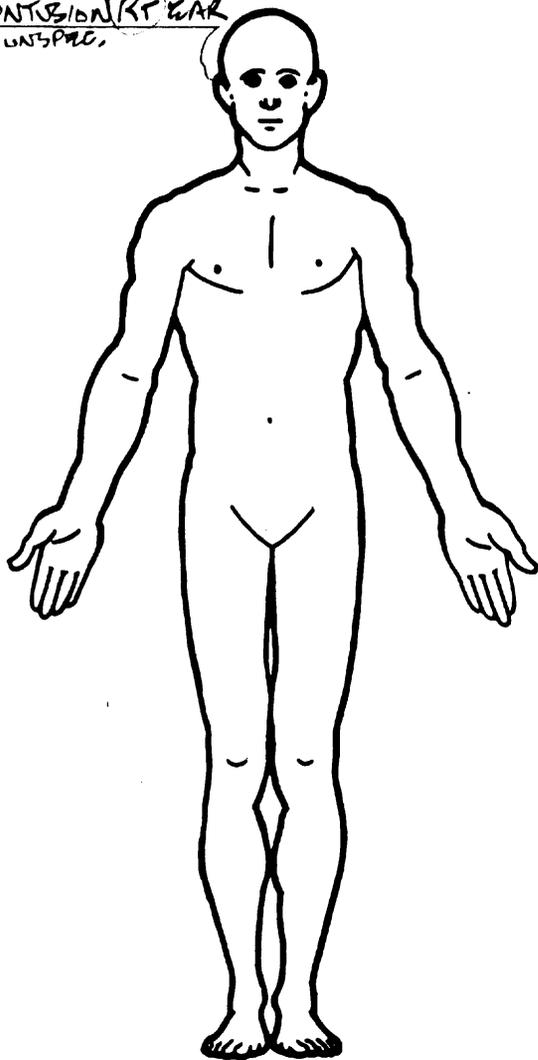

SOURCE OF INJURY DATA

OFFICIAL

- (1) Autopsy records with or without hospital/medical records
- (2) Hospital/medical records other than emergency room (e.g., discharge summary)
- (3) Emergency room records only (including associated X-rays or other lab reports)
- (4) Private physician, walk-in or emergency clinic

UNOFFICIAL

- (5) Lay coroner report
- (6) E.M.S. personnel
- (7) Interviewee
- (8) Other source (specify): _____
- (9) Police

INJURY SOURCE

FRONT

- (01) Windshield
- (02) Mirror
- (03) Sunvisor
- (04) Steering wheel rim
- (05) Steering wheel hub/spoke
- (06) Steering wheel (combination of codes 04 and 05)
- (07) Steering column, transmission selector lever, other attachment
- (08) Add on equipment (e.g., CB, tape deck, air conditioner)
- (09) Left instrument panel and below
- (10) Center instrument panel and below
- (11) Right instrument panel and below
- (12) Glove compartment door
- (13) Knee bolster
- (14) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, mirror, or steering assembly (driver side only)
- (15) Windshield including one or more of the following: front header, A (A1/A2)-pillar, instrument panel, or mirror (passenger side only)
- (16) Driver side air bag compartment cover
- (17) Passenger side air bag compartment cover
- (18) Windshield reinforced by exterior object (specify): _____
- (19) Other front object (specify): _____

LEFT SIDE

- (20) Left side interior surface, excluding hardware or armrests
- (21) Left side hardware or armrest
- (22) Left A (A1/A2)-pillar
- (23) Left B-pillar
- (24) Other left pillar (specify): _____

- (25) Left side window glass or frame
- (26) Left side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (27) Other left side object (specify): _____

- (28) Left side window sill

RIGHT SIDE

- (30) Right side interior surface, excluding hardware or armrests
- (31) Right side hardware or armrest
- (32) Right A (A1/A2)-pillar
- (33) Right B-pillar
- (34) Other right pillar (specify): _____

- (35) Right side window glass or frame
- (36) Right side window glass including one or more of the following: frame, window sill, A (A1/A2)-pillar, B-pillar, or roof side rail.
- (37) Other right side object (specify): _____

- (38) Right side window sill

INTERIOR

- (40) Seat, back support
- (41) Belt restraint webbing/buckle
- (42) Belt restraint B-pillar or door frame attachment point
- (43) Other restraint system component (specify): _____
- (44) Head restraint system
- (45) Air bag (use codes "16" and "17" for injuries sustained from air bag compartment covers)
- (46) Other occupants (specify): _____
- (47) Interior loose objects
- (48) Child safety seat (specify): _____
- (49) Other interior object (specify): _____

ROOF

- (50) Front header
- (51) Rear header
- (52) Roof left side rail
- (53) Roof right side rail
- (54) Roof or convertible top

FLOOR

- (56) Floor (including toe pan)
- (57) Floor or console mounted transmission lever, including console
- (58) Parking brake handle
- (59) Foot controls including parking brake

REAR

- (60) Backlight (rear window)

- (61) Backlight storage rack, door, etc.
- (62) Other rear object (specify): _____

EXTERIOR OF OCCUPANT'S VEHICLE

- (65) Hood
- (66) Outside hardware (e.g., outside mirror, antenna)
- (67) Other exterior surface or tires (specify): _____
- (68) Unknown exterior objects

EXTERIOR OF OTHER MOTOR VEHICLE

- (70) Front bumper
- (71) Hood edge
- (72) Other front of vehicle (specify): _____
- (73) Hood
- (74) Hood ornament
- (75) Windshield, roof rail, A-pillar
- (76) Side surface
- (77) Side mirrors
- (78) Other side protrusions (specify): _____

- (79) Rear surface

- (80) Undercarriage
- (81) Tires and wheels
- (82) Other exterior of other motor vehicle (specify): _____

- (83) Unknown exterior of other motor vehicle

OTHER VEHICLE OR OBJECT IN THE ENVIRONMENT

- (84) Ground
- (85) Other vehicle or object (specify): _____
- (86) Unknown vehicle or object

NONCONTACT INJURY

- (90) Fire in vehicle
- (91) Flying glass
- (92) Other noncontact injury source (specify): _____
- (93) Air bag exhaust gases
- (97) Injured, unknown source

INJURY SOURCE CONFIDENCE LEVEL

- (1) Certain
- (2) Probable
- (3) Possible
- (9) Unknown

DIRECT/INDIRECT INJURY

- (1) Direct contact injury
- (2) Indirect contact injury
- (3) Noncontact injury
- (7) Injured, unknown source

OCCUPANT INJURY CLASSIFICATION

Body Region	Specific Anatomic Structure	Spine	Abbreviated Injury Scale
(1) Head	<u>Whole Area</u>	(02) Cervical	(1) Minor injury
(2) Face	(02) Skin - Abrasion	(04) Thoracic	(2) Moderate injury
(3) Neck	(04) Skin - Contusion	(08) Lumbar	(3) Serious injury
(4) Thorax	(08) Skin - Laceration		(4) Severe injury
(5) Abdomen	(08) Skin - Avulsion	<u>Vessels, Nerves, Organs, Bones,</u>	(5) Critical injury
(6) Spine	(10) Amputation	<u>Joints are assigned consecutive</u>	(6) Maximum (untreatable)
(7) Upper Extremity	(20) Burn	<u>two digit numbers beginning with 02</u>	(7) Injured, unknown severity
(8) Lower Extremity	(30) Crush		
(9) Unspecified	(40) Degloving	Level of Injury	
	(50) Injury - NFS	Specific injuries are assigned consecutive two-digit numbers beginning with 02.	Aspect
	(90) Trauma, other than mechanical		(1) Right
Type of Anatomic Structure	<u>Head - LOC</u>		(2) Left
(1) Whole Area	(02) Length of LOC		(3) Bilateral
(2) Vessels	(04, 06, 08) Level of Consciousness		(4) Central
(3) Nerves	(10) Concussion		(5) Anterior
(4) Organs (includes muscles/ligaments)		To the extent possible, within the organizational framework of the AIS, 00 is assigned to an injury NFS as to severity or where only one injury is given in the dictionary for that anatomic structure. 99 is assigned to any injury NFS as to lesion or severity.	(6) Posterior
(5) Skeletal (includes joints)			(7) Superior
(6) Head - LOC			(8) Inferior
(9) Skin			(9) Unknown
			(0) Whole region

OFFICIAL INJURY DATA — SKELETAL INJURIES

Restrained?

No ?
 Yes

Blood Alcohol Level (mg/dl)

BAL = ?

Glasgow Coma Scale Score

GCSS = ?

Units of Blood Given



Units = ?

Arterial Blood Gases

pH = ?
 PO₂ = ?
 PCO₂ =
 HCO₃ =

Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

AUTOP. - 15000029
MULTIPLE SKULL FRACTURES - NKS
 UNSPECIFIED

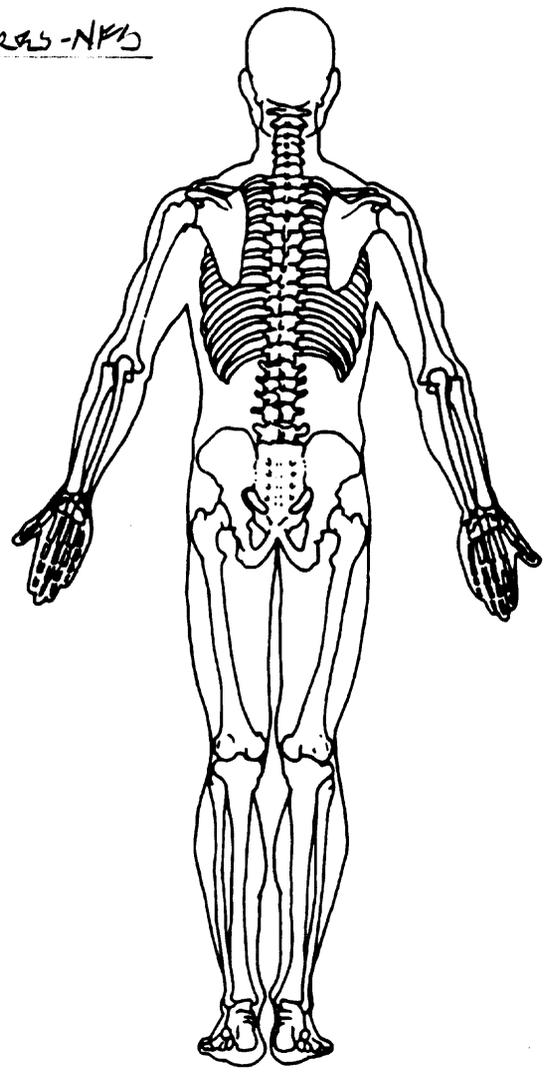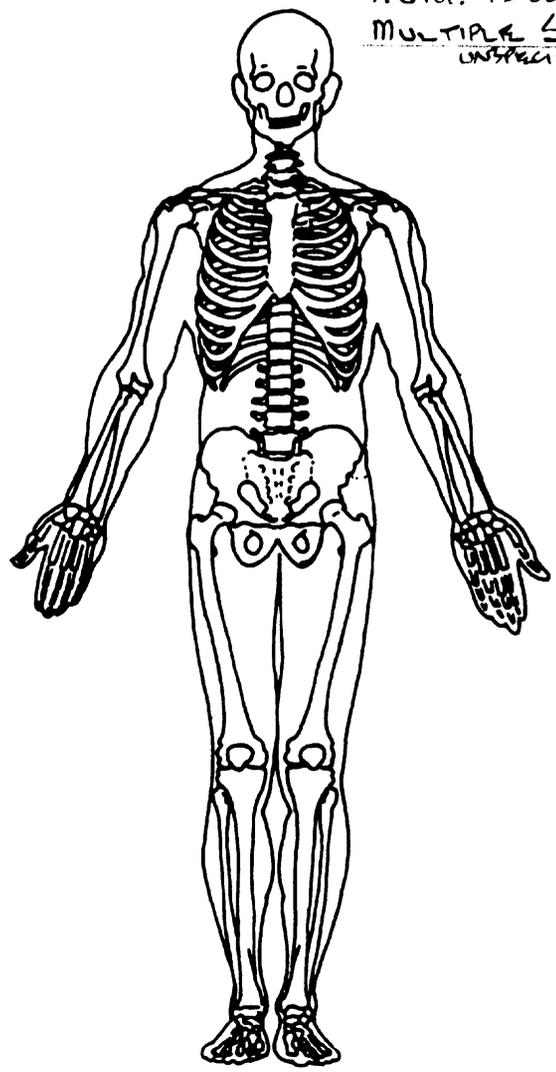

OFFICIAL INJURY DATA — INTERNAL INJURIES



Indicate the Location, Specific Anatomic Structure, Detail (size, depth, fracture type, head injury clinical signs and neurological deficits), and Source of all injuries indicated by official sources (or from PAR or other unofficial sources if medical records and interviewee data are unavailable.)

AUTOP. - 140668.3⁹
CEREBRAL EDEMA -
UNSPEC.

AUTOP. - 140466.3⁶
SUBARACHNOID HEMORRHAGE
UNSPEC.

SEVERE CLOSED HEAD INJURY

AUTOP. - 140602.3³
INTRACRANIAL CONTUSION
UNSPEC.

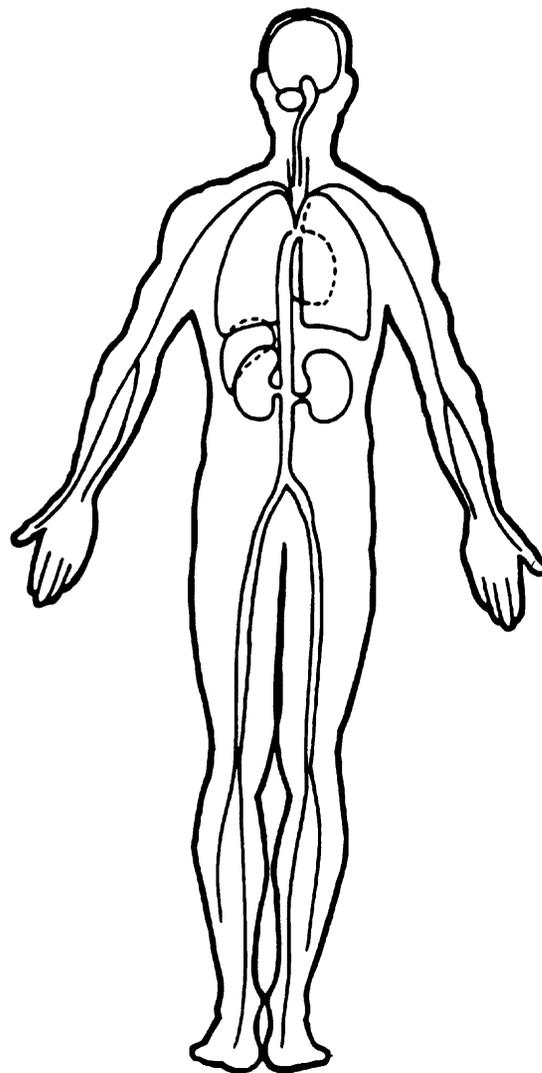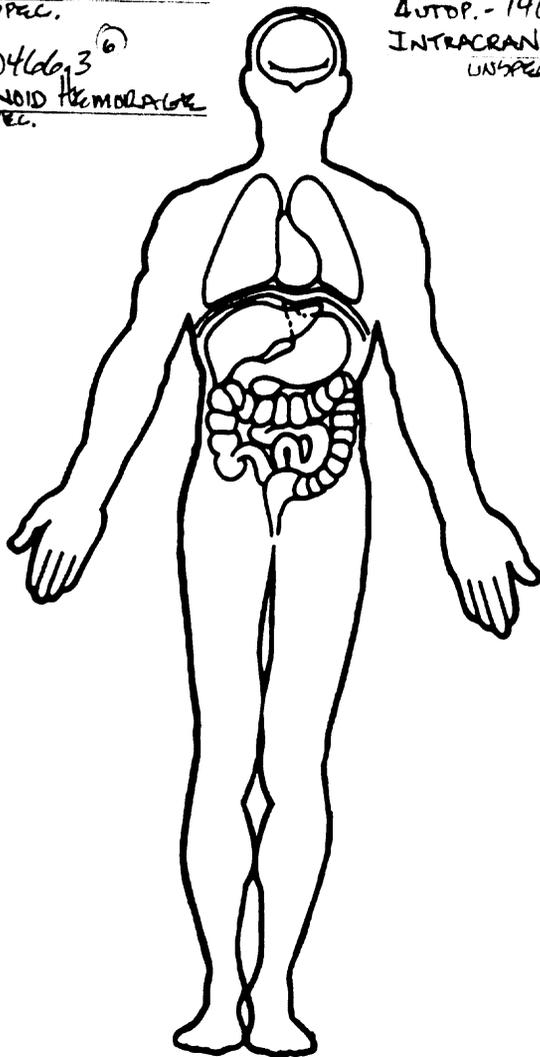



CRASHPC PROGRAM SUMMARY

(All Measurements in Metric)

Identifying Title <u>10</u>	<u>2002</u>	<u>10</u>	<u>05 01 2002</u>
Primary Sampling Unit	Case No.-Stratum	Accident Event Sequence No.	Date (Month, day, year) of Run

CRASHPC Vehicle Identification				
Vehicle 1	<u>198</u>	<u>TOYOTA</u>	<u>CELICA</u>	<u>1</u>
Vehicle 2	<u>1990</u>	<u>FORD</u>	<u>BROOK</u>	<u>2</u>
	Year	Make	Model	NASS Veh. No.

GENERAL INFORMATION

VEHICLE 1		VEHICLE 2	
Size	<u>---</u>	Size	<u>1</u>
Weight	<u>991</u> + <u>88</u> + <u>0</u> = <u>1079</u> kg	Weight	<u>1048</u> + <u>202</u> + <u>0</u> = <u>1250</u> kg
	Curb Occupant(s) Cargo		Curb Occupant(s) Cargo
CDC	<u>OK</u> <u>SAW</u>	CDC	<u>OK</u> <u>FREE</u>
PDOF (-180 to +180)	<u>0</u>	PDOF (-180 to +180)	<u>0</u>
Stiffness	<u>+050</u>	Stiffness	<u>409</u>

SCENE INFORMATION

Rest and Impact Positions No, Go To Damage Information Yes

VEHICLE 1		VEHICLE 2	
Rest Position	X <u>---</u> m Y <u>---</u> m PSI <u>---</u> °	Rest Position	X <u>---</u> m Y <u>---</u> m PSI <u>---</u> °
Impact Position	X <u>---</u> m Y <u>---</u> m PSI <u>---</u> °	Impact Position	X <u>---</u> m Y <u>---</u> m PSI <u>---</u> °
Slip Angle(-180 to +180)	<u>---</u> °	Slip Angle (-180 to +180)	<u>---</u> °

VEHICLE MOTION

Sustained Contact No Yes

VEHICLE 1		VEHICLE 2	
Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes	Vehicle Rotation	<input type="checkbox"/> No <input type="checkbox"/> Yes
Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes	Rotation Stop Before Rest	<input type="checkbox"/> No <input type="checkbox"/> Yes
End of Rotation Position	X <u>---</u> m Y <u>---</u> m PSI <u>---</u> °	End of Rotation Position	X <u>---</u> m Y <u>---</u> m PSI <u>---</u> °
Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes	Curved Path	<input type="checkbox"/> No <input type="checkbox"/> Yes
Point on Path	X <u>---</u> m Y <u>---</u> m	Point on Path	X <u>---</u> m Y <u>---</u> m
Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW	Rotation Direction	<input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW
Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes	Rotation >360°	<input type="checkbox"/> No <input type="checkbox"/> Yes

FRICITION INFORMATION

Coefficient of Friction _____
 Rolling Resistance Option _____

Vehicle 1 Rolling Resistance
 LF ____ . ____ RF ____ . ____
 LR ____ . ____ RR ____ . ____

Vehicle 2 Rolling Resistance
 LF ____ . ____ RF ____ . ____
 LR ____ . ____ RR ____ . ____

TRAJECTORY INFORMATION

Trajectory Data No Yes
 If No, Go To Damage Information

Vehicle 1 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Vehicle 2 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Terrain Boundary No Yes

First Point
 X _____ . ____ m Y _____ . ____ m

Second Point
 X _____ . ____ m Y _____ . ____ m

Secondary Coefficient of Friction _____

DAMAGE INFORMATION

VEHICLE 1		VEHICLE 2	
Damage Length	L <u>273</u> cm	Damage Length	L <u>54</u> cm
Crush Depths	C ₁ _____ <u>5</u> cm	Crush Depths	C ₁ _____ <u>22</u> cm
	C ₂ _____ <u>54</u> cm		C ₂ _____ <u>21</u> cm
	C ₃ _____ <u>53</u> cm		C ₃ _____ <u>25</u> cm
	C ₄ _____ <u>61</u> cm		C ₄ _____ <u>17</u> cm
	C ₅ _____ <u>43</u> cm		C ₅ _____ <u>0</u> cm
	C ₆ _____ <u>20</u> cm		C ₆ _____ <u>18</u> cm
Damage Offset	D ⁺ <u>10</u> cm + <u>39</u>	Damage Offset	D ⁺ _____ <u>0</u> cm

IF THIS COMMON IMPACT WAS WITH A MOTOR VEHICLE NOT IN TRANSPORT, FILL IN THE INFORMATION BELOW.

Model Year: _____
 Make: _____
 Model: _____
 VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate vehicle damage sketch and dimensions to the Form.

FINAL RUN

SUMMARY OF CRASHPC RESULTS USING DAMAGE

CRASH3 RECONSTRUCTION

SPEED CHANGE (DAMAGE)

VEHICLE #1

TOTAL	44 KPH (27 MPH)
LONGITUDINAL	-28 KPH (-18 MPH)
LATITUDINAL	-34 KPH (-21 MPH)
PDOF ANGLE	50 DEGREES
ENERGY DISSIPATED =	134533 JOULES (99213 FT-LB)

VEHICLE #2

TOTAL	38 KPH (23 MPH)
LONGITUDINAL	-29 KPH (-18 MPH)
LATITUDINAL	24 KPH (15 MPH)
PDOF ANGLE	-40 DEGREES
ENERGY DISSIPATED =	92092 JOULES (67915 FT-LB)

DAMAGE DATA

	VEHICLE #1	VEHICLE #2
SIZE CATEGORY	1	1
STIFFNESS CATEGORY	1	9
VEHICLE WEIGHT	1073 KGS (2366 LBS)	1251 KGS (2758 LBS)
CDC	O2RYAW5	11FDEW2
PDOF ANGLE	50 DEGREES	-40 DEGREES
CRUSH LENGTH	283 CM. (111 IN.)	154 CM. (61 IN.)
C1	5 CM. (2 IN.)	22 CM. (9 IN.)
C2	24 CM. (9 IN.)	21 CM. (8 IN.)
C3	53 CM. (21 IN.)	25 CM. (10 IN.)
C4	61 CM. (24 IN.)	27 CM. (11 IN.)
C5	43 CM. (17 IN.)	30 CM. (12 IN.)
C6	20 CM. (8 IN.)	38 CM. (15 IN.)
D	39 CM. (15 IN.)	0 CM. (0 IN.)
D'	53 CM. (21 IN.)	7 CM. (3 IN.)


(* INDICATES DEFAULT VALUE)

DIMENSIONS AND INERTIAL PROPERTIES

	VEHICLE #1	VEHICLE #2
CG TO FRONT AXLE	115 CM. (45 IN.)	115 CM. (45 IN.)
CG TO REAR AXLE	122 CM. (48 IN.)	122 CM. (48 IN.)
TRACK	130 CM. (51 IN.)	130 CM. (51 IN.)
CG TO FRONT OF VEH	193 CM. (76 IN.)	193 CM. (76 IN.)
CG TO REAR OF VEH	-213 CM. (-84 IN.)	-213 CM. (-84 IN.)
CG TO SIDE OF VEH	77 CM. (30 IN.)	77 CM. (30 IN.)
MOMENT OF INERTIA	5597 KGS (12338 LBS)	6525 KGS (14385 LBS)
VEHICLE MASS	3 KGS (6 LBS)	3 KGS (7 LBS)

Printing Picture:

79044B

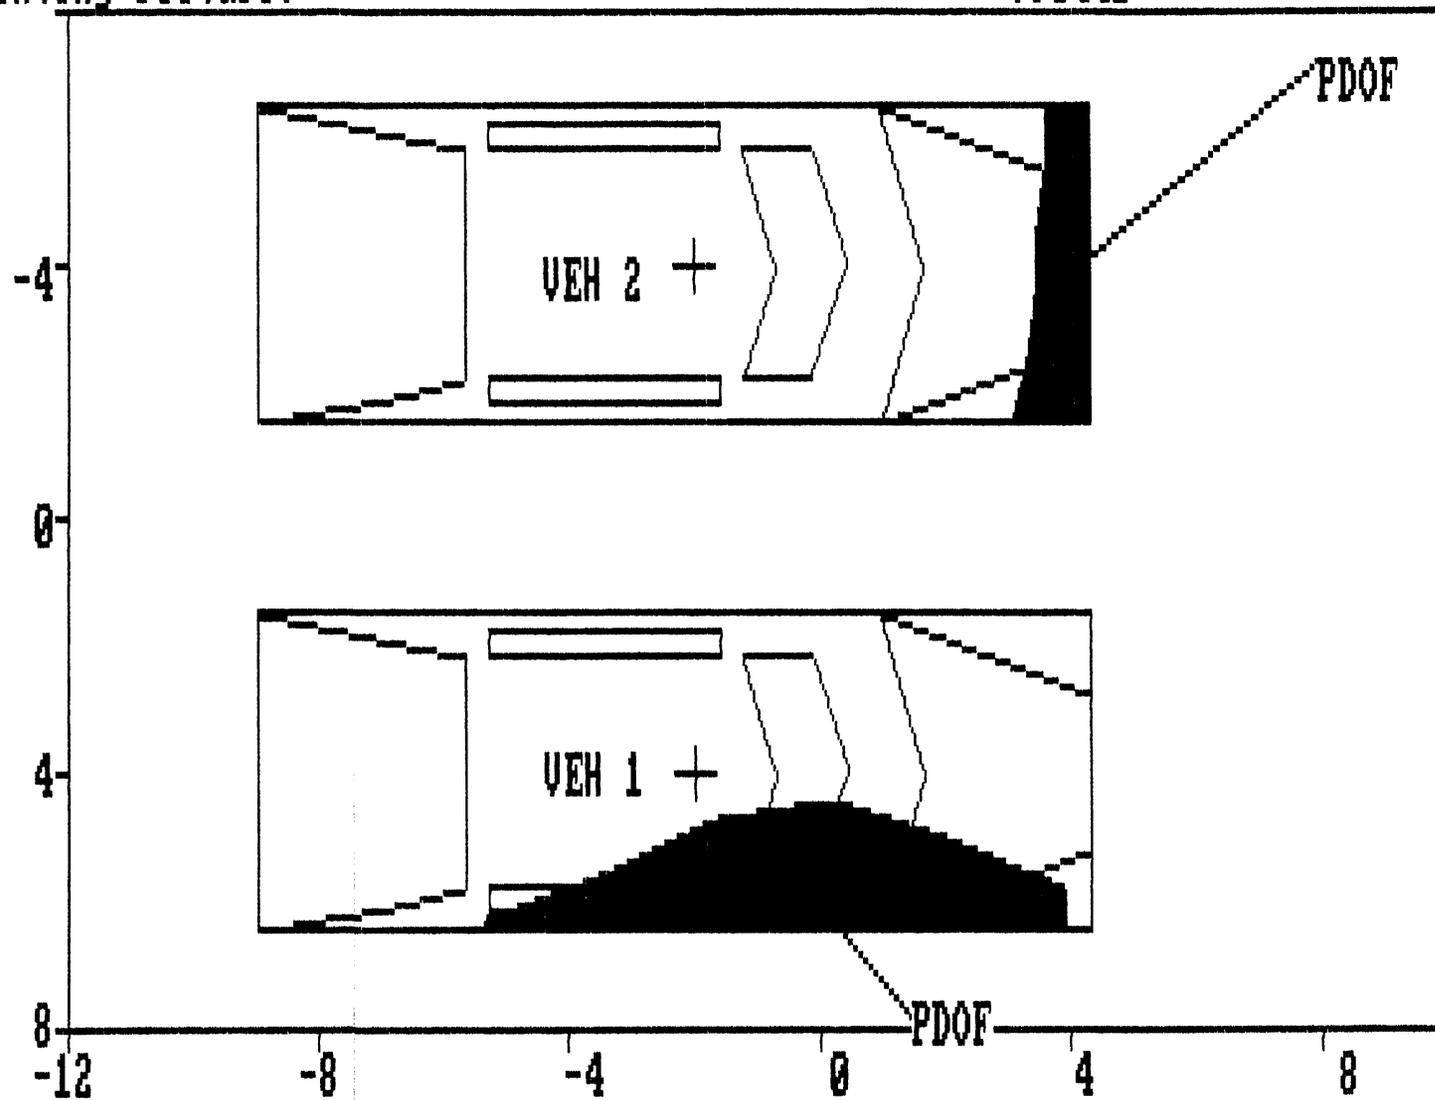

DAMAGE DESCRIPTION

SUMMARY OF CRASHPC RESULTS USING DAMAGE

CASE 044B

SPEED CHANGE
(DAMAGE)

VEHICLE #1

TOTAL 43 KPH (27 MPH)
LONGITUDINAL -21 KPH (-13 MPH)
LATITUDINAL -37 KPH (-23 MPH)
PDOF ANGLE 60 DEGREES
ENERGY DISSIPATED = 105269 JOULES (77632 FT-LB)

VEHICLE #2

TOTAL 37 KPH (23 MPH)
LONGITUDINAL -35 KPH (-22 MPH)
LATITUDINAL 13 KPH (8 MPH)
PDOF ANGLE -20 DEGREES
ENERGY DISSIPATED = 61201 JOULES (45134 FT-LB)

DAMAGE DATA

	VEHICLE #1	VEHICLE #2
SIZE CATEGORY	1	1
STIFFNESS CATEGORY	1	9
VEHICLE WEIGHT	1073 KGS (2366 LBS)	1251 KGS (2758 LBS)
CDC	02RYAW5	11FDEW2
PDOF ANGLE	60 DEGREES	-20 DEGREES
CRUSH LENGTH	283 CM. (111 IN.)	154 CM. (61 IN.)
C1	5 CM. (2 IN.)	22 CM. (9 IN.)
C2	24 CM. (9 IN.)	21 CM. (8 IN.)
C3	53 CM. (21 IN.)	25 CM. (10 IN.)
C4	61 CM. (24 IN.)	27 CM. (11 IN.)
C5	43 CM. (17 IN.)	30 CM. (12 IN.)
C6	20 CM. (8 IN.)	38 CM. (15 IN.)
D	10 CM. (4 IN.)	0 CM. (0 IN.)
D'	24 CM. (10 IN.)	7 CM. (3 IN.)


(* INDICATES DEFAULT VALUE)

DIMENSIONS AND INERTIAL PROPERTIES

	VEHICLE #1	VEHICLE #2
CG TO FRONT AXLE	115 CM. (45 IN.)	115 CM. (45 IN.)
CG TO REAR AXLE	122 CM. (48 IN.)	122 CM. (48 IN.)
TRACK	130 CM. (51 IN.)	130 CM. (51 IN.)
CG TO FRONT OF VEH	193 CM. (76 IN.)	193 CM. (76 IN.)
CG TO REAR OF VEH	-213 CM. (-84 IN.)	-213 CM. (-84 IN.)
CG TO SIDE OF VEH	77 CM. (30 IN.)	77 CM. (30 IN.)
MOMENT OF INERTIA	5597 KGS (12338 LBS)	6525 KGS (14385 LBS)
VEHICLE MASS	3 KGS (6 LBS)	3 KGS (7 LBS)

Printing Picture:

CRASH

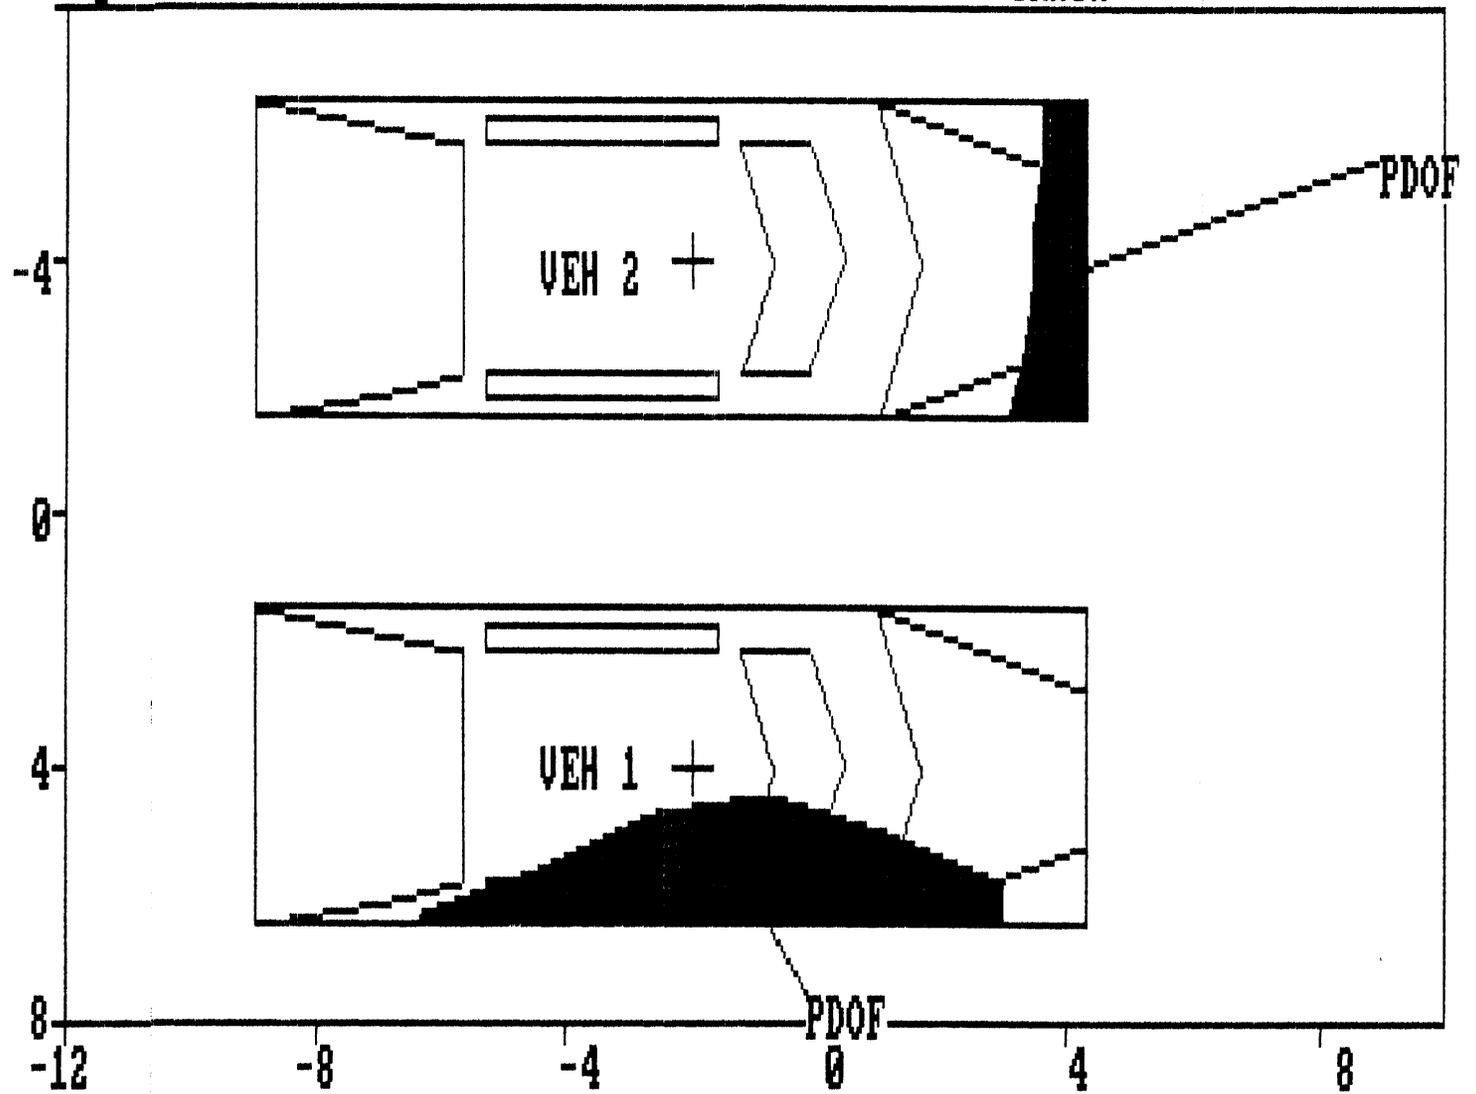

DAMAGE DESCRIPTION



CRASHPC PROGRAM SUMMARY

(All Measurements in Metric)

Identifying Title			
Primary Sampling Unit	Case No.-Stratum	Accident Event Sequence No.	Date (Month, day, year) of Run

CRASHPC Vehicle Identification				
Vehicle 1	Year	Make	Model	NASS Veh. No.
Vehicle 2	Year	Make	Model	NASS Veh. No.

GENERAL INFORMATION

VEHICLE 1			VEHICLE 2		
Size	_____		Size	_____	
Weight	_____ kg		Weight	_____ kg	
Curb + Occupant(s) + Cargo = _____ kg			Curb + Occupant(s) + Cargo = _____ kg		
CDC	_____ °		CDC	_____ °	
PDOF (-180 to +180)	_____ °		PDOF (-180 to +180)	_____ °	
Stiffness	_____		Stiffness	_____	

SCENE INFORMATION

Rest and Impact Positions <input checked="" type="checkbox"/> No, Go To Damage Information <input type="checkbox"/> Yes					
VEHICLE 1			VEHICLE 2		
Rest Position	X	_____ m	Rest Position	X	_____ m
	Y	_____ m		Y	_____ m
	PSI	_____ °		PSI	_____ °
Impact Position	X	_____ m	Impact Position	X	_____ m
	Y	_____ m		Y	_____ m
	PSI	_____ °		PSI	_____ °
Slip Angle(-180 to +180)	_____ °		Slip Angle (-180 to +180)	_____ °	

VEHICLE MOTION

Sustained Contact <input type="checkbox"/> No <input type="checkbox"/> Yes					
VEHICLE 1			VEHICLE 2		
Vehicle Rotation <input type="checkbox"/> No <input type="checkbox"/> Yes			Vehicle Rotation <input type="checkbox"/> No <input type="checkbox"/> Yes		
Rotation Stop Before Rest <input type="checkbox"/> No <input type="checkbox"/> Yes			Rotation Stop Before Rest <input type="checkbox"/> No <input type="checkbox"/> Yes		
End of Rotation Position	X	_____ m	End of Rotation Position	X	_____ m
	Y	_____ m		Y	_____ m
	PSI	_____ °		PSI	_____ °
Curved Path <input type="checkbox"/> No <input type="checkbox"/> Yes			Curved Path <input type="checkbox"/> No <input type="checkbox"/> Yes		
Point on Path			Point on Path		
X	_____ m	Y	_____ m	X	_____ m
Rotation Direction <input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW			Rotation Direction <input type="checkbox"/> None <input type="checkbox"/> CW <input type="checkbox"/> CCW		
Rotation >360° <input type="checkbox"/> No <input type="checkbox"/> Yes			Rotation >360° <input type="checkbox"/> No <input type="checkbox"/> Yes		

FRICTION INFORMATION

TRAJECTORY INFORMATION

Coefficient of Friction . _____
 Rolling Resistance Option _____

Vehicle 1 Rolling Resistance
 LF _____ RF _____
 LR _____ RR _____

Vehicle 2 Rolling Resistance
 LF _____ RF _____
 LR _____ RR _____

Trajectory Data No Yes
 If No, Go To Damage Information

Vehicle 1 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Vehicle 2 Steer Angles
 LF _____ ° RF _____ °
 LR _____ ° RR _____ °

Terrain Boundary No Yes

First Point
 X _____ m Y _____ m

Second Point
 X _____ m Y _____ m

Secondary Coefficient of Friction _____

DAMAGE INFORMATION

VEHICLE 1
 Damage Length L _____ 5 _____ cm
 Crush Depths C₁ _____ 2 _____ cm
 C₂ _____ 5 _____ cm
 C₃ _____ 8 _____ cm
 C₄ _____ 8 _____ cm
 C₆ _____ 6 _____ cm
 C₆ _____ 7 _____ cm
 Damage Offset D ± _____ 10 _____ cm

VEHICLE 2
 Damage Length L _____ 30LE _____ cm
 Crush Depths C₁ _____ cm
 C₂ _____ cm
 C₃ _____ cm
 C₄ _____ cm
 C₆ _____ cm
 C₆ _____ cm
 Damage Offset D ± _____ cm

IF THIS COMMON IMPACT WAS WITH A MOTOR VEHICLE *NOT IN TRANSPORT*, FILL IN THE INFORMATION BELOW.

Model Year: _____
 Make: _____
 Model: _____
 VIN: _____

The Weight, CDC, Scene Data and Damage Information for this vehicle should be recorded above.

Complete and ATTACH the appropriate vehicle damage sketch and dimensions to the Form.

SUMMARY OF CRASHPC RESULTS USING DAMAGE

CASE 044B V1 SECONDARY IMPACT

	SPEED CHANGE (DAMAGE)
VEHICLE #1	
TOTAL	6 KPH (4 MPH)
LONGITUDINAL	2 KPH (1 MPH)
LATITUDINAL	6 KPH (4 MPH)
PDOF ANGLE	-110 DEGREES
ENERGY DISSIPATED =	5094 JOULES (3756 FT-LB)

VEHICLE #2	
TOTAL	0 KPH (0 MPH)
LONGITUDINAL	0 KPH (0 MPH)
LATITUDINAL	0 KPH (0 MPH)
PDOF ANGLE	0 DEGREES
ENERGY DISSIPATED =	0 JOULES (0 FT-LB)

DAMAGE DATA

	VEHICLE #1	VEHICLE #2
SIZE CATEGORY	1	11
STIFFNESS CATEGORY	1	0
VEHICLE WEIGHT	1073 KGS (2366 LBS)	***** KGS (2204586 LBS) *
CDC	08LBEW3	BARRIER
PDOF ANGLE	-110 DEGREES	0 DEGREES *
CRUSH LENGTH	115 CM. (45 IN.)	0 CM. (0 IN.) *
C1	10 CM. (4 IN.)	0 CM. (0 IN.) *
C2	10 CM. (4 IN.)	0 CM. (0 IN.) *
C3	18 CM. (7 IN.)	0 CM. (0 IN.) *
C4	18 CM. (7 IN.)	0 CM. (0 IN.) *
C5	6 CM. (2 IN.)	0 CM. (0 IN.) *
C6	0 CM. (0 IN.)	0 CM. (0 IN.) *
D	-191 CM. (-75 IN.)	0 CM. (0 IN.) *
D'	-198 CM. (-78 IN.)	0 CM. (0 IN.) *


(* INDICATES DEFAULT VALUE)

DIMENSIONS AND INERTIAL PROPERTIES

	VEHICLE #1	VEHICLE #2
CG TO FRONT AXLE	115 CM. (45 IN.)	127 CM. (50 IN.)
CG TO REAR AXLE	122 CM. (48 IN.)	127 CM. (50 IN.)
TRACK	130 CM. (51 IN.)	127 CM. (50 IN.)
CG TO FRONT OF VEH	193 CM. (76 IN.)	127 CM. (50 IN.)
CG TO REAR OF VEH	-213 CM. (-84 IN.)	-127 CM. (-50 IN.)
CG TO SIDE OF VEH	77 CM. (30 IN.)	127 CM. (50 IN.)
MOMENT OF INERTIA	5597 KGS (12338 LBS)	***** KGS (***** LBS)
VEHICLE MASS	3 KGS (6 LBS)	2600 KGS (5732 LBS)

Printing Picture:

CRASH

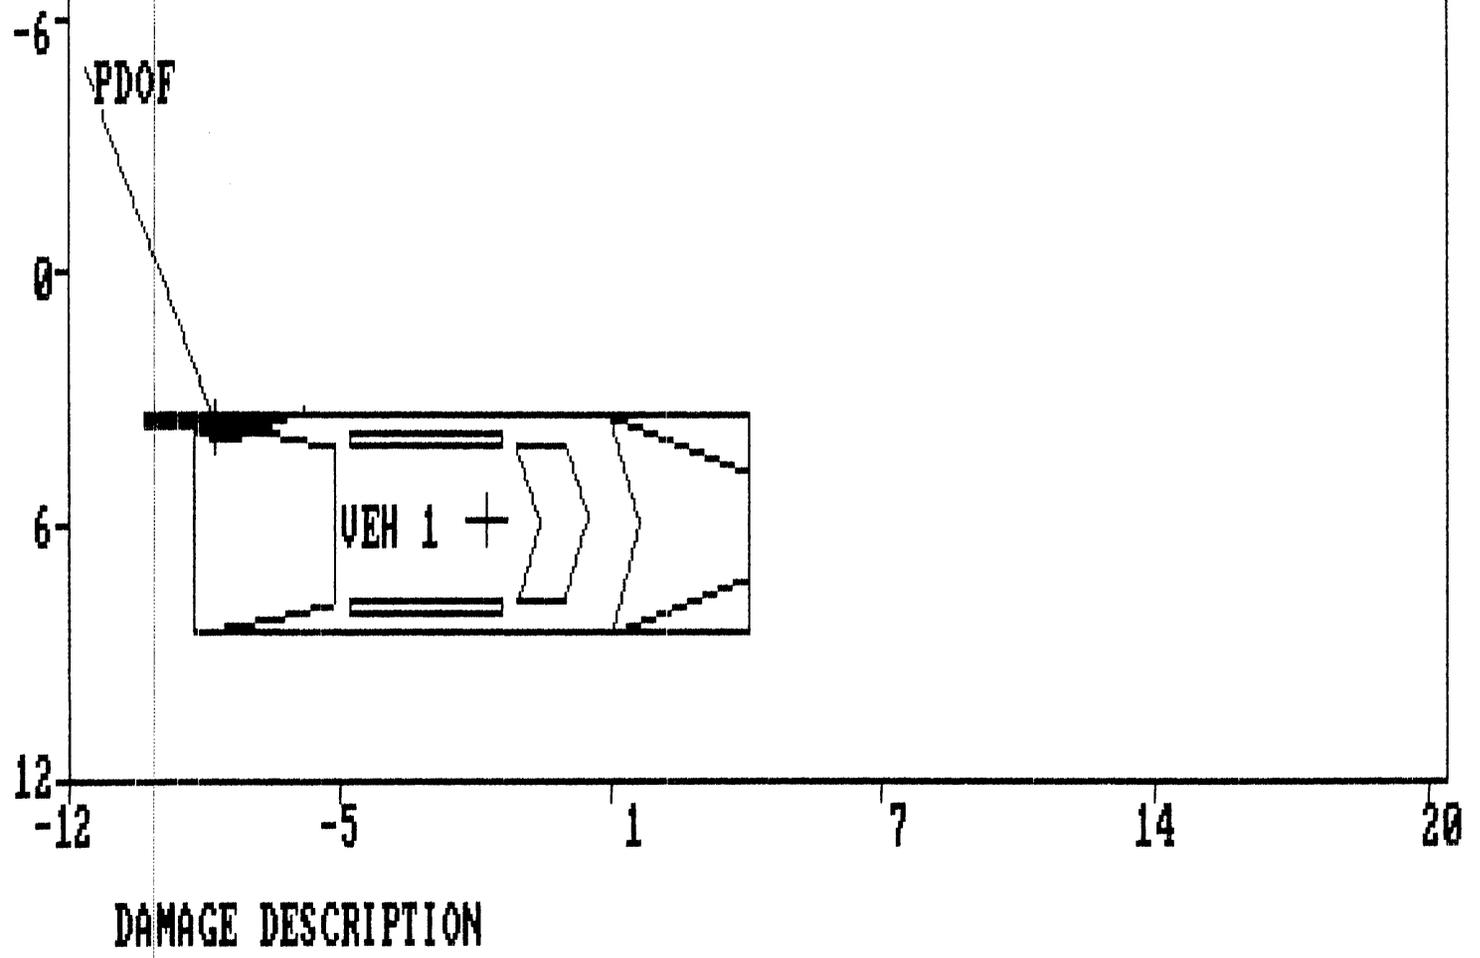

GENERAL VEHICLE Vehicle: 1

11

INTRA ERRORS

0GG0421 2 If ROLLOVER GV24 equals 1-9, then BASIS FOR DELTA V GV29 should
GG0422 equal 4 or 5.

0

INTERIOR VEHICLE Vehicle: 2

11

INTRA ERRORS

OCC0531 2 ***** THIS CASE SHOWS A DOOR OR HATCH OR GATE OPENING *****
CC0532 ***** CHECK YOUR DATA AND IF CORRECT, NOTIFY YOUR ZONE *****
CC0533 DOOR LEFT FRONT IV05 equals 2 or IV06 equals 2 or IV07 equals 2
CC0534 or IV08 equals 2 or IV09 equals 2.

0

OCCUPANT ASSESSMENT Vehicle: 2 Occupant: 1

11

INTRA ERRORS

OHH1091 2 If TREATMENT DA35 equals 0, 4 or 5, then WORKING DAYS LOST DA38
HH1092 should equal 00, 01, 97 or 99.

0

OCCUPANT INJURY Vehicle: 2 Occupant: 1

11

INTRA ERRORS

OTT0541 2 ***** THIS CASE SHOWS A RESTRAINT AS THE INJURY SOURCE *****
TT0542 ***** FOR AN AIS-2 (OR GREATER) INJURY. *****
TT0543 ***** CHECK FOR ACCURATE AND COMPLETED DOCUMENTS & DATA *****
TT0544 INJURY SOURCE OI12(n) equals 41, 42, 43 or 45 and A.I.S.
TT0545 SEVERITY OI10(n) is greater than 1.

0

OCCUPANT ASSESSMENT Vehicle: 2 Occupant: 2

11
INTRA ERRORS

OHH1091 2 If TREATMENT OA35 equals 0, 4 or 5, then WORKING DAYS LOST OA38
HH1092 should equal 00, 01, 97 or 99.

0
OCCUPANT INJURY Vehicle: 2 Occupant: 2
11
INTRA ERRORS

OTT0541 2 ***** THIS CASE SHOWS A RESTRAINT AS THE INJURY SOURCE *****
TT0542 ***** FOR AN AIS-2 (OR GREATER) INJURY. *****
TT0543 ***** CHECK FOR ACCURATE AND COMPLETED DOCUMENTS & DATA *****
TT0544 INJURY SOURCE OI12(n) equals 41, 42, 43 or 45 and A.I.S.
TT0545 SEVERITY OI10(n) is greater than 1.

TT0541 2 ***** THIS CASE SHOWS A RESTRAINT AS THE INJURY SOURCE *****
TT0542 ***** FOR AN AIS-2 (OR GREATER) INJURY. *****
TT0543 ***** CHECK FOR ACCURATE AND COMPLETED DOCUMENTS & DATA *****
TT0544 INJURY SOURCE OI12(n) equals 41, 42, 43 or 45 and A.I.S.
TT0545 SEVERITY OI10(n) is greater than 1.

TT0541 2 ***** THIS CASE SHOWS A RESTRAINT AS THE INJURY SOURCE *****
TT0542 ***** FOR AN AIS-2 (OR GREATER) INJURY. *****
TT0543 ***** CHECK FOR ACCURATE AND COMPLETED DOCUMENTS & DATA *****
TT0544 INJURY SOURCE OI12(n) equals 41, 42, 43 or 45 and A.I.S.
TT0545 SEVERITY OI10(n) is greater than 1.

01
INTER ERRORS

OEHO011 2 If TREATMENT OA35 equals 1, then 1st DEFORMATION EXTENT EV11
EH0012 should be greater than 03. GV=02 OA=03

PSU79 ERROR SUMMARY SCREEN 07/21/94
CASE 044B
CURRENT VERSION: 7.00

FORM NAME	NUMBER OF DOLLAR SIGNS	NUMBER OF LEVEL 1 ERRORS	NUMBER OF LEVEL 2 ERRORS	VERSION NUMBER CONSISTENT
Accident	0	0	0	Y
General Vehicle	0	0	1	Y
Vehicle Exterior	0	0	0	Y
Vehicle Interior	0	0	1	Y
Occupant Assesment	0	0	2	Y
Occupant Interior	0	0	4	Y
Total Inter Errors		0	1	
Total Case Errors	0	0	9	



PSU 79-044B (1994) #1



PSU 79-044B (1994) #2



PSU 79-044B (1994) #3



PSU 79-044B (1994) #4



PSU 79-044B (1994) #5



PSU 79-044B (1994) #8



PSU 79-044B (1994) #7



PSU 79-044B (1994) #8



PSU 79-044B (1994) #9



PSU 79-044B (1994) #10



PSU 79-044B (1994) #11



PSU 78-044B (1994) #12



PSU 78-044B (1994) #13



PSU 79-044B (1994) #14



PSU 79-044B (1994) #15



PSU 79-044B (1994) #16



PSU 79-044B (1994) #17
Best Available



PSU 79-044B (1994) #18
Best Available



PSU 79-044B (1994) #19
Best Available



PSU 79-044B (1994) #20
Best Available



PSU 79-044B (1994) #21



PSU 79-044B (1994) # 22



PSU 79-044B (1994) #23




**FSU 79-044B (1994) #24
Best Available**



PSU 79-044B (1994) #25
Best Available



PSU 79-044B (1994) #26
Best Available

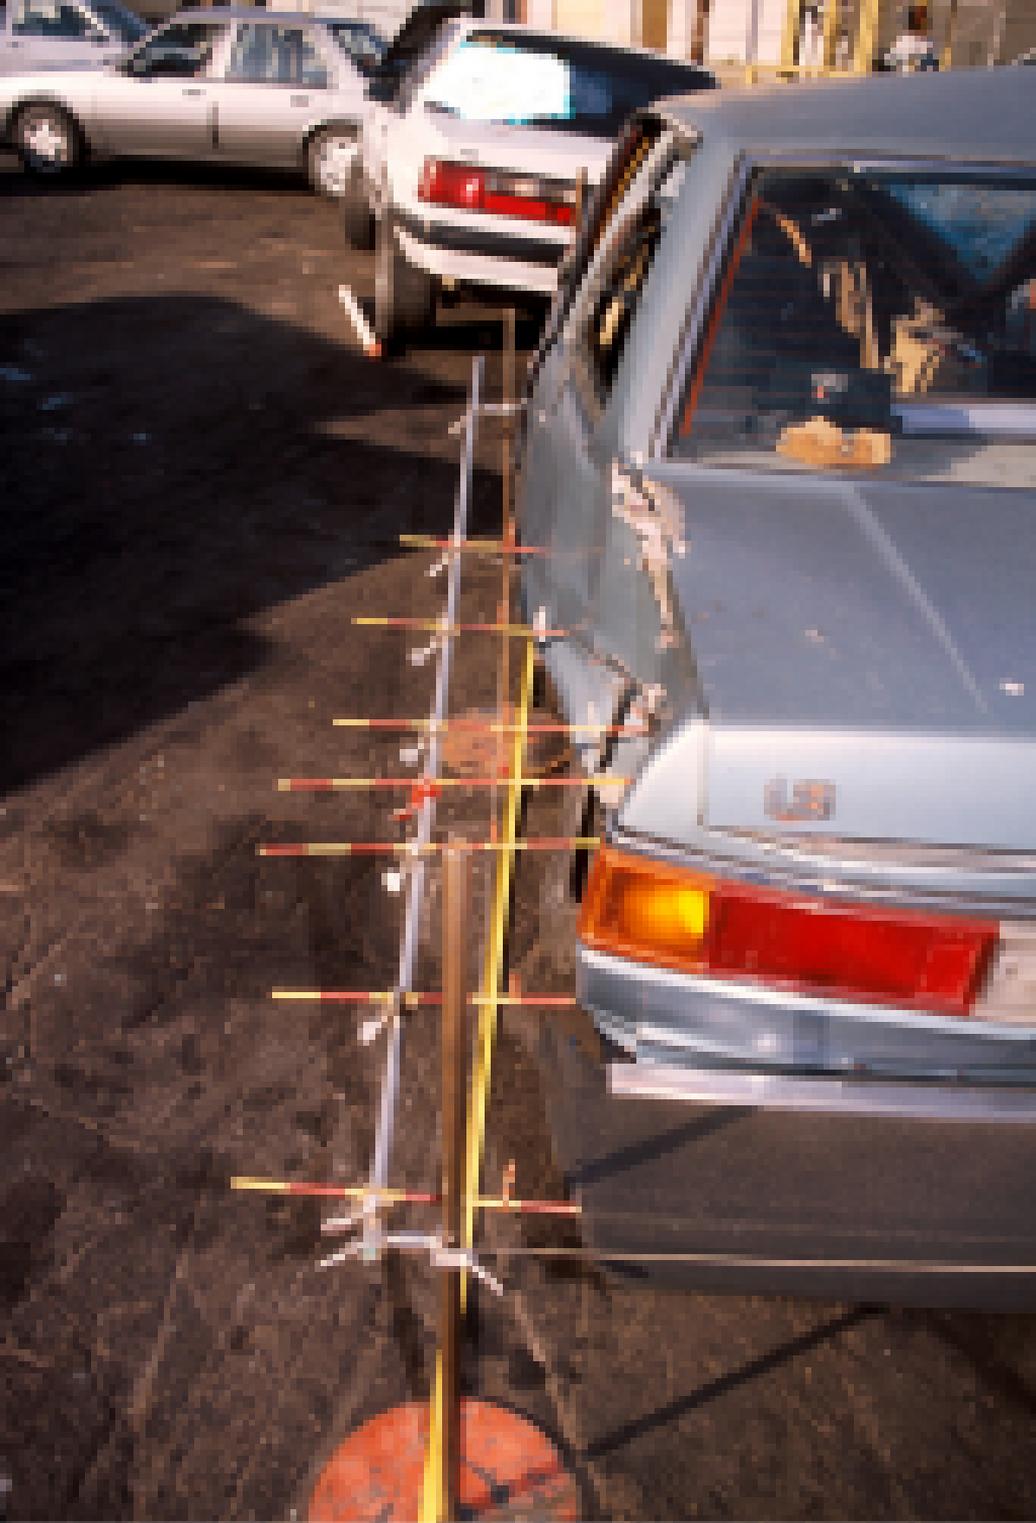

PSU 79-044B (1994) #27
Best Available



PSU 79-044B (1994) #28
Best Available



PSU 79-0448 (1994) #29

Best Available



PSU 79-044B (1994) #30

Best Available



PSU 79-044B (1994) #31



PSU 79-044B (1994) #32
Best Available



PSU 79-044B (1994) #33
Best Available



PSU 79-044B (1994) #34
Best Available



PSU 79-044B (1994) #35
Best Available



PSU 79-044B (1994) #36
Best Available



PSU 79-044B (1994) #37



PSU 79-044B (1994) #38



PSU 79-044B (1994) #39



PSU 79-0448 (1994) #40



PSU 79-044B (1994) #41
Best Available



PSU 79-044B (1994) #42
Best Available



PSU 79-044B (1994) #43
Best Available



PSU 79-044B (1994) #44
Best Available



PSU 79-044B (1994) #45



PSU 79-044B (1994) #46
Best Available



PSU 78-044B (1994) #47



PSU 79-044B (1984) #48



PSU 79-044B (1994) #49



PSU 79-044B (1994) #50



PSU 79-044B (1994) #51



PSU 79-044B (1994) #52



PSU 79-044B (1994) #53



PSU 79-044B (1994) #54



PSU 79-044B (1994) #55



PSU 79-044B (1994) #56



PSU 79-044B (1894) #57



PSU 78-044B (1994) #58



PSU 79-044B (1994) #59



PSU 79-044B (1994) #60



PSU 79-044B (1994) #61



PSU 79-044B (1994) #62



PSU 79-044B (1994) #63



PSU 79-044B (1994) #84



PSU 79-044B (1994) #65



PSU 79-044B (1994) #68



PSU 79-044B (1994) #67

Best Available



PSU 79-044B (1994) #68
Best Available



PSU 79-044B (1994) #69
Best Available



PSU 79-044B (1994) #70
Best Available



PSU 79-044B (1994) #71
Best Available



PSU 79-044B (1994) #72
Best Available



PSU 79-044B (1994) #73
Best Available



PSU 79-044B (1994) #74
Best Available



PSU 79-044B (1994) #75
Best Available



PSU 79-044B (1994) #76
Best Available



PSU 79-044B (1994) #77
Best Available



PSU 79-044B (1994) #76

Best Available



PSU 79-044B (1994) #79
Best Available



PSU 79-044B (1994) #80
Best Available



PSU 79-044B (1994) #81
Best Available



**PSU 79-044B (1984) #82
Best Available**



PSU 79-044B (1994) #83
Best Available



PSU 79-044B (1994) #84
Best Available



PSU 79-044B (1994) #85
Best Available



PSU 79-044B (1994) #86



PSU 79-044B (1994) #87
Best Available



PSU 79-0448 (1994) #88
Best Available



PSU 79-044B (1994) #89
Best Available



PSU 79-044B (1994) #90
Best Available



PSU 79-044B (1994) #91

Best Available



PSU 79-044B (1994) #92
Best Available



PSU 79-044B (1994) #93
Best Available



PSU 79-044B (1994) #94
Best Available



PSU 79-044B (1994) #95
Best Available



PSU 79-044B (1994) #96



PSU 79-044B (1994) #97
Best Available



PSU 79-044B (1994) #98
Best Available



PSU 79-044B (1994) #98



PSU 79-044B (1994) #100



PSU 79-044B (1994) #101



PSU 79-044B (1994) #102



PSU 79-044B (1994) #103



PSU 79-044B (1994) #104




PSU 79-044B (1994) #105



PSU 79-044B (1994) #106



PSU 79-044B (1994) #107

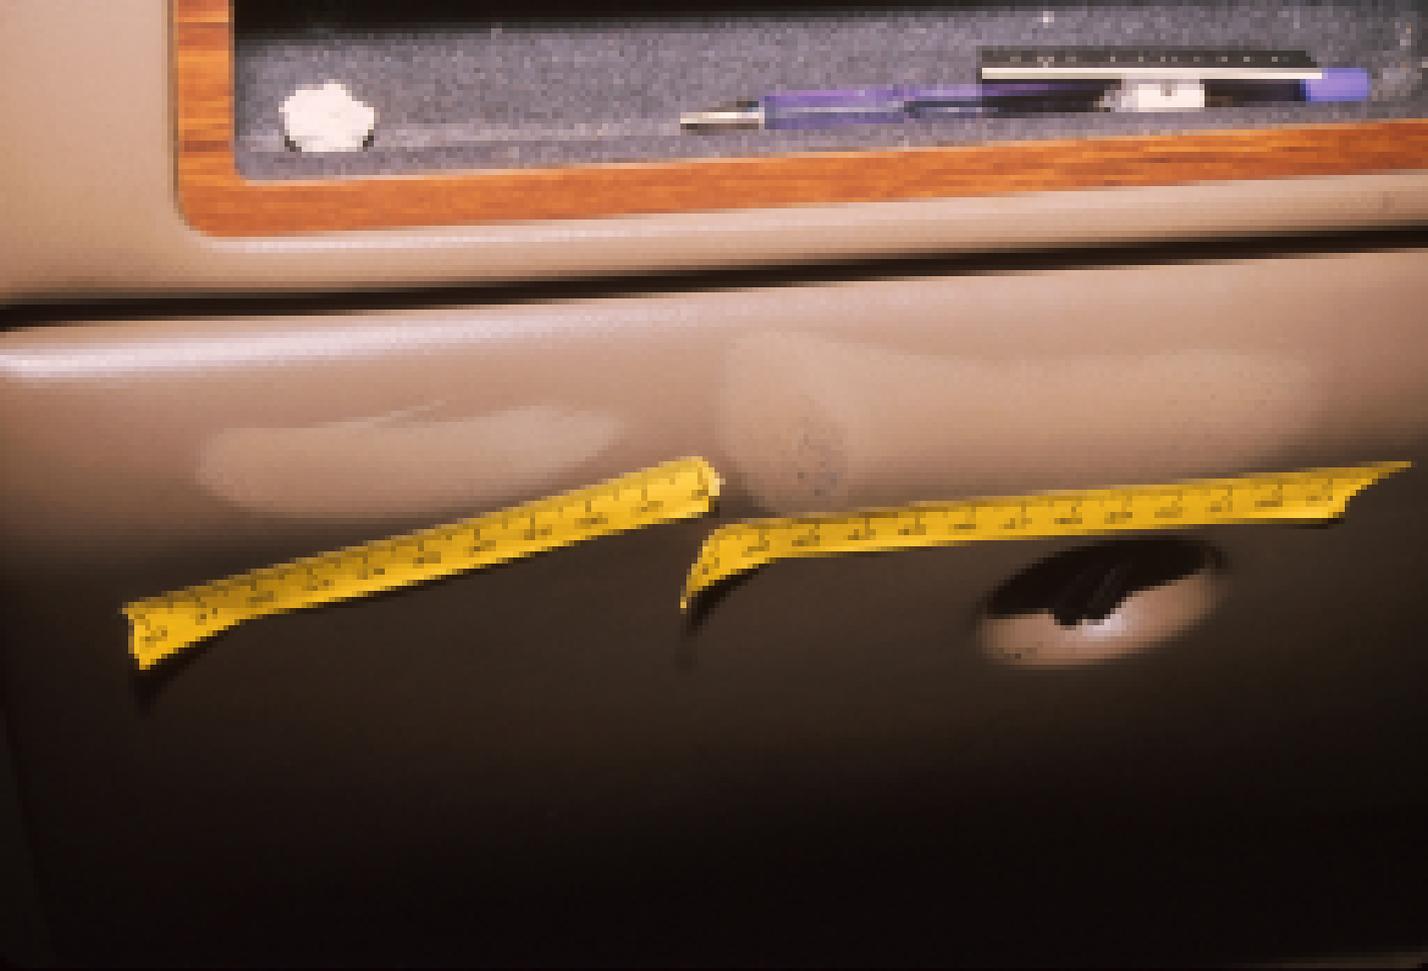

PSU 79-044B (1994) #108



PSU 79-044B (1994) #109



PSU 79-044B (1994) #110



PSU 79-044B (1994) #111



PSU 79-044B (1994) #112



PSU 79-044B (1994) #113



PSU 79-044B (1994) #114



PSU 79-044B (1994) #115



PSU 79-044B (1994) #116



PSU 79-044B (1994) #117



PSU 79-044B (1994) #118



PSU 79-044B (1994) #119